


Digital Load Cell Indicator Model TD-I-1050

Instruction Manual

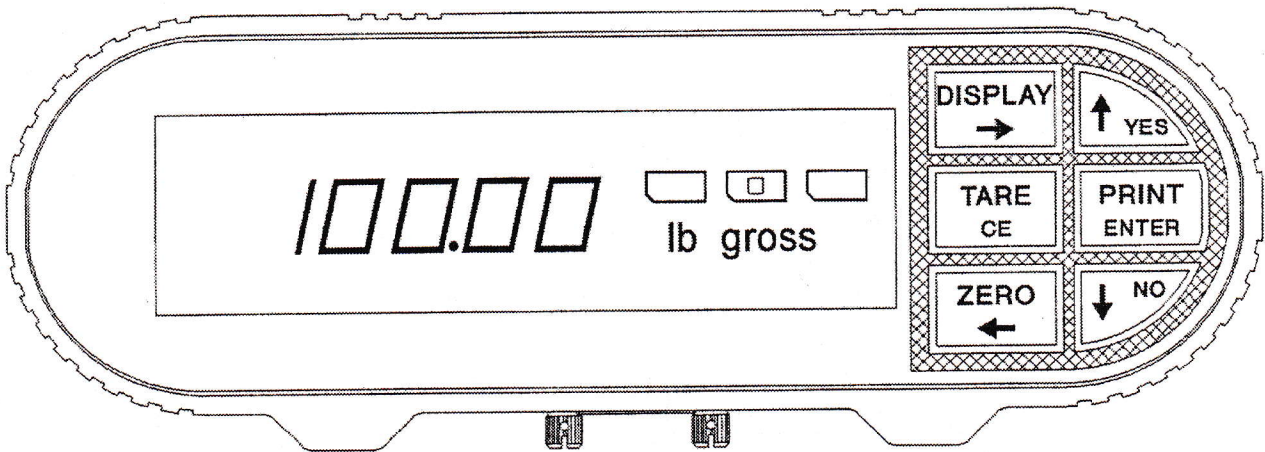

Contents	Page
Load cell wiring	2
Calibration	3
Setup Configure	4
Setup Input/Output	5
Setup Units	6
Setup Port 2	7
Balance multiple cells	8
Factory setup	9
Front Panel lights & buttons	9
Specifications	10

Load cell wiring connections

If (1) load cell is connected to indicator, it must have address 01.

If (4) load cells are connected to indicator, they must have addresses 01, 02, 03, 04.

Terminal Blocks

TB3-10	- OUT	P2
	+ OUT	P2
	- IN	P1
	+ IN	P1
TB3-6	- OUT	A
TB3-5	+ OUT	B
	SIG COM	
	IN	P1
	OUT	P1
TB3-1	OUT	
TB2-3	IN	P1
TB2-2	OUT	P1
TB2-1	OUT	
TB1-6	- EXC	
	- SENSE	
	- SIG	
	+ SIG	
	+ SENSE	
TB1-1	+ EXC	

----- Black (-RS485) ----- White (+RS485) Pair RS485 Communications

----- Black (0VDC Ref) ----- Red (+12VDC) Pair 12VDC power

Calibration

1. Internal MAIN MODE switch S1-1 to "CLOSED". Do **not** use CAL MODE switch S1-2.
2. Display **SEt** **AUTO** ? Press **NO(↓)**
3. Display **SEt-UP** **CONFIG** ? Press **NO(↓)**
4. Display - - - - **CAL** ? Press **YES(↑)**
5. Display **10000** **CAPACITY** ← or → will position flashing digit. **YES(↑)** or **NO(↓)** will change value.
Press **ENTER** if value has been changed.
6. Press **NO(↓)** for next step or **YES(↑)** **YES(↑)** for previous step.
7. Display **10000** **X 1** Change with ← or →
.0001 .0002 .0005 .001 .002 .005 .01 .02 .05 .1 .2 .5 1 2 5 10 20 50 100
8. Press **NO(↓)** for next step or **YES(↑)** for previous step.
9. Display **10000** **LB** Change with ← or →
LB KG OZ GRAM(g) GRAIN(gr) TON(tn) DRAM(dr) MTON(mt)
10. Press **NO(↓)** for next step or **YES(↑)** for previous step.
11. Display **Actual** **ZERO CAL** With no test load, press **ENTER**. Display **CAL OK**.
12. Display **Actual** **SPAN CAL** Change span cal target value (Test Load) with ← or → keys and **YES(↑)** or **NO(↓)** keys.
With test load on scale, press **ENTER**. Display **SPAN OK**.
13. Display **Actual** **FILTR 10** Change with ← or → Larger numbers have more filtering.
1 2 3 4 5 6 7 8 9 10 12 14 16 18 20 25 30 35 40 45 50
14. Cal switch S1-1 to "OPEN". Calibration is complete.

Note: If "?" is flashing, press **YES(↑)** or **NO(↓)** keys only. The other keys will not work.
To EXIT the Calibration program at any point set Main Mode switch S1-1 to "OPEN".

Set Up Configure

1. Internal MAIN MODE switch S1-1 to "CLOSED".

2. Display **SET** **AUTO** ? Press **NO(↓)**

3. Display **SET-UP** **CONFIG** ? Press **YES(↑)**

Press **NO(↓)** to go down the SET UP CONF list or **YES(↑)** to go up the list.

Available settings (Change with ← or → arrow keys.)

4. Display **Actual** **FILTR 1** 1 2 3 4 5 6 7 8 9 10 12 14 16 18 20 25 30 35 40 45 50

5. Display **Auto** **DSP/SEC** 2 3 5 Auto

6. Display **oFF** **ZERO %** 2 5 10 20 100 oFF "oFF" will disable ZERO button.

7. Display **oFF** **AZM +/-** 0.5 1 3 5 10 oFF "oFF" will disable auto zero tracking.

8. Display **oFF** **MOTION** 1 3 5 10 20 50 oFF

9. Display **oFF** **AUTO TR** on oFF "on" will enable TARE button.

10. Display **oFF** **CONV.** on oFF "on" will enable multiple units with **NO(↓)** **YES(↑)** arrows.

11. Display **oFF** **LINEAR** on oFF

12. Display **oFF** **MIN** on oFF

13. Display **oFF** **MAX** on oFF

14. Display **oFF** **FREEZE** on oFF

15. Display **SET-UP** **EXIT ?** **YES** will return to main menu (- - - - **CAL ?**)

16. Mode switch S1-1 to "OPEN". Set Up Configure is complete.

Note: If "?" is flashing, press **YES(↑)** or **NO(↓)** keys only. The other keys will not work.

To EXIT the Set Up Configure program at any point set Main Mode switch S1-1 to "OPEN".

Set Up Input/Output

1. Internal MAIN MODE switch S1-1 to "CLOSED".

- | | | | | |
|------------|---------------|---------------|---|---------------------|
| 2. Display | SEt | AUTO | ? | Press NO(↓) |
| 3. Display | SEt-UP | CONFIG | ? | Press NO(↓) |
| 4. Display | - - - - | CAL | ? | Press NO(↓) |
| 5. Display | SEt-UP | I/O | ? | Press YES(↑) |

Press **NO(↓)** to go down the SET UP I/O list or **YES(↑)** to go up the list.

Available settings (Change with ← or → arrow keys.)

- | | | | |
|-------------|---------------|-------------------|--|
| 6. Display | SEt-UP | PORT 2 | To setup port 2 press YES and refer to page Setup Port 2. |
| 7. Display | SEt-UP | TIME&D | |
| 8. Display | SEt-UP | PARAL | |
| 9. Display | SEt-UP | ANALOG | |
| 10. Display | SEt-UP | IN/OUT | |
| 11. Display | SEt-UP | EXIT ? | YES will return to main menu (SEt-UP I/O ?) |

12. Mode switch S1-1 to "OPEN". Set Up Input/Output is complete.

Note: If "?" is flashing, press **YES(↑)** or **NO(↓)** keys only. The other keys will not work.
To EXIT the Set Up Input/Output program at any point set Main Mode switch S1-1 to "OPEN".

Set Up Units

Note: Make sure that in the Set Up Configure parameters on page 4 **CONV** is set **on**

1. Internal MAIN MODE switch S1-1 to "CLOSED".

2. Display	SET	AUTO	?	Press NO(↓)
3. Display	SET-UP	CONFIG	?	Press NO(↓)
4. Display	- - - -	CAL	?	Press NO(↓)
5. Display	SET-UP	I/O	?	Press NO(↓)
6. Display	- - - -	CONV.	?	Press YES(↑)

Press **NO(↓)** to go down the UNITS list or **YES(↑)** to go up the list.

Available settings (Change with ← or → arrow keys.)

7. Display	on	LB	on oFF
8. Display	on	KG	on oFF
9. Display	oFF	OZ	on oFF
10. Display	oFF	GRAM(g)	on oFF
11. Display	oFF	GRAIN(gr)	on oFF
12. Display	oFF	TON(tn)	on oFF
13. Display	oFF	DRAM(dr)	on oFF
14. Display	oFF	MTON(mt)	on oFF
15. Display	SET-UP	EXIT	? YES will return to main menu (- - - CONV. ?)

16. Mode switch S1-1 to "OPEN". Set Up Inits is complete.

Note: If "?" is flashing, press **YES(↑)** or **NO(↓)** keys only. The other keys will not work.
To EXIT the Set Up Units program at any point set Main Mode switch S1-1 to "OPEN".

Set Up Port 2

1. This setup continues from Setup Input/Output Port 2

Press **NO(↓)** to go down the SET UP Port 2 list or **YES(↑)** to go up the list.

	Display		Available settings (Change with ← or → arrow keys.)
2. Display	PORT 2	PRINTER	PRINTER SIMPLEX OFF
3. Display	SEt P2	AUTO PR ?	
4. Display	baud	9600	600 1200 2400 4800 9600 19200
5. Display	Parity	ODD	EVEN ODD MARK NONE
6. Display	PORT 2	STANDARD	STANDARD MODIFY CUSTOM
7. Display	PORT 2	EXIT ?	YES will return to (SEt-UP Port 2 ?)

Note: If “?” is flashing, press **YES(↑)** or **NO(↓)** keys only. The other keys will not work.
To EXIT the Set Up Port 2 program at any point set Main Mode switch S1-1 to “OPEN”.

Balance

1. Internal MAIN MODE switch S1-1 to "CLOSED".

- | | | | | |
|------------|---------------|----------------|---|---------------------|
| 2. Display | SET | AUTO | ? | Press NO(↓) |
| 3. Display | Set-UP | CONFIG | ? | Press NO(↓) |
| 4. Display | - - - - | CAL | ? | Press NO(↓) |
| 5. Display | Set-UP | I/O | ? | Press NO(↓) |
| 6. Display | - - - - | CONV. | ? | Press NO(↓) |
| 7. Display | - - - - | BALANCE | ? | Press YES(↑) |

8. Display **CELLS** 1 Change with ← or → Choices are 1 2 3 4
 One load cell must have address 01. Four cells must have addresses 01 02 03 04.
 Press **NO(↓)** for next step or **YES(↑)** for previous step.

- | | | | |
|-------------|---------------|-----------------|--|
| 10. Display | Actual | BalReset | Press ENTER to clear registers. |
| Display | Actual | RESET | Briefly. |
| Display | Actual | BalReset | Press NO(↓) for next step or YES(↑) for previous step. |
| 11. Display | Actual | ZERO BAL | Scale unloaded, Press ENTER . |
| Display | CAL | ACQUIRE | Briefly. |
| Display | Actual | ZERO BAL | Press NO(↓) for next step or YES(↑) for previous step. |
| 12. Display | Actual | CEL1 BAL | Apply load to cell 1 only. Press ENTER . |
| Display | CAL | ACQUIRE | When display changes back to CEL1 BAL , remove load.. |
| Display | Actual | CEL1 BAL | Press NO(↓) for next step or YES(↑) for previous step. |
| 13. Display | Actual | CEL2 BAL | Apply load to cell 2 only. Press ENTER . |
| Display | CAL | ACQUIRE | When display changes back to CEL2 BAL , remove load.. |
| Display | Actual | CEL2 BAL | Press NO(↓) for next step or YES(↑) for previous step. |
| 14. Display | Actual | CEL3 BAL | Apply load to cell 3 only. Press ENTER . |
| Display | CAL | ACQUIRE | When display changes back to CEL3 BAL , remove load.. |
| Display | Actual | CEL3 BAL | Press NO(↓) for next step or YES(↑) for previous step. |
| 15. Display | Actual | CEL4 BAL | Apply load to cell 4 only. Press ENTER . |
| Display | CAL | ACQUIRE | When display changes back to CEL4 BAL , remove load.. |
| Display | Actual | CEL4 BAL | Press NO(↓) for next step or YES(↑) for previous step. |
| 16. Display | - - - - | BALANCE | Press ENTER . |
| Display | CAL | ACQUIRE | Briefly. |
| Display | - - - - | BALANCE | |

18. Mode switch S1-1 to "OPEN". Balance is complete.

Note: If "?" is flashing, press **YES(↑)** or **NO(↓)** keys only. The other keys will not work.
 To EXIT the Balance program at any point set Main Mode switch S1-1 to "OPEN".

Setup

Factory settings that should not be changed.

1. Port 1 serial: Automatic
2. Serial switch S10: sw 3 closed, sw 1,2 & 4 open (RS485 sel).
3. Jumper plugs s8 & s9 in position 2 & 3 (RS485 A & B).

Front Panel Lights and Buttons

Lights (Annunciators)

- | | |
|----------------------|--|
| 1. CENTER ZERO | → 0 ← |
| 2. MOTION | <input type="checkbox"/> |
| 3. TARE | → T ← |
| 4. (8) character LED | lb, kg, oz, g, gr, tn, dr, mt, gross, net |

Buttons (Keys)

1. ZERO function key. This key allows the display to be zeroed if it is within the limits set by the ZERO configuration (2%, 5%, 10%, 20% or Full Scale). See page 4 Setup Configure.
2. TARE function key. The indicator can be set to AUTO TARE by enabling the AUTO TR feature in the Setup Configure mode on page 4. When AUTO TARE is enabled, pressing the TARE key will automatically tare the value of the current gross weight and change the display to the NET mode.
3. Recalling TARE and GROSS data:
 1. With NET display, press the DISPLAY key once or twice to show GROSS weight (GR RCL) or TARE value (TARE RCL).
 2. GROSS RECALLED or TARE RECALLED will display continuously while the DISPLAY key is pressed.
 3. When DISPLAY key is released GROSS RECALLED or TARE RECALLED will display for approximately 3 seconds, then NET display.
4. Returning to GROSS mode from NET mode:
 1. Remove load from scale.
 2. Press ZERO key.
 3. Tare value is set to zero.
 4. Display is GROSS.
5. PRINT key. Sends a demand serial output of display data.
6. DISPLAY key. In the normal operating mode, will select and view all displays that were enabled in Setup Configure mode on page 4.
7. UP and DOWN arrow keys will display the data in the conversion units that were selected in the Setup Units mode on page 6.

Specifications

Load cell power: 12VDC, 500 ma, (4) digital load cells.
 Load cell data: **ALCP** Advanced load cell protocol, RS485

Display divisions: 10,000 div, NTEP. For NTEP applications mount Capacity label above display area.
 100,000 div, non NTEP

Update rate: 10 updates/sec max



Capacity Label

Weight display: (6) digit red LED (0.6" high)
 Annunciator: Alpha Numeric (8) character red LED (0.2" high)


Temperature
 Operating: 40 deg F to 140 deg F.
 Storage: 0 deg F to 185 deg F.
 Warm up: 3 minutes to rated accuracy, 15 minutes to complete stability.

Weight: 6 lb, table top NEMA 4.
 4 lb, panel mount.

Case: Aluminum, extruded, single piece, desk mount.
 Steel, painted, panel mount.

Power input: 120VAC

DESK TOP

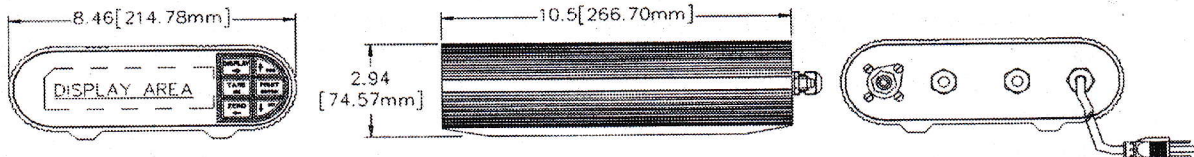

PANEL MOUNT

