

HC-*i* Series

INSTRUCTION MANUAL

Counting Scale

HC-30*Ki*

HC-15*Ki*

HC-6*Ki*



HC-3*Ki*

A&D

A&D Company, Limited

This manual and Marks

All safety messages are identified by the following, "WARNING" or "CAUTION", of ANSI Z535.4 (American National Standard Institute: Product Safety Signs and Labels). The meanings are as follows:

 WARNING	A potentially hazardous situation which, if not avoided, could result in death or serious injury.
 CAUTION	A potentially hazardous situation which, if not avoided, may result in minor or moderate injury.



This is a hazard alert mark.



This mark informs you about the operation of the product.



The information mark of another operations.

Note This manual is subject to change without notice at any time to improve the product. No part of this manual may be photocopied, reproduced, or translated into another language without the prior written consent of the A&D Company.

Product specifications are subject to change without any obligation on the part of the manufacture.

Compliance with FCC rules

Please note that this equipment generates, uses and can radiate radio frequency energy. This equipment has been tested and has been found to comply with the limits of a Class A computing device pursuant to Subpart J of Part 15 of FCC rules. These rules are designed to provide reasonable protection against interference when this equipment is operated in a commercial environment. If this unit is operated in a residential area it might cause some interference and under these circumstances the user would be required to take, at his own expense, whatever measures are necessary to eliminate the interference. (FCC = Federal Communications Commission in the U.S.A.)

Copyright©2005 A&D Company, Limited

Contents

1. INTRODUCTION	3
1-1. Introduction	3
1-2. Unpacking	4
1-3. Parts Overview	4
1-4. Setting Up Your Scale	5
1-5. Simple Operation Mode	6
1-6. kg or lb Weighing Units	6
1-7. Last Unit Weight Used Feature	6
2. Front Panel Overview	8
3. BASIC OPERATIONS	9
3-1. Basic Operations	9
3-2. To Start Counting	11
3-3. Unit Weight By a SAMPLE	12
3-5. Unit Weight By ID Number	17
4. ENTERING A TARE WEIGHT	18
4-1. Using the KEYBOARD TARE Key	18
4-2. To Clear TARE	19
5. STORE UNIT WEIGHT	20
5-1. Store Unit Weight by ID Numbers	20
5-2. Clearing A Memorized Unit Weight	21
5-3. Unit Weight, Tare & Comparator Limits Memorized	22
6. USING THE M+ MEMORY	23
6-1. The M+ Memory Function	23
6-2. Viewing the M+ TOTAL	24
6-3. Clearing the M+ TOTAL	24
6-4. The M- Function	24
7. COMPARATOR FUNCTION	25
8. CALIBRATION	27
8-1. Calibration Procedure Using a Weight	27
8-2. Gravity Compensation	29
9. F-FUNCTION PARAMETERS	30
9-1. To Change or View F-Function Settings	30
9-2. F-Functions	31
10. ACAI FUNCTION	37
10-1. ACAI Automatic Counting Accuracy Improvement	37
10-2. ACAI Automatic Operation	37
10-3. ACAI Manual Operation	38

11. AWA FUNCTION.....	39
11-1. AWA Audible Weighing Assist.....	39
11-2. To Enable/Disable AWA Function.....	39
12. OP-02 BATTERY.....	41
13. OP-03 RS-232C SERIAL INTERFACE.....	43
13-1. Installation.....	43
13-3. Data Output Mode.....	44
13-4. Connecting the AD-8121 Printer / MODE 1 or MODE 2.....	45
13-5. Connecting the AD-8121 Printer / MODE 3.....	46
13-6. Command Mode.....	46
13-6. Using UFC (Universal Flex Coms) Function.....	51
14. OP-04 RS-232C & RELAY OUTPUT.....	53
15. SPECIFICATIONS.....	54
16. GRAVITY ACCELERATION MAP.....	55

1. INTRODUCTION

1-1. Introduction

Thank you for your Purchase!

This manual describes the functions of your counting scale and how to get the most out of it. Read this manual carefully before use.

Features


The HC-*i* counting scales have the following features:

- £ The scales have the high internal resolution for a wider range of counting applications.
 - £ HC-3Ki / 6Ki / 30Ki: 1/600,000
 - £ HC-15Ki: 1/750,000
- £ There are the following ways to enter a unit weight (of the sample piece).
 - £ The way to weigh a fixed number of samples like 5 pieces, 10 pieces and so on.
 - £ The way to weigh the desired number of samples.
 - £ The way to store the desired unit weight directly using the 10-key pad.
 - £ The way to recall the stored unit weight from ID memory.
 - £ The way to send the desired unit weight from a personal computer.
- £ Three UNIT WEIGHT BY LED's will navigate you to enter a unit weight easily.
- £ ACAI (Automatic Counting Accuracy Improvement) supports counting by recalculating the unit weight when a sample is added. Therefore it is possible to reduce the counting error.
- £ The scale can show information for piece count, weight, unit weight and comparator result at the same time.
- £ UP to 99 ID memories can store ID numbers, unit weight, tare weight and comparator limits.
- £ Comparator function:
 - £ Compare a count or weight
 - £ Comparator limits can be changed using the 10-key pad.
 - £ Comparator relay output is also available using an optional interface.
- £ Accumulation function for counting.
- £ Optional RS-232C interface to communicate with a personal computer and printer expanding the counting application.
- £ The optional SLA (sealed lead acid) battery is useful for portable operation.



1-2. Unpacking

- £ Unpack the scale carefully and keep the packing material if you are likely to transport the scale again in the future.
- £ In the carton you should find this manual plus:
 - £ The counting scale.
 - £ An AC adapter (check that the AC input rating is correct).

Remove the protective packing materials from around the scale and between the pan and scale casing.

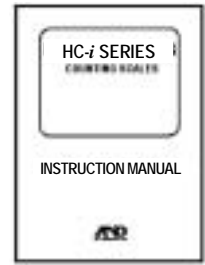


Instruction Manual

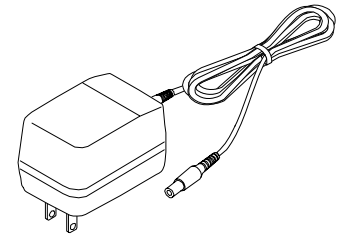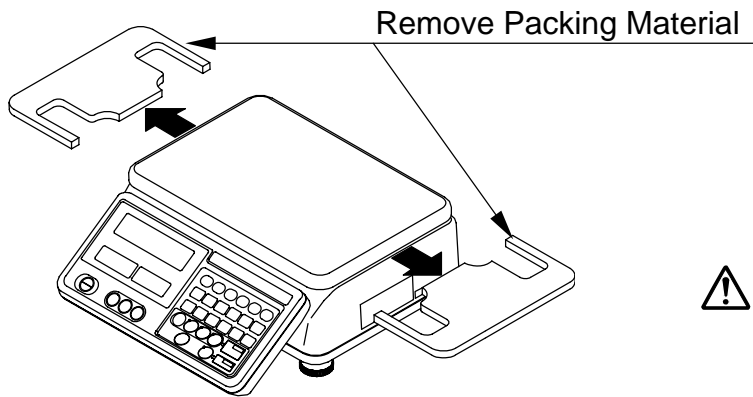

AC Adapter
Please confirm that the AC adapter type is correct for your local voltage and receptacle


1-3. Parts Overview

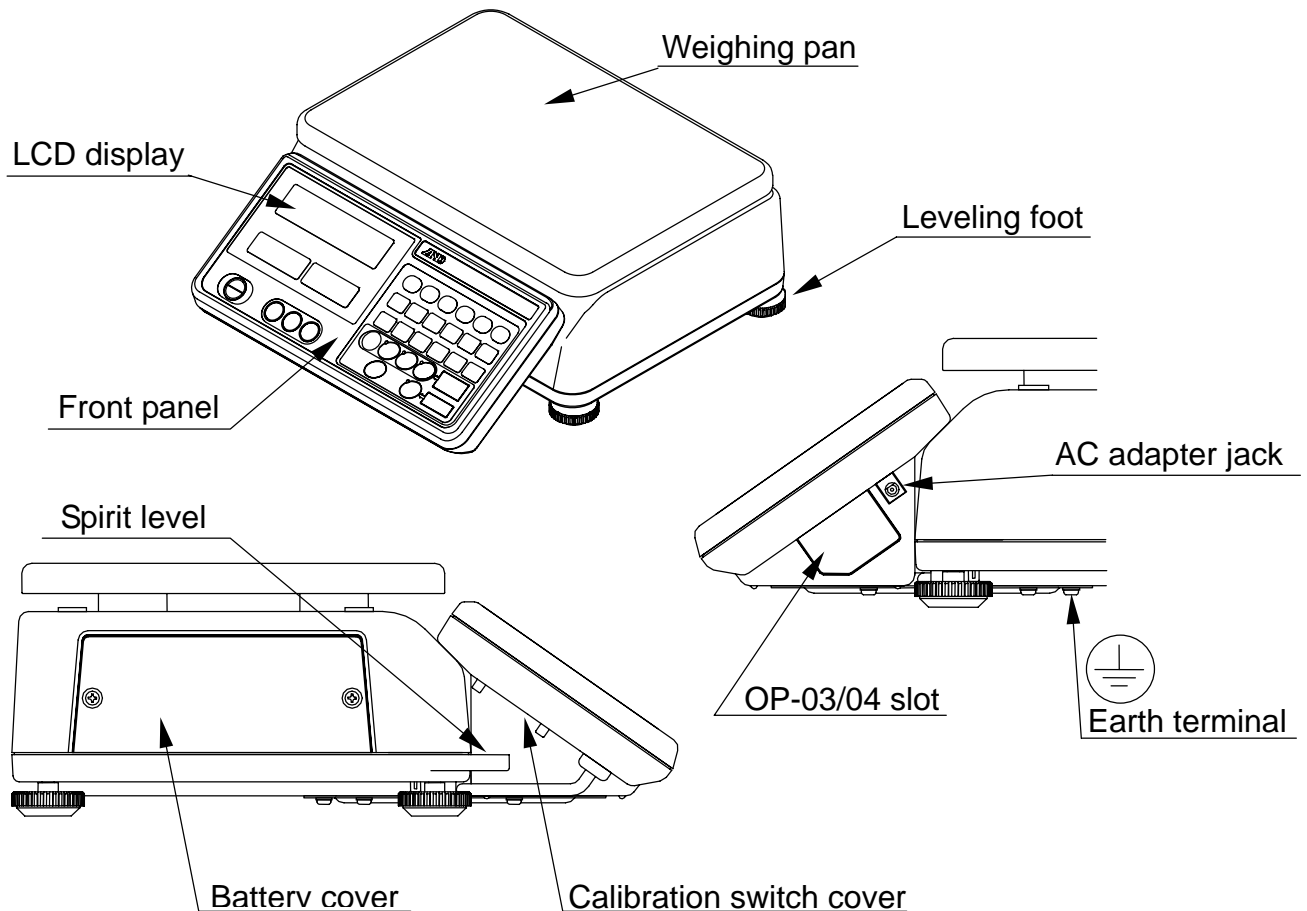

1-4. Setting Up Your Scale

1. Place the scale on a suitable weighing surface (see “Best Conditions For Weighing” below) and turn the adjustable feet until the spirit level shows that the scale is level.

2. Plug in the AC adapter. The AC input requirements could be 100, 120, 220, 230 or 240 Volts (50/60Hz) depending on the area in the world so please check that the adapter is correct. Earth the chassis if you think static electricity may be a problem.

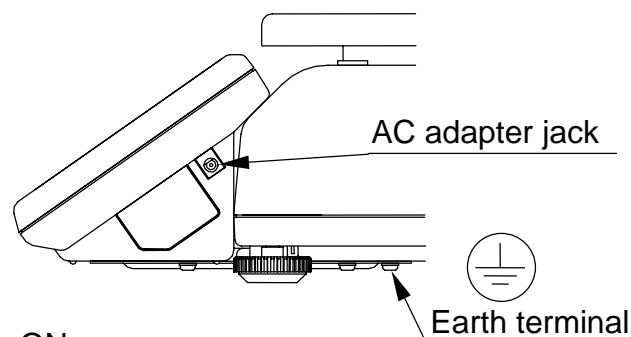

3. Press the key to turn the power ON.
All the display symbols are displayed.

Then the display turns off once, and zero will be shown with the ZERO mark.

4. Pressing the key again, and the power will switch OFF.

£ **Auto-power off function**

It is possible to have the power automatically switched OFF. If zero is displayed for approximately 5 minutes. See “9-2. F-Functions” and set the F-Function f-04-05 at “1” to enable the function.

5. Switch the power ON at least half an hour before use so that the scale can warm up.

Best Conditions For Weighing

- £ The Scale must be level (check the spirit level on the scale).
- £ Best operating temperature is between 20°C~25°C / 68°F~77°F at about 50%~60% Relative Humidity. There shouldn't be large temperature fluctuations.
- £ The weighing room should be kept clean and dry.
- £ The weighing table must be of a solid construction.
- £ Corners of rooms are best as they are less prone to vibrations.
- £ Don't install the scale near heaters or air conditioners.
- £ Don't install the scale in direct sunshine.
- £ Try to ensure a stable AC power supply when using an adapter.
- £ Keep equipment containing magnets away from the scale.
- £ Warm up the scale more than 30 minutes before use.
- £ Ground the scale chassis for electrostatic discharge if the weighing conditions warrant.


Calibration

Calibration of the HC-*i* is required when the scale is initially installed. Please see “8. CALIBRATION” for more calibration information.

1-5. Simple Operation Mode

If desired, the HC-*i* scale can be set in a Simple Operation Mode. Set the F-Function f-01-01 at "1". In this mode, only front panel keys that would be used in "3-3. Unit Weight By a Sample" counting operations are active. All others will not operate. The following keys are active in Simple Operations Mode:

Keys that will operate in Simple Operation Mode:

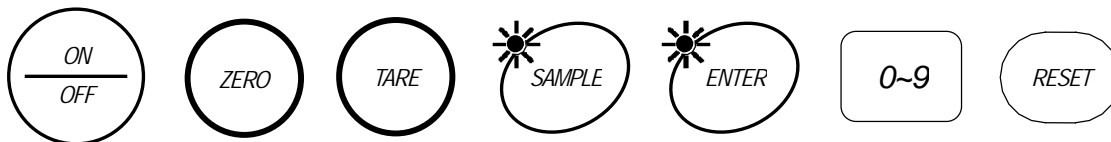

1-6. kg or lb Weighing Units


USA Version ONLY

The HC-*i* scale can weigh and register the unit weight in pounds or kilograms. When you switch between the weighing units, any weight amounts being used are also converted.

£ To change the weighing units between pounds and kilograms, see F-Function f-00-01. Set at "0" for kg; or at "1" for lb.

Or,

£ Set F-Function f-09-01 to "2" and you can change the weighing units between "kg" and "lb" by using the key.

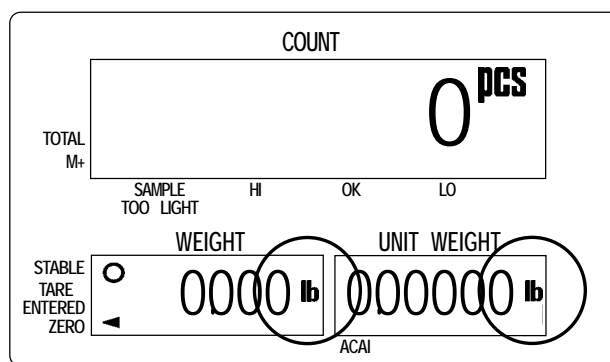


1-7. Last Unit Weight Used Feature



There are a number of ways to register a unit weight to count. The HC-*i* scale has a feature to keep the last unit weight used in memory. This can be handy if you turn the scale off and then want to return to the same unit weight, or you accidentally clear the unit weight by pressing the key.

When a unit weight is registered it is automatically placed in the ID "i d-00" and remains there until a new unit weight is entered. It can be recalled by the following:



1. When a unit weight is cleared and the three **UNIT WEIGHT BY** LED's are blinking;

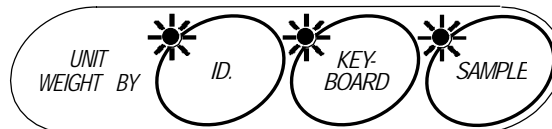

2. Press the key. 'i d 00' will be displayed with 00i blinking.

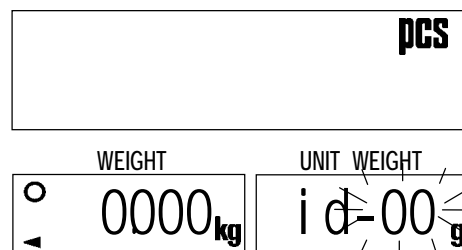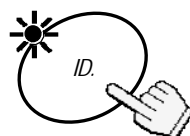

 3. Press the **ENTER** key.
The scale will recall the previous unit weight.

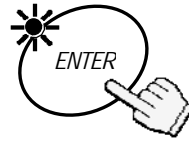


⚠ This feature cannot be used in Simple Operation Mode.

Automatic Last Unit Weight Used

When you turn the display ON, the scale can automatically recall the last unit weight used from memory, if desired.

- £ Set the F-Function f-01-04 at "1". The scale will recall the last unit weight used, when the display is turned ON.

2. Front Panel Overview

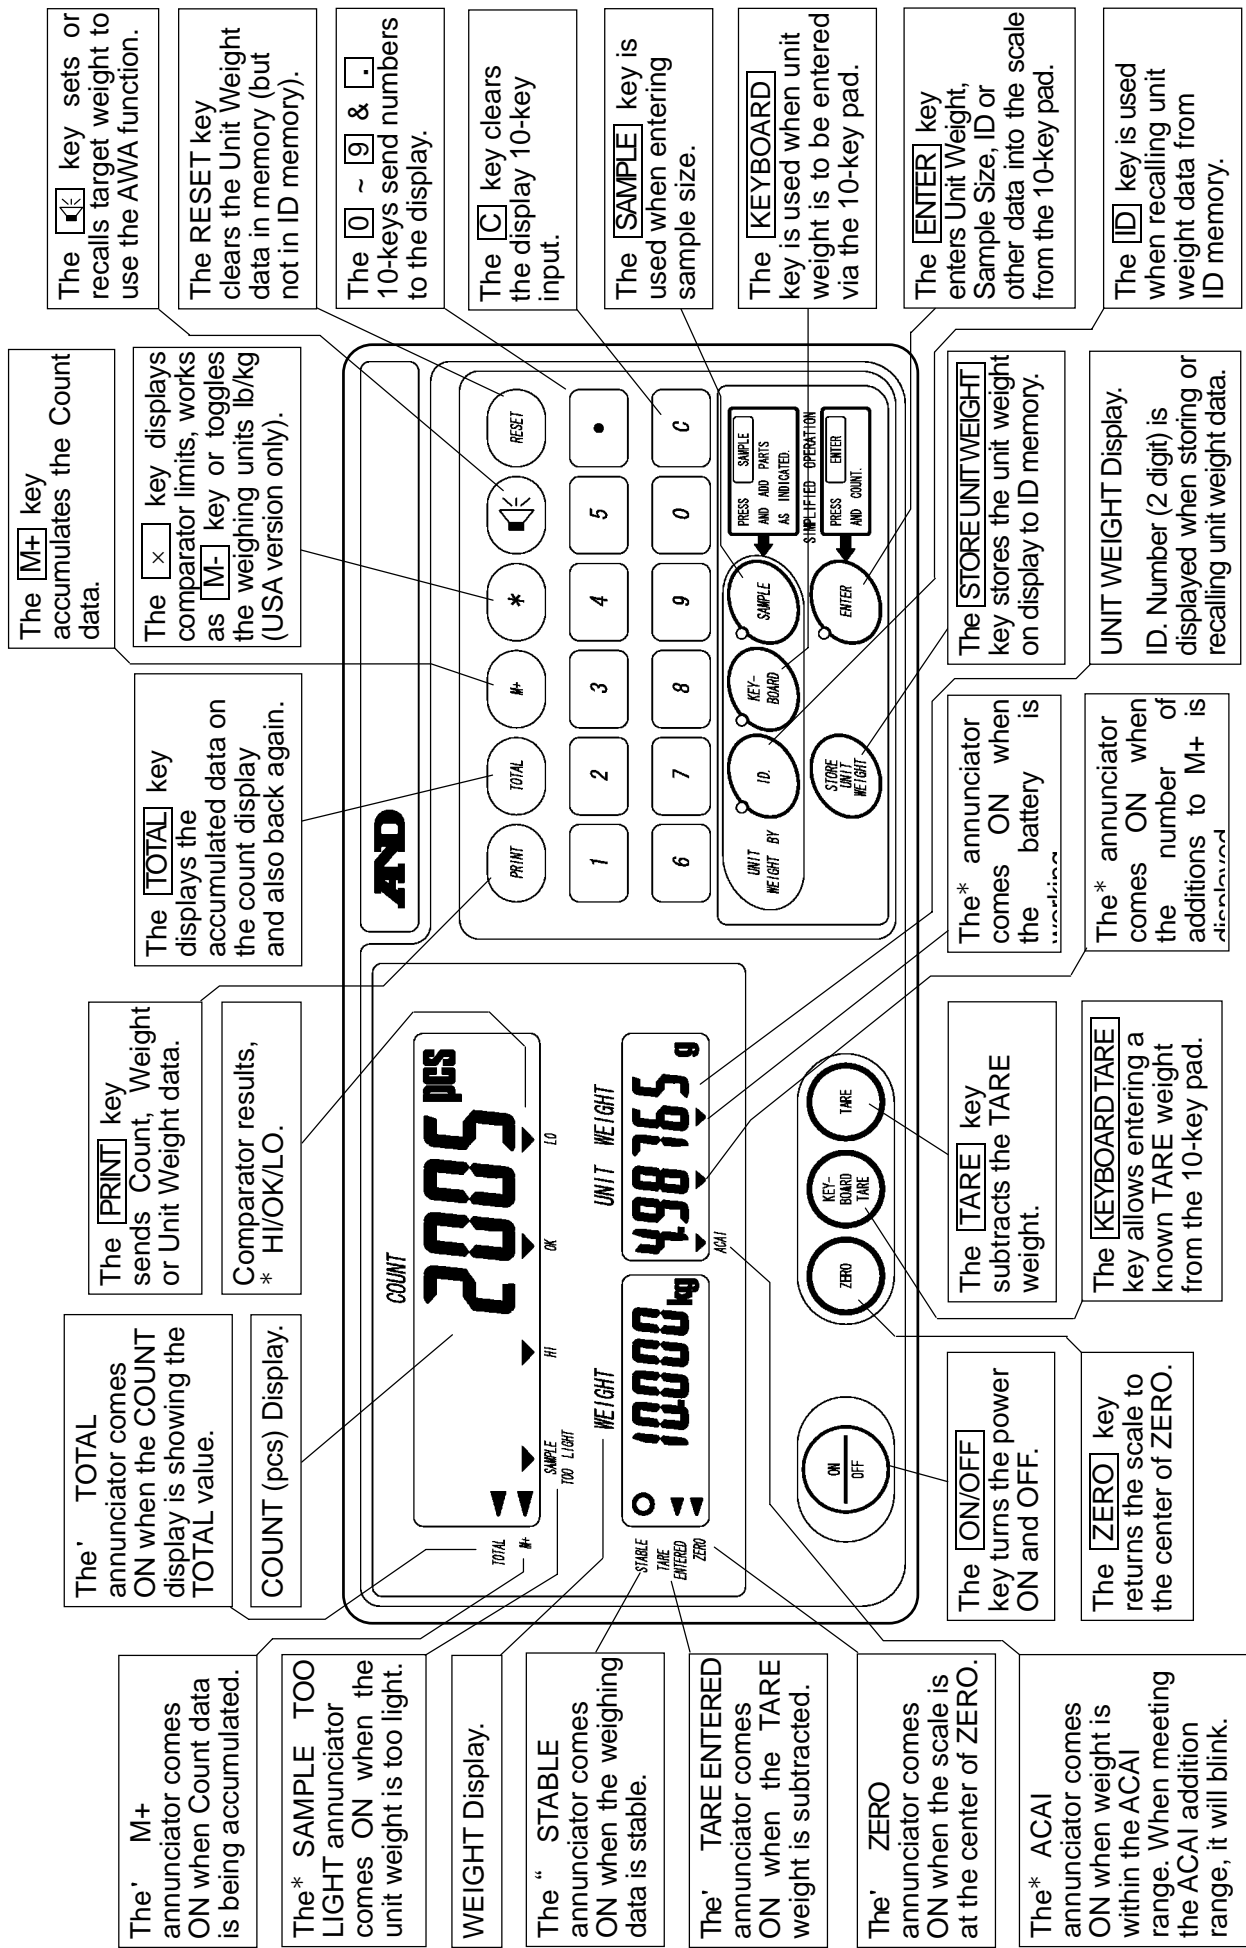

The **TOTAL** annunciator comes ON when the COUNT display is showing the TOTAL value.

COUNT (pcs) Display.

The **PRINT** key sends Count, Weight or Unit Weight data.

Comparator results, * HI/OK/LO.

The **M+** key accumulates the Count data.

The **x** key displays comparator limits, works as **M-** key or toggles the weighing units lb/kg (USA version only).

The **TOTAL** key displays the accumulated data on the count display and also back again.

AND

COUNT
TOTAL # 2005 PCS

WEIGHT
10000 kg

UNIT WEIGHT
498765 g

The **RESET** key clears the Unit Weight data in memory (but not in ID memory).

The **KEYBOARD** key is used when unit weight is to be entered via the 10-key pad.

The **ENTER** key enters Unit Weight, Sample Size, ID or other data into the scale from the 10-key pad.

The **ENTER** key enters Unit Weight, Sample Size, ID or other data into the scale from the 10-key pad.

The **ID** key is used when recalling unit weight data from ID memory.

The **M+** key accumulates the Count data.

The **x** key displays comparator limits, works as **M-** key or toggles the weighing units lb/kg (USA version only).

PRINT **TOTAL** **#** ***** **RESET**

1 2 3 4 5 6 7 8 9 0 **C**

UNIT WEIGHT BY **ID** **KEYBOARD** **SAMPLE** **ENTER**

STORE UNIT WEIGHT **ENTER**

The **STORE UNIT WEIGHT** key stores the unit weight on display to ID memory.

UNIT WEIGHT Display. ID. Number (2 digit) is displayed when storing or recalling unit weight data.

The **M+** annunciator comes ON when Count data is being accumulated.

The * **SAMPLE TOO LIGHT** annunciator comes ON when the unit weight is too light.

WEIGHT Display.

The **" STABLE** annunciator comes ON when the weighing data is stable.

The **TARE ENTERED** annunciator comes ON when the TARE weight is subtracted.

The **ZERO** annunciator comes ON when the scale is at the center of **ZERO**.

The * **ACAL** annunciator comes ON when weight is within the ACAL range. When meeting the ACAL addition range, it will blink.

The * annunciator comes ON when the battery is **LOW BATTERY**

The * annunciator comes ON when the number of additions to **M+** is **displayed**

The **TARE** key subtracts the TARE weight.

The **KEYBOARD TARE** key allows entering a known TARE weight from the 10-key pad.


The **ON/OFF** key turns the power ON and OFF.

The **ZERO** key returns the scale to the center of **ZERO**.


3. BASIC OPERATIONS

3-1. Basic Operations

Turn The Power ON and OFF

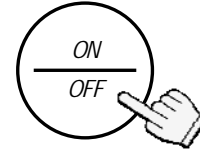


1. Press the **ON/OFF** key to turn the power ON.
All the display symbols will turn on. After a few seconds, the display turns off once. Then, the scale will automatically take zero (power-on zero) and the display shows zero.

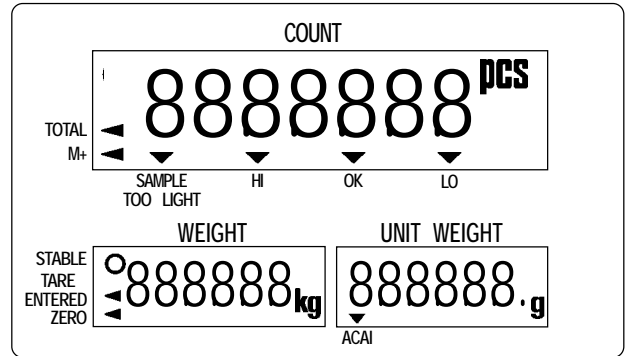

2. Press the **ON/OFF** key again, and the power will be switched OFF.

£ Auto-power off function

It is possible to have the power automatically switched OFF. If zero is displayed for approximately 5 minutes. See “9-2. Functions” and set the F-Function f-04-05 at “1” to enable the function.

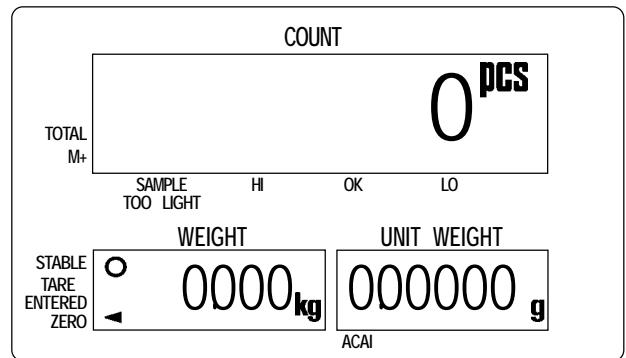

ZERO

- £ The **ZERO** key will bring the weight display back to zero.

1. Remove everything from the weighing pan and press the **ZERO** key. Then the weight display shows “-----” and waits for the weighing data to become stable.
2. The scale will zero and the ZERO indicator will come ON to indicate that the scale is ready to start weighing or counting.




- £ There is automatic re-zeroing function called “Zero Tracking”. The scale initially comes with this function enabled to take care of normal drifts from zero caused by changes in temperature, humidity, air pressure etc. (F-Function f-04-01).



TARE

£ The **TARE** key will subtract the displayed container weight.

1. Remove everything from the weighing pan and press the **ZERO** key to zero the scale.

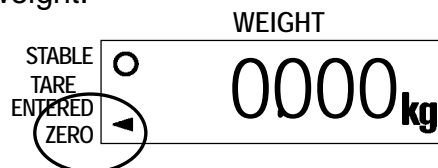

2. Place a tare container on the weighing pan. The weight display will show the weight of the container.

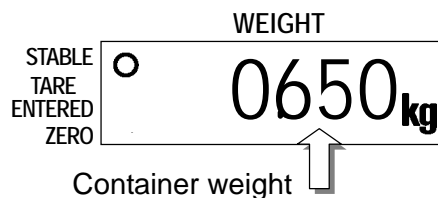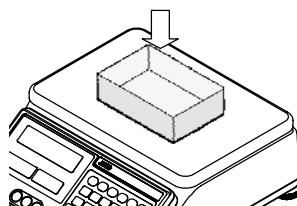

3. Press the **TARE** key. Then the weight display shows "-----" and waits for the weighing data to become stable.




4. The scale will subtract the weight of the container and the weight display changes to net weight.


£ The TARE ENTERED indicator will light.

3-2. To Start Counting

1. Press the **ON/OFF** key to turn the scale ON. Or press the **RESET** key to initialize any previous operations.
2. The three LED's on the **UNIT WEIGHT BY** keys will blink. This is to prompt you to select a method for entering a unit weight for operation.

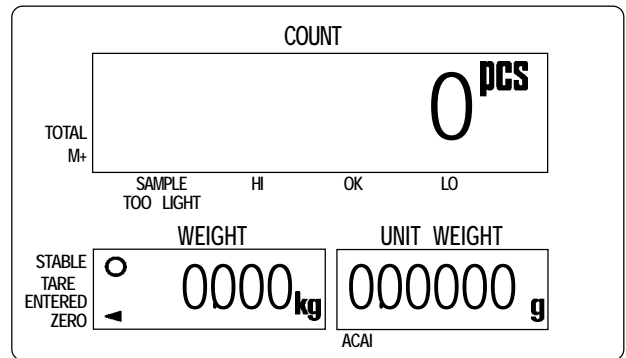

3. Select one of the ways to enter or recall the unit weight (the weight of one item of what you are counting), and see the section noted for more instructions.

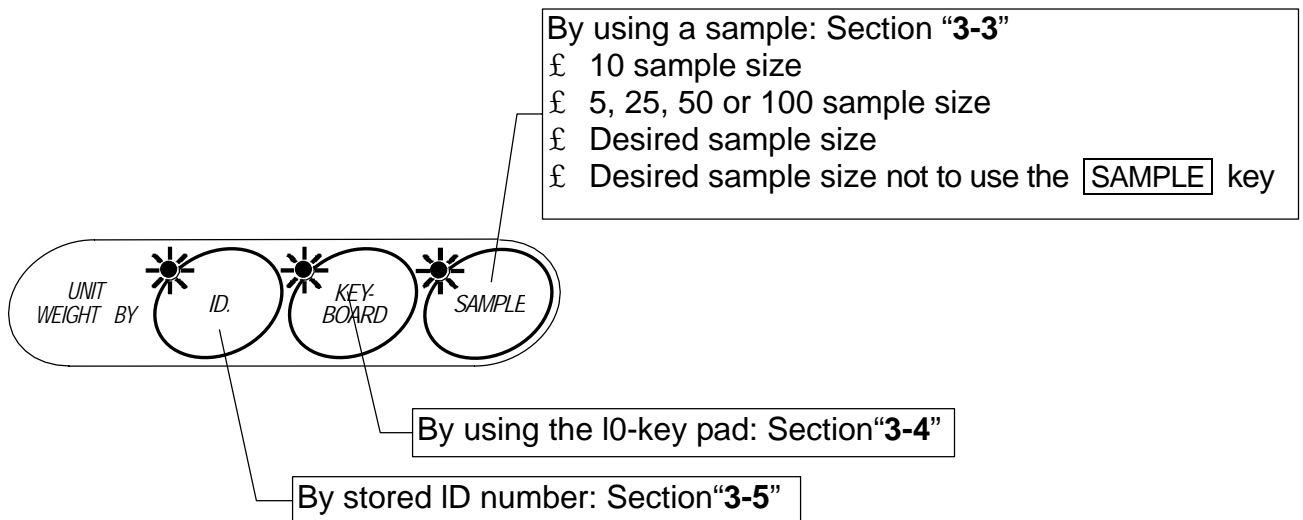


]
 You can return to this point at any time during operation by pressing the **RESET** key. (This doesn't clear the entered tare weight, M+ memory, AWA settings and comparator limits.)


3-3. Unit Weight By a SAMPLE

10 Sample Size

1. The three **UNIT WEIGHT BY** LED's should be blinking at this point, if not, press the **RESET** key. to clear any unit weight. If you are going to use a tare container, place it on the weighing pan.

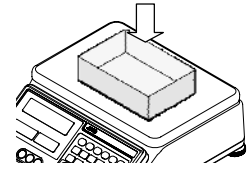


2. Press the **SAMPLE** key. Any tare container will be automatically tared. The display Will show "add" "10 pcs".

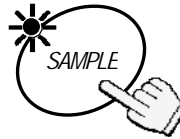

COUNT		10 ^{pcs}
WEIGHT	UNIT WEIGHT	
0000 _{kg}	add _g	


If weight isn't zero, press the TARE.

3. Place 10 sample pieces on the weighing pan (or in the tared container). The weight of all 10 pieces will be displayed.

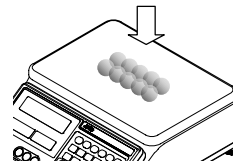

COUNT		10 ^{pcs}
WEIGHT	UNIT WEIGHT	
0056 _{kg}	add _g	

4. Press the **ENTER** key. The display will show "-----" for a moment while calculating the unit weight. After a moment the display will show the count, total weight and unit weight.

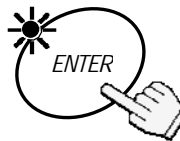

COUNT		pcs

WEIGHT	UNIT WEIGHT	
0056 _{kg}	add _g	

At this point the scale may decide that 10 pieces is not a large enough sample size for accurate counting. If you see the "add ##" on the unut weight display, then add the additional number of sample pieces displayed.

COUNT		10 ^{pcs}
WEIGHT	UNIT WEIGHT	
0056 _{kg}	561200 _g	

Total Weight
The weight of all the sample pieces

Unit Weight
The calculated weight of a unit.

- £ You can ignore the "add ##" message and continue counting by pressing the **ENTER** key. However, the results may not be accurate. See F-Function f-01-02.

5. You may now begin counting operations for pieces of the same weight.


- £ See "10. ACAI FUNCTION" for information concerning the ACAI counting accuracy function.

COUNT		10 ^{pcs}
SAMPLE HI OK LO		
TOO LIGHT		
WEIGHT	UNIT WEIGHT	
0004 _{kg}	add 15 _g	



Another 30 pieces

5, 25, 50 or 100 Sample Size


- The three **UNIT WEIGHT BY** LED's should be blinking at this point, if not, press the **RESET** key. to clear any unit weight. If you are going to use a tare container, place it on the weighing pan.

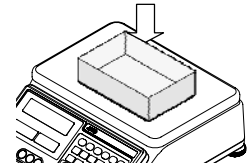

- Press the **SAMPLE** key. Any tare container will be automatically tared. The display will show "add" "10 pcs".

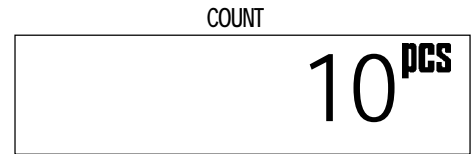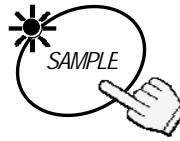

If weight isn't zero, press the TARE.

 


- Press the **SAMPLE** key to do through the count size: of 5, 25, 50 or 100 pieces.






à 10 à 5 à 25 à 50 à 100



 - £ The larger the sample size, the more accurate unit weight registered. (Example of selecting a sample size of 50)






 - Place the selected number of sample pieces on the weighing pan (or in the tared container). The weight of the pieces will be displayed.

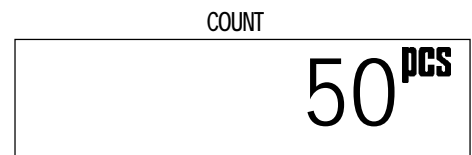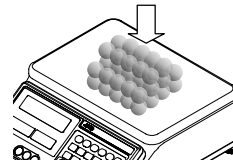



- Press the **ENTER** key. The display will show "-----" for a moment while calculating the unit weight. After a moment the display will show the count, total weight and unit weight.

 ë Blinking

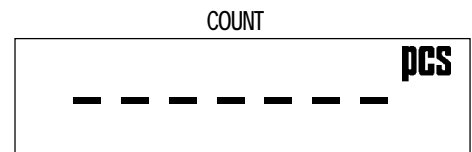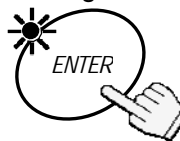

- If the "add ##" appears on the unit weight display, then the sample size is not large enough for accurate counting – add the additional number of sample pieces.

 
COUNT

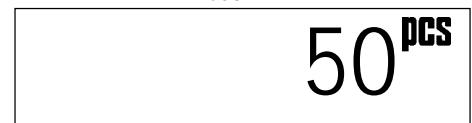



- You may now begin counting operations for pieces of the same weight.

Desired Sample Size

- The three **UNIT WEIGHT BY** LED's should be blinking at this point, if not, press the **RESET** key. to clear any unit weight. If you are going to use a tare container, place it on the weighing pan.


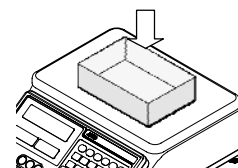


- Press the **SAMPLE** key. Any tare container will be automatically tared. The display Will show "add " "10 pcs".

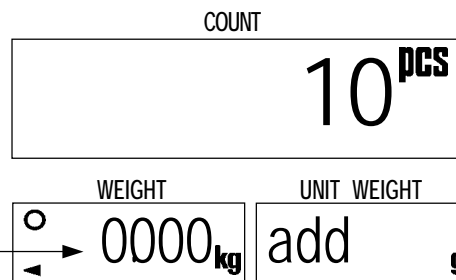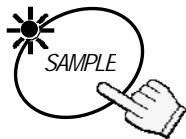



If weight isn't zero, press the TARE.

 - Use the **0** à **9** 10-key pad to display the sample size desired.

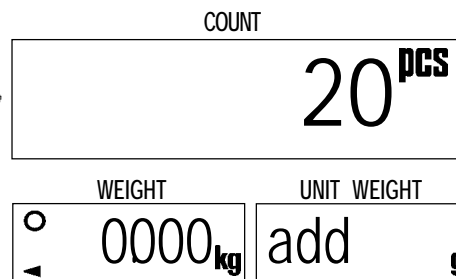



- £ If you hit the wrong key, press the **C** key to clear and start again. (Example of selecting a sample size of 20)

- Place the selected number of sample pieces on the weighing pan (or in the tared container). The weight of the pieces will be displayed.

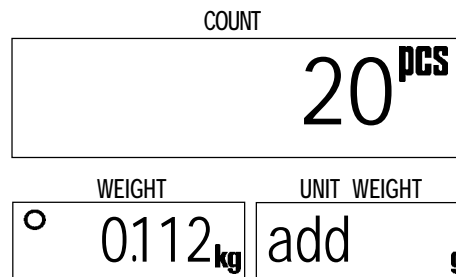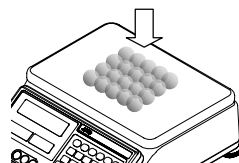


- Press the **ENTER** key. The display will show "-----" for a moment while calculating the unit weight. After a moment the display will show the count, total weight and unit weight.

ë Blinkingì

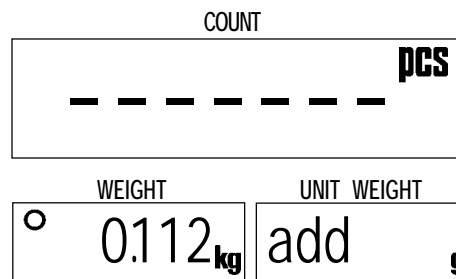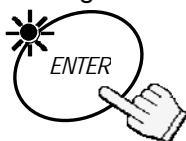



- If the "add ##" appears on the unit weight display, then the sample size is not large enough for accurate counting – add the additional number of sample pieces.

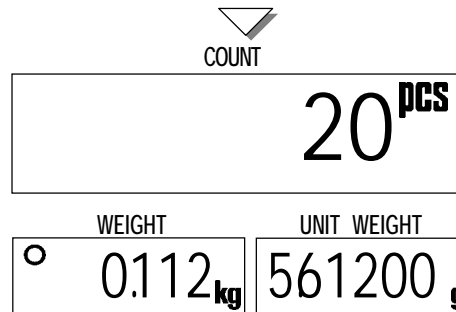


- You may now begin counting operations for pieces of the same weight.

Desired Sample Size Not Using The **SAMPLE** Key




- The three **UNIT WEIGHT BY** LED's should be blinking at this point, if not, press the **RESET** key. to clear any unit weight. If you are going to use a tare container, place it on the weighing pan and press the **TARE** key. Be sure to set the weight display is "0".

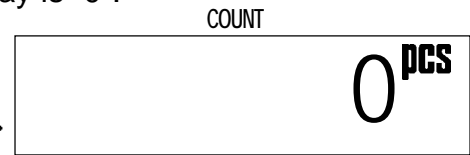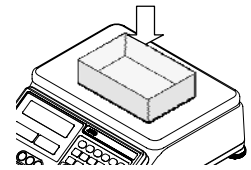




If weight isn't zero, press the TARE.

 

 - Place sample pieces on the weighing pan (or in the tared container). The weight of the pieces will be displayed.


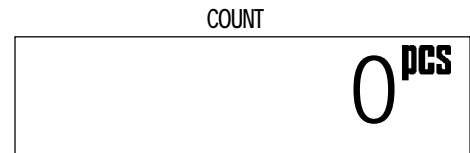
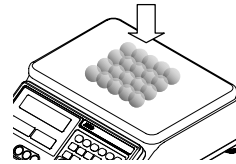


  - Use the **0** à **9** 10-key pad to enter the sample size of the pieces you placed.
- If you hit the wrong key, press the **C** key to clear and enter again. (Example of setting a sample size of 20)

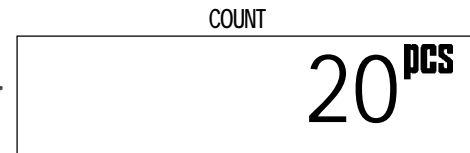


- Press the **ENTER** key. The display will show "-----" for a moment while calculating the unit weight. After a moment the display will show the count, total weight and unit weight.

 Blinking

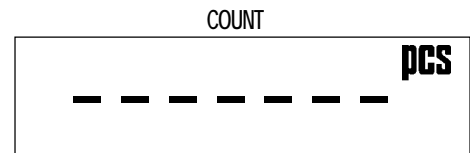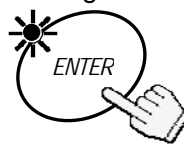


- If the "add ##" display appears on the unit weight display, then the sample size is not large enough for accurate counting – add the additional number of sample pieces.

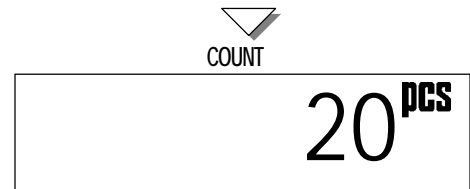


- You may now begin counting operations for pieces of the same weight.

3-4. Unit Weight By KEYBOARD


1. The three **UNIT WEIGHT BY** LED's should be blinking at this point, if not, press the **RESET** key. to clear any unit weight. If you are going to use a tare container, place it on the weighing pan and press the **TARE** key. Be sure to set the weight display is "0".

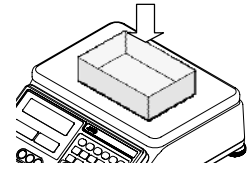

2. Press the **KEYBOARD** key.
The unit weight display and the **ENTER** key LED will blink.


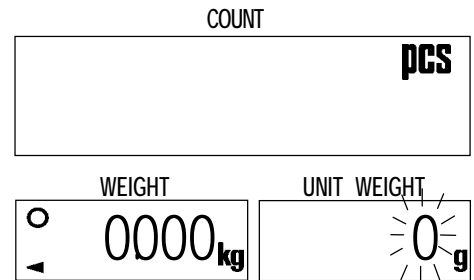


3. Use the **0** à **9** and **.** 10-key pad to display the unit weight.

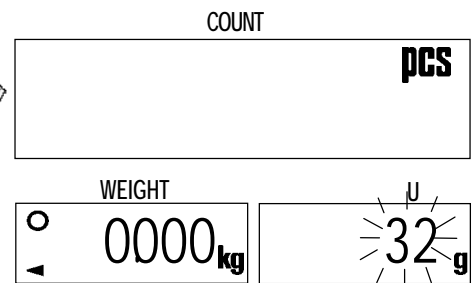


- £ If you hit the wrong key, press the **C** key to clear and start again.
(Example of a unit weight 32g)

4. Press the **ENTER** key.
The unit weight 32g will have been entered.

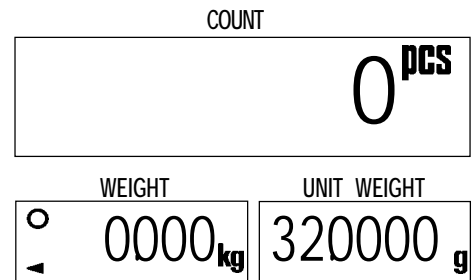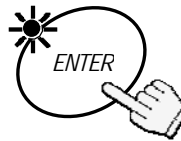

- ⚠ If the unit weight entered is too light, "l o ut" (low unit weight) will be displayed, and you will be returned to step 3.

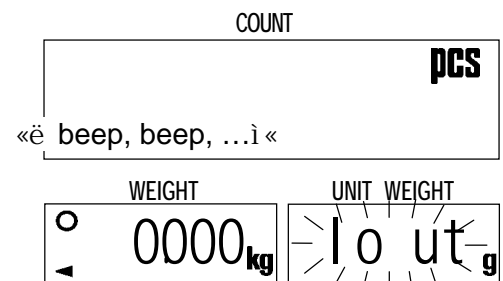

5. You may now begin counting operations for pieces of the same weight.

3-5. Unit Weight By ID Number

1. If there are no unit weights stored into memory, see “5-1. Store unit weight by ID Numbers”.

The three **UNIT WEIGHT BY** LED's should be blinking at this point, if not, press the **RESET** key to clear any unit weight.


2. Press the **ID** key.
'i d-00' will be displayed with 00i blinking.




3. Use the **0** à **9** 10-key pad to display the ID number.




- £ If you hit the wrong key, press the **C** key to clear and start again. (Example of ID number '12')

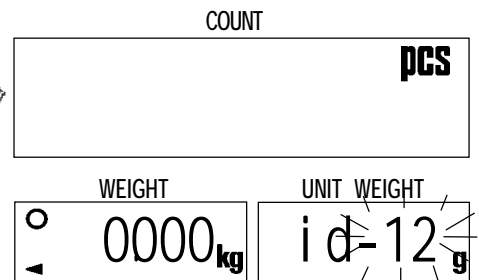

4. Press the **ENTER** key.
The count display will show '0' and the scale will recall '12g' previously entered as the unit weight of ID 12.

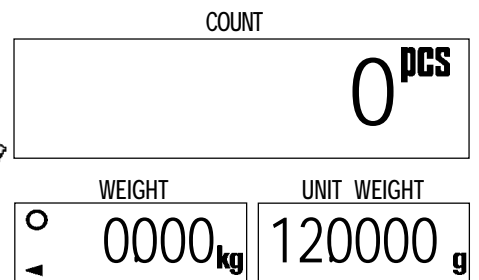

- ⚠ If there is no unit weight entered for the ID number you tried to recall, “no i d” will be displayed, and you will be returned to step 3.

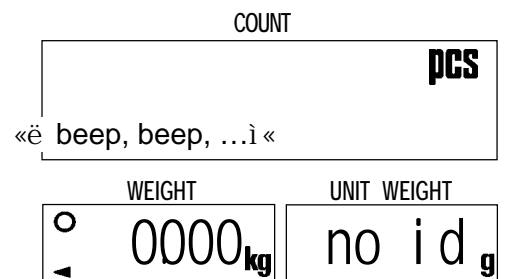

5. You may now begin counting operations for pieces of the same weight.

]

- £ “i d-00” is a special memory area. It always holds the last unit weight entered.
- £ When you register a unit weight, it is automatically placed in the ID “i d-00”.
- £ If you clear the unit weight by pressing the **RESET** key, it can be recalled by recalling the ID “i d-00”.

4. ENTERING A TARE WEIGHT


There are two methods of tare operations.

- £ Using the **TARE** key to subtract the displayed container weight directly. Please see “3-1. Basic Operations”.
- £ Using the **KEYBOARD TARE** key to enter a tare weight via the 10-key pad.

4-1. Using the KEYBOARD TARE Key


1. Remove everything from the weighing pan and press the **ZERO** key to zero the scale.

2. Press the **KEYBOARD TARE** key.
The weight display will blink (display is any tare weight previously entered).

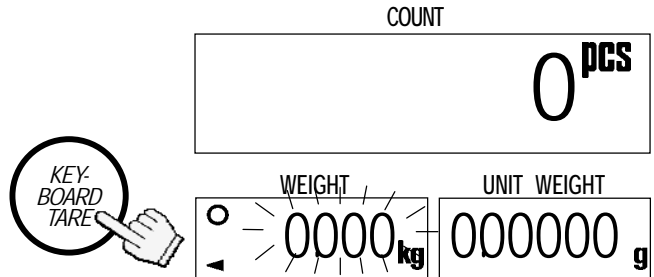


3. Use the **0** à **9** 10-key pad to display the desired tare weight.

- £ If you hit the wrong key, press the **C** key to clear and start again. (Example of a tare weight 615g)

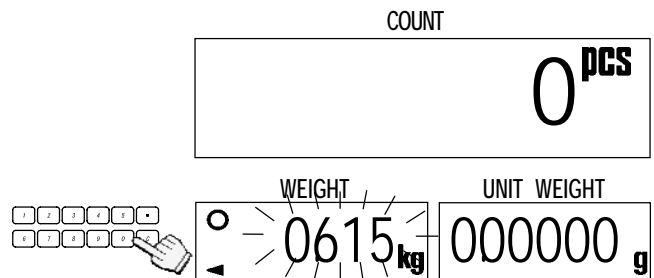

4. Press the **ENTER** key.
The weight display changes to net weight.


- £ The TARE ENTERED indicator will light.

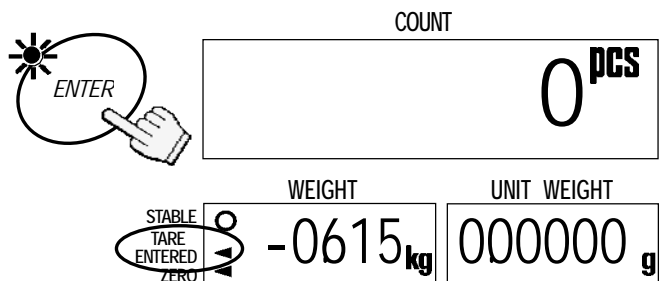


4-2. To Clear TARE

Either:

1. Have nothing on the weighing pan.
- £ If the ZERO indicator is not displayed, press the **ZERO** key to zero the scale.

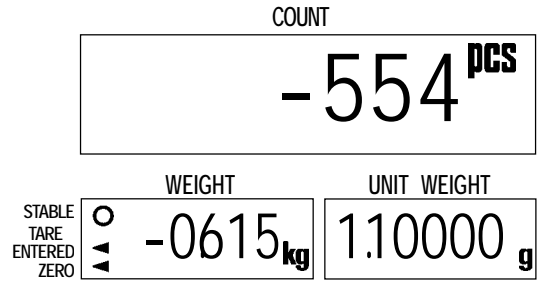


2. Press the **TARE** key.
The weight display will go to "0", and the TARE ENTERED indicator will be turned off (tare cleared).

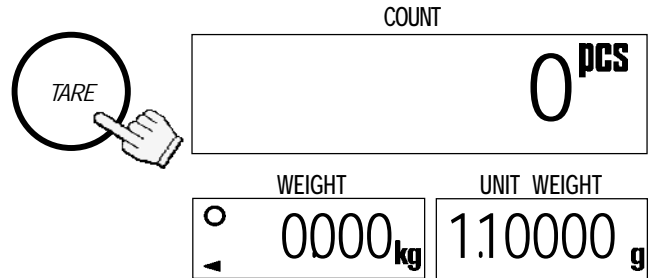


Or:

1. Press the **KEYBOARD TARE** key.
The weight display will blink (display is any tare weight previously entered).

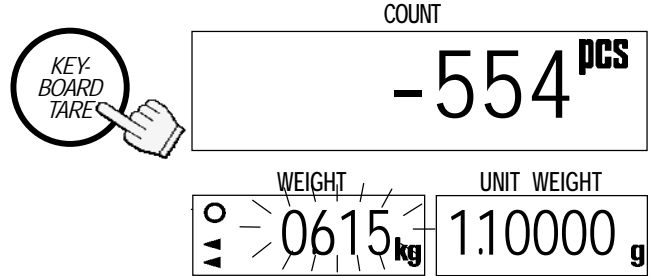


2. Press the **0** key and press the **ENTER** key.

Enter tare weight '0'.

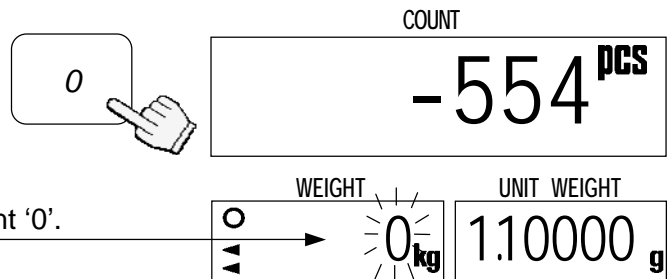

3. The tare weight is cleared and the TARE ENTERED indicator will be turned off.

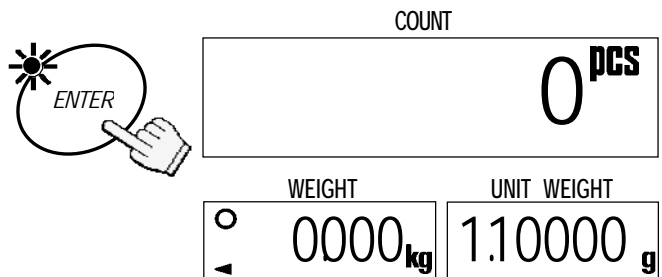



5. STORE UNIT WEIGHT

5-1. Store Unit Weight by ID Numbers


The scale can memorize up to 99 unit weights by 2 digit ID numbers, from 01 to 99. To recall, see “3-5. Unit Weight By ID. Number”.

£ The scale is initially set to memorize ID numbers with a unit weight only. However, it can be set to memorize a TARE weight and comparator limits by setting F-Function f-01-05.

 
1. First register a unit weight by any method – using a sample or via the 10-key pad – and have it displayed.

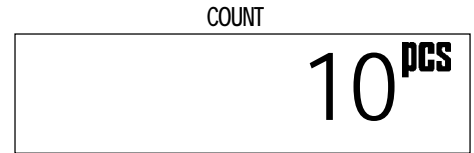

 2. Press the **STORE UNIT WEIGHT** key. “i d-00” will appear with 00i blinking.





 3. Use the **0** à **9** 10-key pad to display the new ID number. (Example of ID number “12”)





£ If you hit the wrong key, press the **C** key to clear and start again.

 
4. Press the **ENTER** key. The ID number is memorized and the display returns to normal.

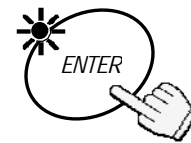

- 1) If the same ID number was previously stored, the scale beeps twice and the ID number display stops blinking. You must then select one of two options: either (a) Overwrite the old ID unit weight, or (b) Select a different ID number:

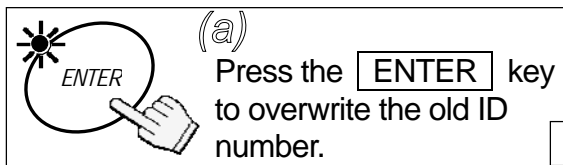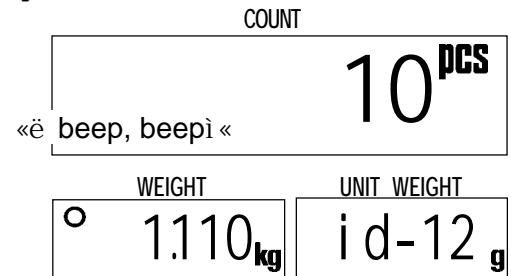


OR

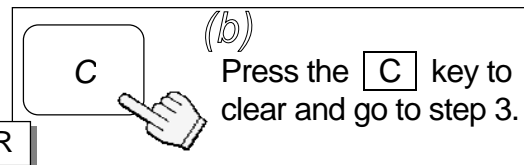


5-2. Clearing A Memorized Unit Weight



1. Press and hold the **C** key, then press the **STORE UNIT WEIGHT** key – release both.
2. “Clear” will appear and “i d-00” will appear with “00” blinking.

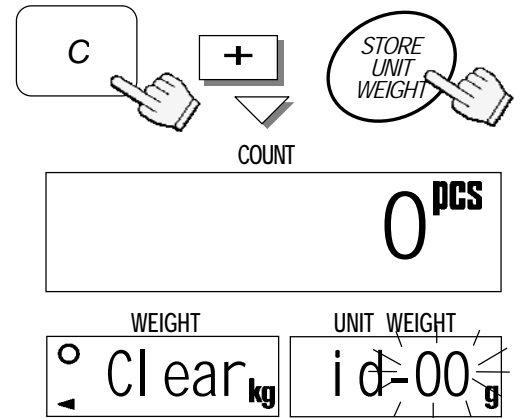


3. Use the **0** à **9** 10-key pad to display the ID number to clear. (Example of ID number “12”)
- £ If you hit the wrong key, press the **C** key to clear and start again.

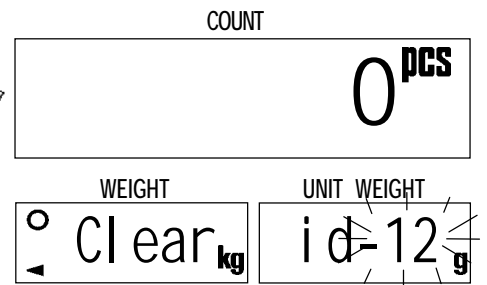

4. Press the **ENTER** key. The ID memory specified at step 3 will be cleared and the display returns to normal.

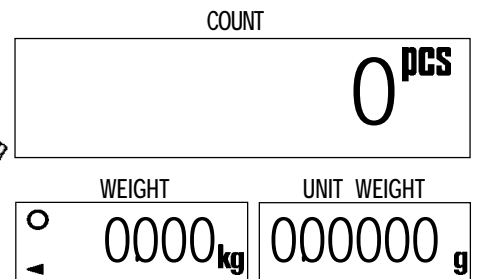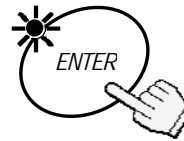

 If there is no such ID number to clear, the scale will beep. Return to step 2 to try again, or press the **RESET** key to exit.

Clearing All ID Memories at Once


1. In the Step 2 above, press the **TOTAL** key. “i dal l” will appear with “all” blinking.



2. Press the **ENTER** key, then “all” blinking will stop.



3. Press the **ENTER** key again to clear all of ID memories. Press the **RESET** to exit without clearing ID memories. Display will return to normal.

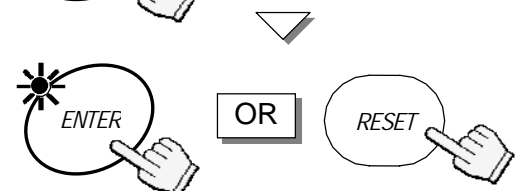

5-3. Unit Weight, Tare & Comparator Limits Memorized


The scale is initially set to store ID numbers with a unit weight only. However, it can be set to store a tare weight and/or comparator limits also by setting F-Function f-01-05.

1. First register a unit weight and a tare weight by any method. If necessary, set the comparator limits.

COUNT
-554^{pcs}

2. Go to step 2 of section “5-1. Store Unit Weight By ID Numbers”.

WEIGHT UNIT WEIGHT
STABLE TARE ENTERED ZERO 0 -0615_{kg} 1.10000_g

-  When you recall a unit weight by the **ID** key, the tare and/or comparator limits are also recalled along with the unit weight.



“i d-00”, the special memory area, does not store a tare weight and comparator limits along with unit weight.

6. USING THE M+ MEMORY

6-1. The M+ Memory Function

- £ The scale can accumulate count data by pressing the **M+** key, or automatically (see the next page). It also keeps track of the number of times you add to the total.
- £ When you view the total by pressing the **TOTAL** key, you view the number of pieces accumulated and the number of additions (how many times the total was added to). Please see “6-2.” and “6-3.” to view or clear the total count.

Adding Using the M+ Key

£ When stable count data is displayed:


1. Press the **M+** key.

The scale will beep and the **M+** annunciator will blink for a few seconds.

⚠ If the scale beeps 4 times, or the **M+** indicator did not blink, then refer to the note below.

⚠ The **M+** indicator will stay ON while there is count in memory.

2. Press the **M+** key every time you want to add to the count. Remember that you may only add the count data once – the scale must return to near zero before it will let you add again.

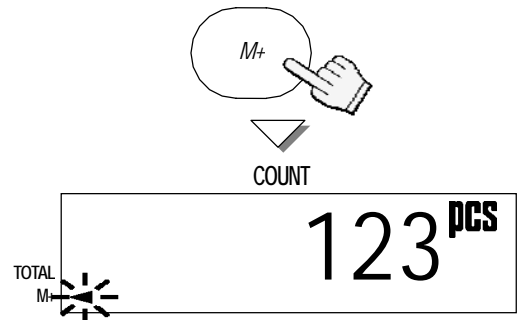


-]
- £ The **M+** key is accepted only once for every stable count data. Once accepted, the **M+** key is prohibited until the display returns to less than +5d (1d = 1 weighing division).
 - £ If f-03-02 is set at “1”, then the **M+** key can accumulate negative data. Once the **M+** key is accepted, weight data must return within ±5d before the next accumulation.
 - £ To memorize the total count in the ID number, see “5-3. Unit Weight, Tare & Comparator Limits Memorized”.

To Erase the Last M+ Addition

1. Press and hold the **C** key, then press the **M+** key – release.

2. The scale will beep and clear the last **M+** addition.

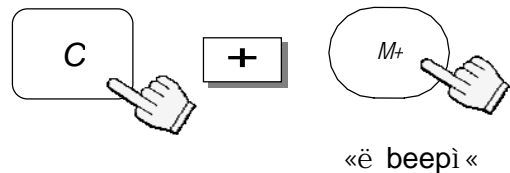

⚠ If the scale beeps 4 times, there is no **M+** addition to erase.

Automatic M+ Accumulation Mode

£ M+ Accumulation can also be done automatically each time you count a different batch, As soon as you have a stable count, it will be added to the M+ memory and the scale will beep«. The weight display will have to return to near zero before another count can be added.


⚠ Automatic M+ accumulation is set by F-Function f-03-01 at “1”.

⚠ Only positive counts can be added. If F-Function f-03-02 is set at “1” (to accept negative count data), it will be ignored.

⚠ Once there is an automatic M+ accumulation, the display must return to less than +5d before another count can be accumulated.

6-2. Viewing the M+ TOTAL


1. Press the **TOTAL** key.
The count display will show the total count and the TOTAL ◀ annunciator will come ON.
The number of additions to the M+ memory is also shown.

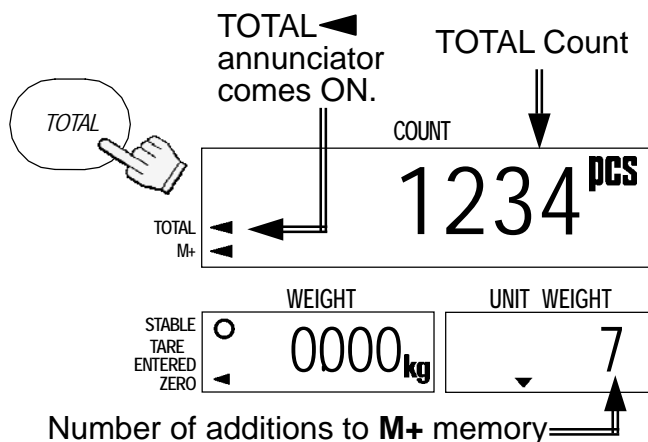


2. Press the **TOTAL** key again.
The display will return to normal.

6-3. Clearing the M+ TOTAL

1. Press and hold the **C** key, then press the **TOTAL** key – release both.

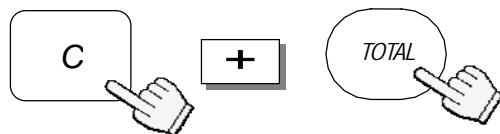

2. The scale will clear the M+ memory, and the TOTAL ◀ annunciator and the M+ ◀ annunciator will go OFF.



£ The **RESET** key does not clear the total data.

£ The total data is held in memory, even if AC/Battery power to scale is interrupted.

6-4. The M- Function

£ The scale can subtract count data from M+ memory by using the **×** key.

£ Set the F-Function f-09-01='1' to use the **×** key as **M-** key.


⚠ This function is not to clear the last M+ addition, but to subtract count data instead of addition. The number of additions is increased.

⚠ There is no automatic M- function.

7. COMPARATOR FUNCTION

£ The scale contains a comparator function that checks the amount on the weighing pan against set acceptable count or weight levels. When the comparator function is activated, “HI”, “OK” or “LO” indicator * will be displayed.

£ Before the comparator will work, Upper and Lower Limits must be set (see below). The levels are set by count or weight. So, if you are using weight for your comparator levels, calculate the weight before starting the procedure below.

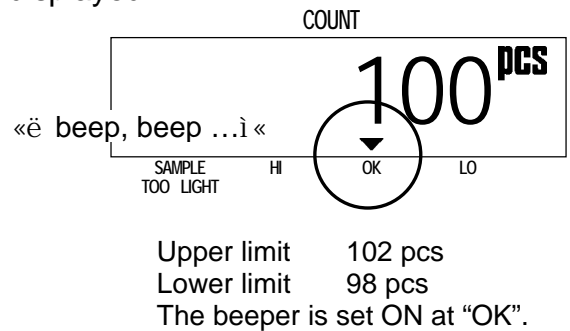

£ If the OP-04 is installed, comparator relay output is also available.


£ The comparator responds as follows,

- “HI” Upper Limits < Count / Weight Data
- “OK” Lower Limits mCount / Weight Data mUpper Limits
- “LO” Count / Weight Data < Lower Limits


To Set the Comparator

£ Start with the scale switched off.



1. Press and hold the **ZERO** key, then press the **ON/OFF** key – release both.

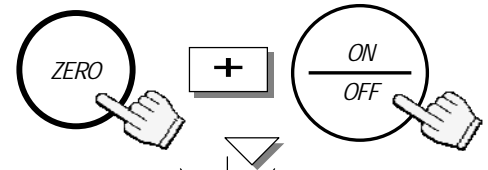




The count display will show “f-00” with “00” blinking.

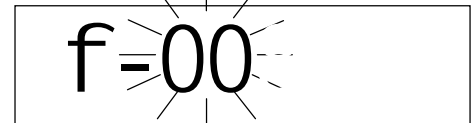




2. Press the **5** key to enter into the F-Function *F-05-X Comparator* section.

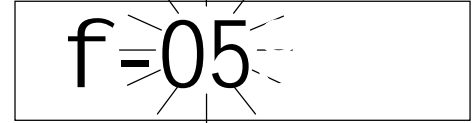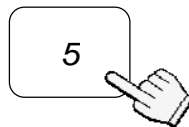

 3. Press the **ENTER** key.
The count display will show the F-Function and its present setting will blink.

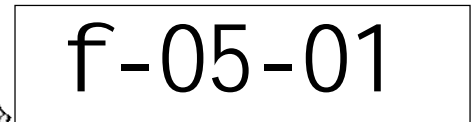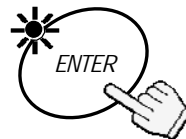


  4. Use the **0** à **6** keys to display the number of the desired setting.

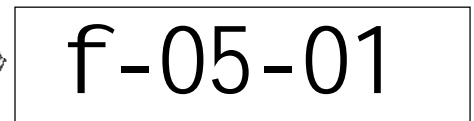

For example, let’s select “1” compare all data.

5. Press the **ENTER** key to save the setting and move to next F-Function, f-05-02.

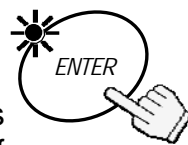


f-05-02

6. Continue to enter f-05 comparator settings – refer to “9-2. F-Functions” for a listing. If there are no changes to a F-Function, press the **ENTER** key to move to the next.

0

7. When finished: press the **ON/OFF** key to exit. Then, press it to turn the display back ON. Comparator functions and limits will now operate as set.

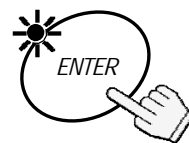


To ENTER
or
MOVE to next

Viewing Comparator Limits

£ The comparator limits you are using will be shown by pressing the **x** key.

£ Set f-09-01="0" to use this mode.

1. Press the **x** key, then upper limit will be shown.

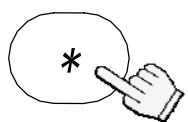

COUNT
102^{PCS}

2. Press the **x** key again, then lower limit will be shown.

WEIGHT 0000^{kg} UNIT WEIGHT Hi

 
3. Press the **x** key. The display will return to normal.

Upper limit


Changing Comparator Limits Instead of Setting the F-Function

£ Set f-09-01="0" to use this mode.

1. To change the upper limit, use the **0** à **9** 10-key pad to display new limit in step 1 above, and press the **ENTER** key. Then new limit is memorized and the lower limit will be shown.




COUNT
102^{PCS}

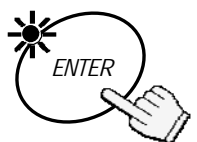

WEIGHT 0000^{kg} UNIT WEIGHT Hi

2. To change the lower limit, use the **0** à **9** 10-key pad to display new limit, and press the **ENTER** key. Then the display will return to normal with the new limit.

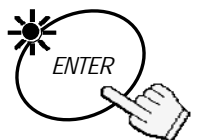

COUNT
98^{PCS}

£ Pressing the **x** key to go to next step, the input data is not memorized.

WEIGHT 0000^{kg} UNIT WEIGHT 10

⚠ These limits are held in memory even if power to the scale is switched off.

8. CALIBRATION

£ Calibration of the scale is required when it is initially installed, if it is moved often, or if it is moved a substantial distance. Calibration is also necessary in regular scale maintenance due to normal mechanical wear-and-tear, changes in seasonal temperature, humidity, air pressure, etc.


⚠ The scale is equipped with gravity compensation, which allows it to be calibrated in one location and then adjusted to match the gravity acceleration at another location where it will be used. But don't worry about this, as far as you calibrate the scale using a calibration weight and use it at same place.

⚠ The scale must perform "warm up" for at least 30 minutes before starting calibration.

8-1. Calibration Procedure Using a Weight

⚠ The scale should be powered on at least one-half hour to warm it up before starting the calibration procedure.

1. Remove the calibration switch cover, and press the calibration (CAL) switch. The scale shows "Cal" in the count display.

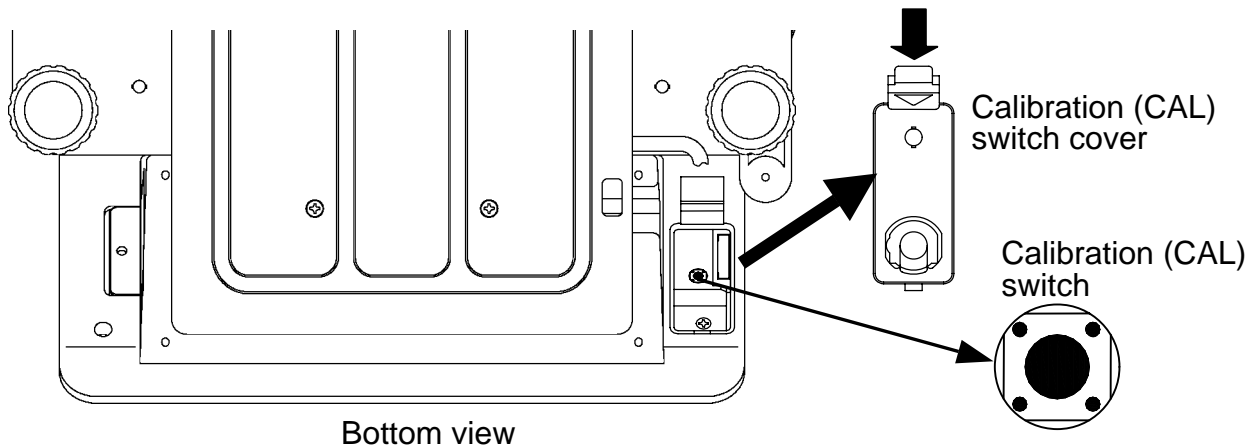



Bottom view


£ Press the **ON/OFF** key to exit without calibrating the scale.



£ Press and hold the **PRINT** key and press the **ON/OFF** key, then you can also enter calibration mode.

2. Press the **ZERO** key to enter into zero & span calibration mode.



£ The display flashes the required calibration weight value.

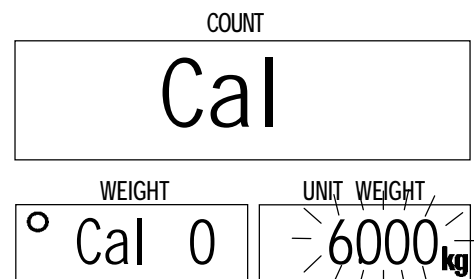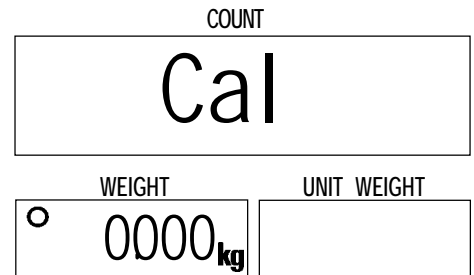

 
 If you know the exact weight value, or if you wish to use a different weight, use the **0** à **9** and **.** 10-key pad to display the desired calibration weight. (For example: Using 5 kg calibration weight that actually weighs 5.001 kg. Do not forget to enter a decimal point in this case.)

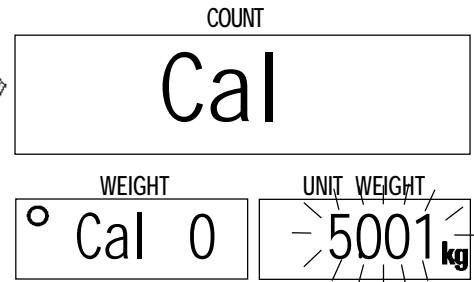


3. Press the **ENTER** key.
The calibration weight stops blinking.

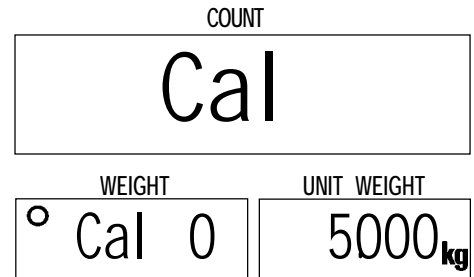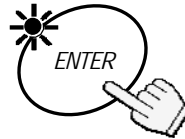


4. Making sure that there is nothing on, or touching the weighing pan, press the **ENTER** key. When zero calibration is completed, the display will show "Cal f".

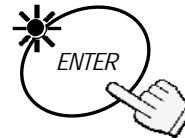


Nothing on the weighing pan!

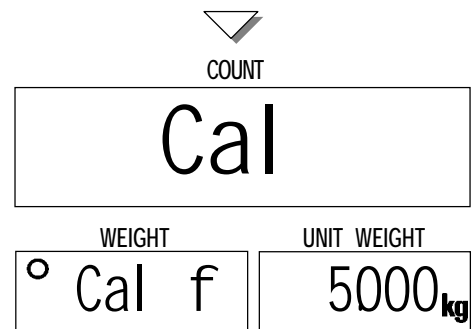


 
 If you don't need span calibration, press the **ON/OFF** key to exit from the calibration procedure.

5. Place the calibration weight on the weighing pan and press the **ENTER** key. When span calibration is completed, the display returns to step 1 showing the weight value for the calibration weight. Remove the calibration weight.

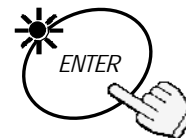


Place Calibration

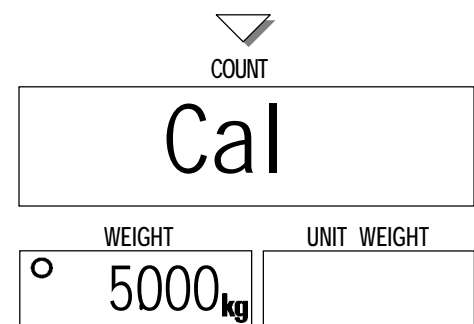

 If the calibration weight is not what it should be, an error will be displayed. Check if the weight is correct and try again.

6. Press the **ON/OFF** key to turn the scale off and re-attach the calibration switch cover. (End of the calibration procedure.)


 If the scale will be moved to another place, set the gravity acceleration value before calibration. The value must be of the area where the calibration is to be done.

8-2. Gravity Compensation



When the scale is first used or has been moved to different place, it should be calibrated using a calibration weight.

But if the calibration weight cannot be prepared, the gravity acceleration correction will compensate the scale. Change the gravity acceleration value of the scale to the value of the area where it will be used. Refer to the gravity acceleration map appended to the end of this manual.



- In the Step 1 above, press **TARE** key
The display flashes the gravity acceleration value stored in the scale.

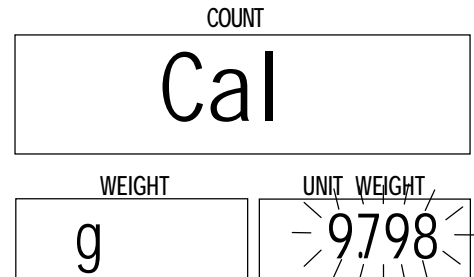

 - Use the **0** à **9** 10-key pad to display the desired gravity acceleration value.
(Example of the value 9.800 m/s².)

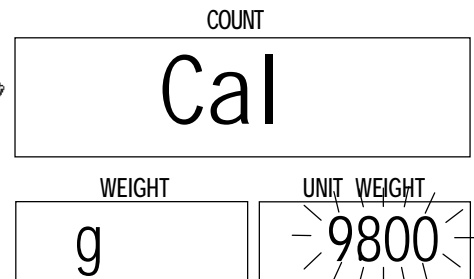

- Press the **ENTER** key.
The scale will store the new value.
If necessary to calibrate the scale using a weight, go to Step 2 of the previous section.

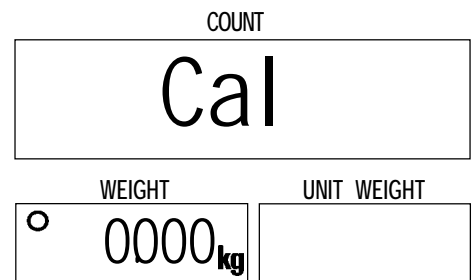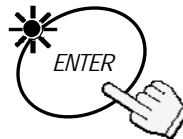

- Press the **ON/OFF** key to turn the scale off and re-attach the calibration switch cover. (End of the calibration procedure.)


9. F-FUNCTION PARAMETERS

9-1. To Change or View F-Function Settings


£ Start with the scale switched off.

1. Press and hold the **ZERO** key, then press the **ON/OFF** key.

The count display will show “f-00” with “00” blinking. Then release the both keys.

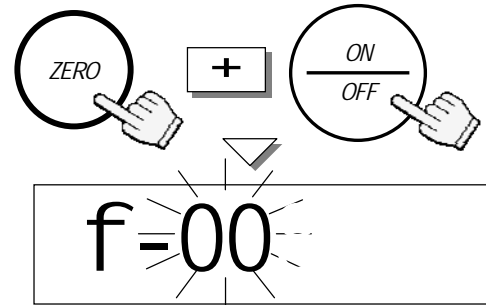



2. Press the **0** à **9** keys to display the number of the F-Function section.

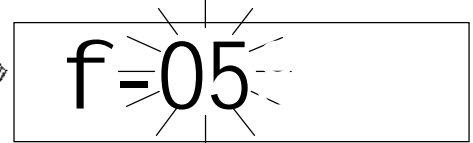


- £ For example: the **5** key to enter into the F-Function **F-05-X Comparator** section.

3. Press the **ENTER** key.


The count display will show the F-Function and its present setting will blink.

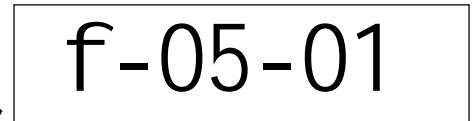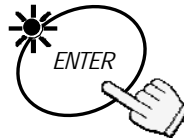

 4. You may now either change the setting (Step 5) or move to the next F-Function (Step 6).



5. Use the **0** à **9** keys to change the setting.

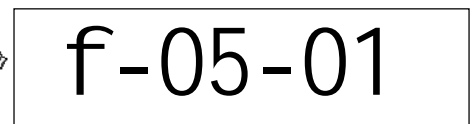



☞ The **C** key clears the input setting if you press the wrong key and want to re-enter.




☞ If you make a mistake and want to escape without saving any changes made after the last time the **ENTER** key was pressed – press the **ON/OFF** key to exit.

After the **ENTER** key is pressed, the data is entered.

6. Press the **ENTER** key to save any changes and/or move to next.

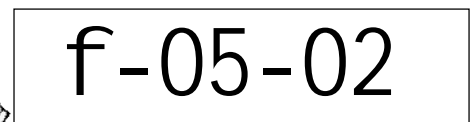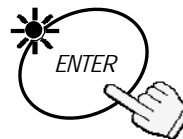

 7. When finished: press the **ON/OFF** key to exit. Then, press it to turn the display back ON. New settings will operate as set.



9-2. F-Functions

£ “ ” designates Factory Settings.

F-00-X Weight Unit USA Version ONLY

f-00-01	£ Weight Display when the scale is switched on. See also setting “f-09-01=2”.	
	0	kg (kilograms).
	1	lb (pounds).

f-00-02	£ Unit Weight (when “lb” is selected).	
	0	lb as piece weight.
	1	lb as 1,000 piece weight.

F-01-X Operations

f-01-01	£ Operation Mode.	
	0	Normal Operation. All features and keys available.
	1	Simplified Operation. The unit weight registration is by sample only. All other keys are disabled.

f-01-02	£ “Add” Sample Request Override. If the sample weight is too light and the scale asks to “Add” more sample pieces, using this F-Function, the unit weight can be entered without adding the requested sample pieces. Or disable the “Add” Sample Request function.	
	0	“Add” sample request function is disabled. Light unit weight can be accepted without “Add” more sample request.
	1	The unit weight <u>can be entered</u> without requested “Add” sample pieces (via the ENTER key).
	2	The unit weight <u>cannot be entered</u> without requested “Add” sample pieces (via the ENTER key).

£ “f-01-03” is for factory use and should be “0”.

f-01-04	£ Display ON Unit Weight – Reset or Last. When the scale is switched on, the scale can be set to recall the last unit weight used.	
	0	The unit weight is RESET (cleared) when display comes on.
	1	The unit weight last used will be entered automatically.

f-01-05

<p>£ ID Memory contents. The scale ID memory can contain unit weights with tare weights and comparator limits, or just unit weights alone.</p>	
00	ID memory contains the unit weight only.
<p>Tare Weight ↓ 00 ↑ Comparator limits</p>	<p>You select which data to be stored by keying in a 0 or 1 for the data: tare weight or comparator limits. <i>Example:</i> Key in 1 0 to display 10, ID memory contains the unit weight and comparator limits.</p>

F-02-X ACAI Operation & Min. Unit Weight

f-02-01

<p>£ ACAI Mode When Unit Weight entered by <i>Sample Pieces</i>.</p>	
0	ACAI is disabled.
1	ACAI automatic Operation.
2	ACAI Manual Mode (using the ENTER key).

f-02-02

<p>£ ACAI Mode When Unit Weight entered by <i>Keyboard or ID</i>.</p>	
0	ACAI is disabled.
1	ACAI Manual Mode (using the ENTER key). This setting works when f-02-01 setting is not "0".
2	ACAI Automatic obeys f-02-01 setting.

f-02-03

<p>£ Minimum Unit Weight. (1d=1 weighing display division) The factory setting may be different for some countries.</p>	
0	1/5 d
1	1/100 d

F-03-X M+ Accumulation Function

f-03-01	£ M+ Accumulation – Automatic or manual	
	0~	Manual accumulation (by pressing the M+ key).
	1	Automatic accumulation (Positive data only).

f-03-02	£ + or – Count Data Acceptable. (Manual Accumulation)	
	0~	Positive data only (5d and above).
	1	Positive and negative data (5d and above or –5d or below).

F-04-X Environment and Beeper

f-04-01	£ Zero Tracking. Zero tracking traces a drift from zero caused by temperature change etc., and stabilize the zero point.	
	0~	Zero tracking ON.
	1	Zero tracking OFF.

f-04-02	£ Response	
	0	Fast / sensitive
	1~	Normal
	2	Slow / stable
	3	Slower / stabler

f-04-03	£ Stable Detection Speed / Environment	
	0	Fast stable detection (good environment).
	1~	Normal.
2	Slow stable detection (poor environment).	

f-04-04	£ Beeper for key operation	
	0~	Beeper ON.
1	Beeper OFF.	

f-04-05	£ Auto power-off	
	0~	Auto power-off disabled.
	1	Auto power-off enabled.

£ “f-04-06” is for factory use and should be “0”.



F-05-X Comparator

f-05-01	£ Comparator Mode.	
	0~	Comparator OFF.
	1	Compare all data.
	2	Compare stable data.
	3	Compare all data except when near ZERO*.
	4	Compare stable data except when near ZERO*.
	5	Compare all positive data except when near ZERO*
	6	Compare stable positive data except when near ZERO*.
* “near ZERO” means between -4d and +4d of weight data.		

f-05-02	£ Data to Compare – Count or Weight	
	0~	Compare count data.
	1	Compare weight data.

f-05-03	£ Upper Limit.	
	0~	Enter via the 10-key pad. Use the <input type="text" value="."/> key to “set minus value.”

f-05-04	£ Lower Limit.	
	0~	Enter via the 10-key pad. Use the <input type="text" value="."/> key to set minus value.

 f-05-05	£ A Beeper With Comparator Results.	
	These are beeps for the comparator, not for the key operation.	
	000~	All Comparator Beepers are OFF.
		Example: 
0 = Beeper OFF 1 = Beeper ON		The OK beep sounds – HI & LO doesn't sound. The scale will beep continuously when display meets OK condition.

F-06-X RS-232C Data Output

F-06-X requires OP-03 or OP-04 RS-232C interface.

f-06-01

£ Data Out Mode	
0~	Key Mode: Data is sent by pressing the PRINT key. + Command Mode.
1	Stream Mode: Data is sent continuously. Command Mode cannot be used.
2	Auto-Print Mode A: Data is sent if the weight display is stable at +5d (weighing display division) and above. + Command Mode.
3	Auto-Print Mode B: Data is sent if the weight display is stable, at ±5d (weighing display division) and above/below. + Command Mode
4	Command Mode Only.
5	To use as Bar Code Reader Interface.
6	UFC format with Key Mode (see setting "0").
7	UFC format with Auto-Print Mode A (see setting "2").
8	UFC format with Auto-Print Mode B (see setting "3").

f-06-02

£ Data to be Sent.	
0100~	Count data sent.
	<p>You select which data to be sent by keying in a 0 or 1 for the data: ID no., PCS (count), weight or unit weight.</p> <p><i>Example:</i> Key in 1 1 0 0 to display 1100, this setting would send only the ID number and the count.</p>

f-06-03

£ Data Format		
0~	Format for AD-8121 MODE 1.	No difference between "0" and "1" when used with the UFC format.
1	Format for AD-8121 MODE 3.	
2	Format for general apparatuses, computers, etc.	

f-06-04

£ Baud Rate	
0~	2400 bps.
1	4800 bps.
2	9600 bps.

f-06-05

£ Data Length and Parity	
0~	7 bits, even parity.
1	7 bits, odd parity.
2	8 bits, non parity.

£ “f-07” and “f-08” are for factory use and should be “0”.

F-09-X key

f-09-01

F-09-01=2 is for USA version only.

£ Operation mode for the <input type="checkbox"/> key	
0~	Operating as a key to display and/or change comparator upper and lower limits.
1	Operating as <input type="checkbox"/> M- key to subtract Count data from M+ memory.
2	Operating as a key to toggle the weighing unit between “lb” and “g”.

f-09-02

£ Decimal Point and RS-232C Output	
0000~	Decimal point: “.” Header for stable weight data: “ST” Acknowledgment of command: <ACK><C _R ><L _F >
<p>Diagram: A box containing '0000'. Arrows point from the first '0' to 'ACK', from the second '0' to 'Decimal Point', from the third '0' to 'ST/WT', and from the fourth '0' to 'N.A.'.</p>	Select the decimal point “.” or “,” and output format for RS-232C. Set <input type="checkbox"/> 0 or <input type="checkbox"/> 1 for each bit. Decimal point: “0” = “.” “1” = “,” Header: “0” = “ST,+001.2346 kg” “1” = “WT,+001.2346 kg” Acknowledgment: “0” = “<ACK><C _R ><L _F >” “1” = “<ACK>”


£ “f-10”, “f-11” and “f-12” are for factory use and should be “0”.

10. ACAI FUNCTION

10-1. ACAI Automatic Counting Accuracy Improvement

The ACAI™ (Automatic Counting Accuracy Improvement) function recalculates the unit weight as more pieces are added to improve count accuracy.

When the scale calculates the unit weight from sample pieces, the more sample pieces that are used, the higher the accuracy.


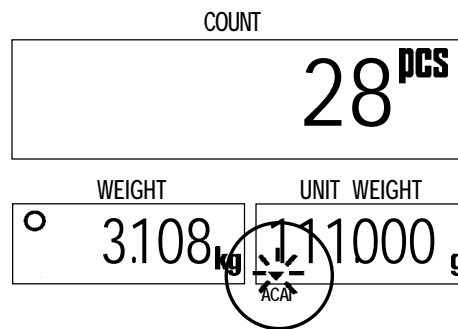


ACAI Notes



- £ You must do the ACAI procedure just after you set the unit weight. The samples must be still on the weighing pan.
- £ Do not take the samples off until the end of the ACAI procedure.
- £ You don't have to count out the pieces when you add, just stay within the ACAI range.
- £ Continue the ACAI procedure to reach the largest amount that you will be counting.
- £ If you want the most precise counting results for every different batch of the same items, use ACAI every time you start counting the next batch.
- £ The ACAI function is initially set to manual operation when the unit weight is set digitally by the keyboard, by ID memory or using computer via the serial interface. This can be set to the automatic mode. The ACAI mode when the unit weight is entered by ID or digital input is controlled by F-Function f-02-02. It is initially set at "0", ACAI manual operation mode. Set to "1" for automatic operation mode.

10-2. ACAI Automatic Operation


1. To start ACAI automatic operation, unit weight must be registered and the sample still on the weighing pan.

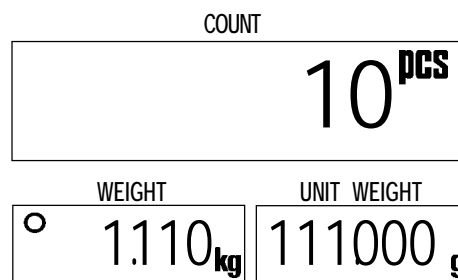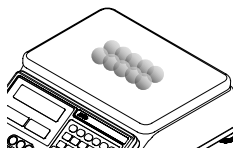


2. Add pieces within the nearest ACAI range (refer to table below). A good rule of thumb is to roughly double the amount on the weighing pan.

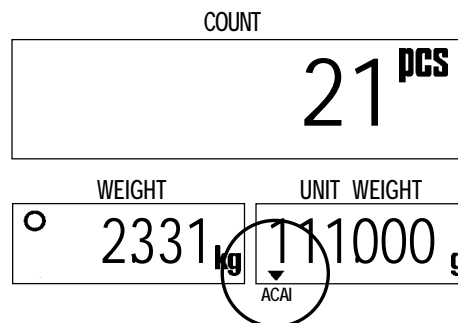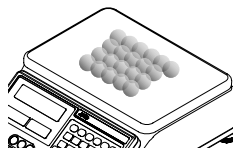


Pcs On the Weighing Pan	ACAI Addition Range		
10	13~26	60	63~122
20	23~49	70	73~138
30	33~70	80	83~152
40	43~89	90	93~166
50	53~106	100	103~299
		over 200	203~492

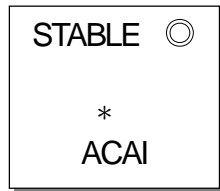

As you add, the ACAI annunciator will be ON as long as you are in range.

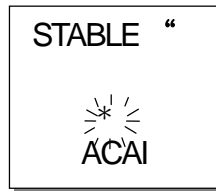

When you stop adding and the display becomes STABLE, the ACAI annunciator will blink.

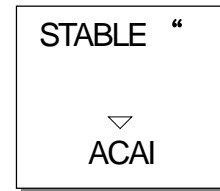

After the new unit weight is calculated, the annunciator will disappear,

3. Continue adding pieces within the ACAI range until you have reached a sample size as large as the largest number of pieces that you will be counting.

£ When you have added the maximum number of pieces required, remove the sample pieces and start your counting job.

10-3. ACAI Manual Operation

£ The ACAI procedure can also be controlled manually. The ACAI will not recalculate the unit weight until the **ENTER** key is pressed (as long as it is at the proper time and the guidelines in the ACAI Notes section have been followed).


£ The ACAI manual mode is controlled by F-Function f-02-1, set at "2".

£ To start ACAI manual operation, the unit weight must be registered and the samples still on the weighing pan.

1. Add pieces within the nearest ACAI range (refer to table in the previous section). The ACAI annunciator will stay ON as long as you are within ACAI range.

2. Wait until the display becomes stable and press the **ENTER** key.

When the new unit weight is calculated, the indicator will blink for a moment and disappear.

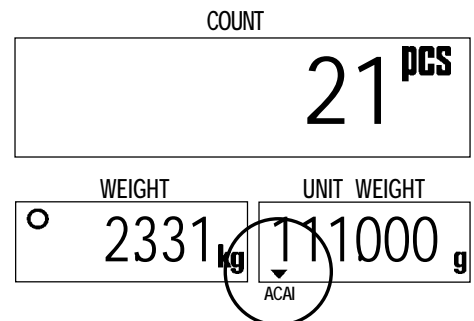

3. Continue adding pieces within the ACAI range until you have reached a sample size as large as the largest number of pieces that you will be counting.

£ When you have added the maximum number of pieces required, remove the sample pieces and start your counting job.

11. AWA FUNCTION

11-1. AWA Audible Weighing Assist

The AWA (Audible Weighing Assist) function will assist you to count a certain amount of pieces by listening to the buzzer sound. The buzzer sound changes its interval as the pieces getting close to, and stops at the target count.

There are three modes of operation. These can be selected by the  key.

Off mode: AWA function disabled.



Target mode: To set the number of pieces that you will count.


Interval mode: To set the number of pieces as an interval count. For example, when 20 pieces is set as an interval count, the target count will be 20, 40, 60, ... pieces.

- £ The buzzer starts to beep at the “target count – 9” pieces. As you add pieces and the count is getting close to the target, the buzzer changes its interval of beeps, shorter and shorter. Finally it stops at the target count.
- £ The buzzer will beep again for “target count + 1, 2, 3 or 4” pieces.
- £ The minimum number of pieces to set is 10.
- £ The number of pieces is set to less than 50 in the interval mode, the buzzer will start to beep at the “target count – 5” pieces.
- £ If the number of pieces is not more than 9, the buzzer does not beep in either mode.
- £ You cannot set the minus target or interval count. But the AWA function works for negative pieces, too.


 The AWA function should be disabled when the comparator buzzer is used.


11-2. To Enable/Disable AWA Function

Press the  key, then the display will show one of the three modes operation to set. The display moves among these setting modes cyclically by pressing the  key to select one of them.

 Press the **RESET** key in the setting modes, the scale returns to normal without changing the AWA function setting and the unit weight you are using.


Off Mode Setting

1. The count display shows “off” blinking.
2. When you do not use the AWA function, press the **ENTER** key. The display returns to normal with the AWA function deactivated. Or, move to the other mode setting by pressing the  key.


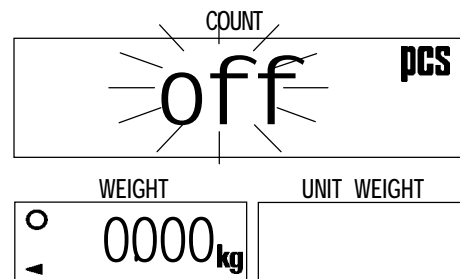



Target Mode Setting

1. The count display shows target count blinking.

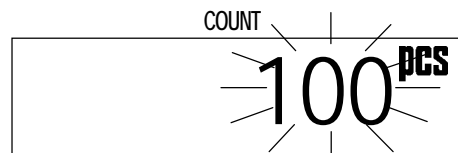


 2. Use the **0** à **9** keys to set or change the count.

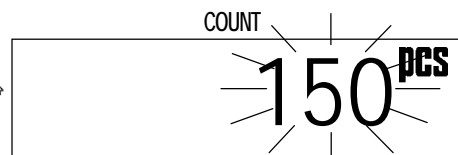


 The **C** key clears the input setting if you press the wrong key and want to re-enter.

 3. Press the **ENTER** key. The display returns to normal and the target mode will be activated.






Interval Mode Setting

1. The count display shows interval count blinking.

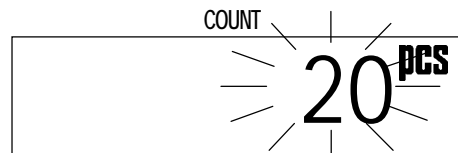


 2. Use the **0** à **9** keys to set or change the count.

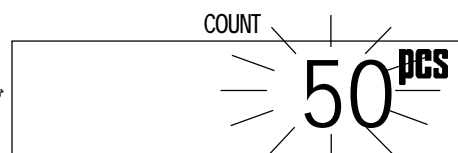

 The **C** key clears the input setting if you press the wrong key and want to re-enter.

 
3. Press the **ENTER** key. The display returns to normal and the interval mode will be activated.




12. OP-02 BATTERY

Using OP-02 SLA Battery

- £ The scale can operate with by an SLA (Sealed Lead Acid) battery that will be commercially available.
- £ The scale (with no other options) can be operated for around 80 hours by fully charged battery.
- £ The battery will take about 15 hours to be fully charged.
- ⚠ The battery life will vary depending on how the scale is used, ambient temperature and so on.



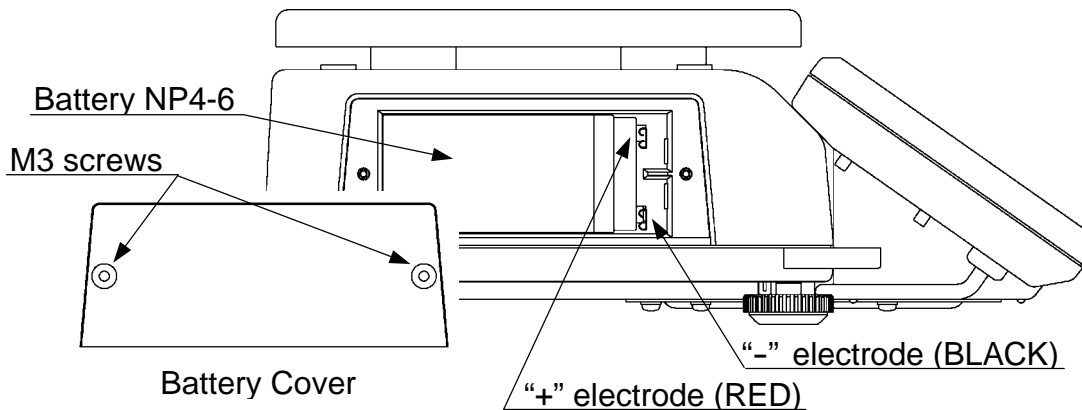

- £ Use a Yuasa Battery NP4-6 (6V, 4Ah).
- £ Use only the AC adapter that is provided with the HC-*i* scale.
- £ There will be risk of explosion if battery is connected improperly or replaced with by an incorrect type.
- £ Dispose of the used battery according to the local laws and regulations.



1. Disconnect the AC adapter from the scale.
2. Loosen the two M3 screws and remove the battery cover.
3. Connect the wires in the battery box to the battery.
- ⚠ **Be sure to connect RED wire to positive (+ / RED) terminal and BLACK wire to negative (- / BLACK) terminal. Or there is a risk of explosion.**
4. Place the battery into the box and attach the battery cover using the screws removed in the step 2 above.
5. Press the ON/OFF key and check if the scale works normally.

Charging the Battery

 When the count display shows “lo bat”, the battery power is almost exhausted and should be recharged.

 While the scale is operating with the battery, the annunciator * will light.

£ The scale can be used while the battery is in charging. After fully charged, the scale will change the charging process to trickle charge automatically.

£ Charge the battery at temperature between 0°C (32°F) and 40°C (104°F). Preferably 5°C (41°F) ~ 35°C (95°F) is recommended.

£ **Charge the battery when using for the first time.**

£ **The battery must be recharged regularly if the scale is not used for long time. Every 3 months in the warmer area and every 6 months in the cool area will be needed.**

£ **Be sure to use the AC adapter that provided with the HC-i.**

COUNT

lo bat ^{PCS}

WEIGHT UNIT WEIGHT

○ 3.108 _{kg}	111000 _g
-----------------------	---------------------


13. OP-03 RS-232C SERIAL INTERFACE

This interface allows the HC-*i* series to be connected with a multifunction printer or a personal computer.

£ The OP-03 unit includes an interface board, a connector plug (DIN type) and two screws. (M3x6 tapping type).


13-1. Installation

1. Disconnect the AC adapter from the scale. If the battery is used, switch off the scale.
2. Loosen the screw and remove the panel covering the option slot.
3. Connect the connector cable on the OP-03 to the connector inside the option slot.
4. Fix the OP-03 unit using the two screws included in the OP-03.

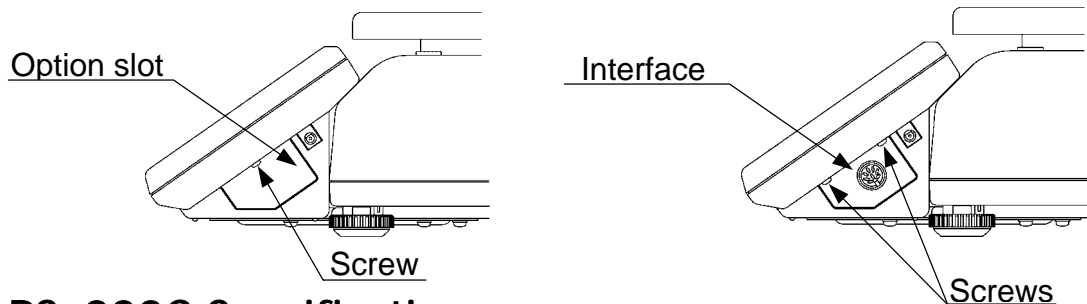


13-2. RS-232C Specifications

Transmission form	Asynchronous, bi-directional, half-duplex	
Data format	Baud rate: 2400, 4800, 9600 bps	
	Data: 7 bits + parity 1bit (even / odd) or 8 bits (non-parity)	
	Start bit: 1 bit	
	Stop bit: 1 bit	
	Code: ASCII	
	Terminator: Data Send / C _{RLF}	Data Receive / C _R or C _{RLF}

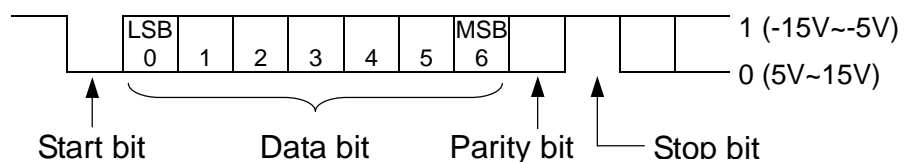

Pin connections

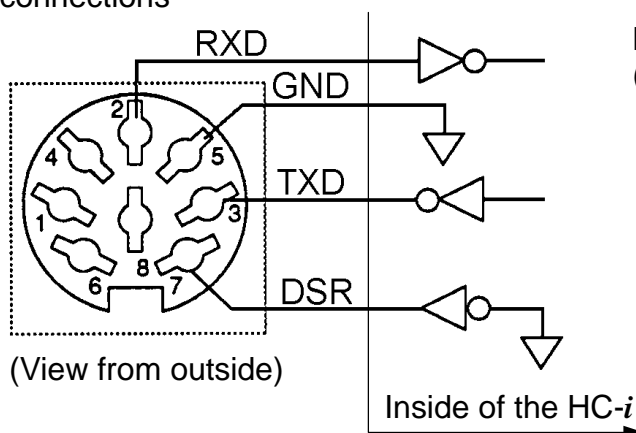

Mating connector: JA+TCP0586
(Included in the OP-03)


- 2 Receive data
- 3 Transmit data
- 5 Signal ground
- 7 Data set ready
- 1, 4, 6 and 8 N.C.

£ The HC-*i* is designated as DCE (Data Communication Equipment).

13-3. Data Output Mode

- £ The Data Output Modes and Parameters are set by F-Functions in F-06-X as described in the "9-2. F-Functions"
- £ To control the scale using commands from an external device, see "13-6. Command Mode".
- £ Refer to "13-6. Command Mode" about the output data format.


Data Output Mode (f-06-01)

- £ Key Mode (f-06-01="0")
When the weight display is stable, data is sent by pressing the PRINT key. The count display will blink when the data has been sent.
 - £ Stream Mode (f-06-01="1")
Data is sent continuously. The data-update rate is approximately 10 times per second for f-06-03="2". For f-06-03="0" or "1", the interval between continuous data is approximately 2 seconds.
 - £ Auto-print Mode A (f-06-01="2")
Data is sent if the weight display is stable at +5d (weighing display division) and above. The next transmission can not occur until after the weight display falls below +5d.
 - £ Auto-print Mode B (f-06-01="3")
Data is sent if the weight display is stable at $\pm 5d$ (weighing display division) and above/below. The next transmission can not occur until after the weight display falls between $-5d$ and $+5d$.
-  To use with the UFC format, refer to "13-7. Using UFC (Universal Flex Coms) Function"

Data to be Sent (f-06-02)

Select which data to be sent by keying in a 0 or 1 for the data: ID No., PCS (count), weight or unit weight.

Example: Key in 1 1 0 0 to display 1100, this setting would send only the ID number and the count.

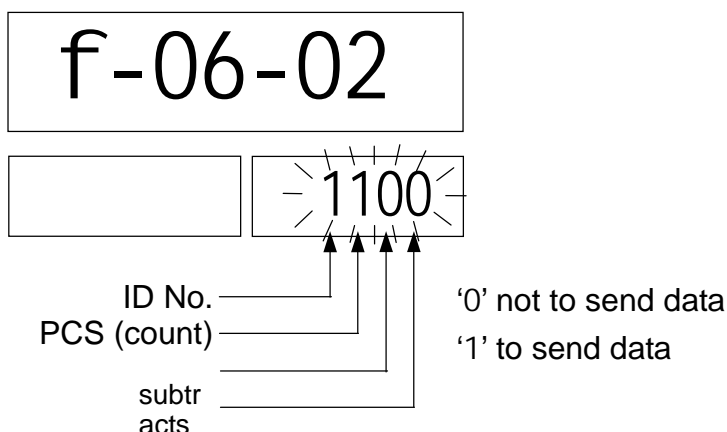

Data Format (f-06-03)

- £ Format for AD-8121 MODE 1 or 2. (f-06-03="0")
- £ Format for AD-8121 MODE 3. (f-06-03="1")
- £ Format for general apparatuses, computers, etc. (f-06-03="2")

Baud Rate (f-06-04)

Select the baud rate according to the device to be connected.

- £ 2400 bps (f-06-04="0") Select 2400 bps to connect with an AD-8121.
- £ 4800 bps (f-06-04="1")
- £ 9600 bps (f-06-04="2")

13-4. Connecting the AD-8121 Printer / MODE 1 or MODE 2

- £ When using the AD-8121 printer (MODE 1 or MODE 2), you will be able to get data: Number of data items, total, maximum, minimum, mean value, range of data (max. - min. data) and standard deviation.
- £ When using the AD-8121 with MODE 2, set f-06-02 to print pcs (count) data only or weight data only.
- £ To print date and time, use the AD-8121's calendar / clock function and set f-06-02 to print pcs (count) data only or weight data only.

Print Operations Settings

Print By:	F-Function f-06-01	Printer MODE
HC <input type="button" value="PRINT"/> key	0	MODE 1
Auto Print	2 or 3	MODE 1
Printer <input type="button" value="DATA"/> key	1	MODE 2

Example of f-06-02 settings

- £ To print pcs (count) data only: set f-06-02 at "0100"
- £ To print weight data only: set f-06-02 at "0010"
- £ To print pcs (count) and weight data: set f-06-02 at "0110"
- £ To print pcs, weight and unit weight data: set f-06-02 at "0111"
- £ To print total data (accumulated by the key), press the key so the count display shows the total, then press the key.
- £ If you are using the AD-8121's statistic functions, then set f-06-02 at "01#0" (# = 0 or 1) for pcs (count) data or "0010" for weight data.
- £ MODE 1 and 2 of the AD-8121 can not print ID numbers.


13-5. Connecting the AD-8121 Printer / MODE 3

£ When using MODE 3 of the AD-8121 printer, printouts are obtained using the **PRINT** key (f-06-01 = 0), or auto-print mode A/B (f-06-01 = 2 or 3).

£ The total data (accumulated by the **M+** key) will be printed along with the number of additions to **M+** memory.

⚠ The AD-8121 / MODE 3 does not have statistical functions.

AD-8121 Printout Sample

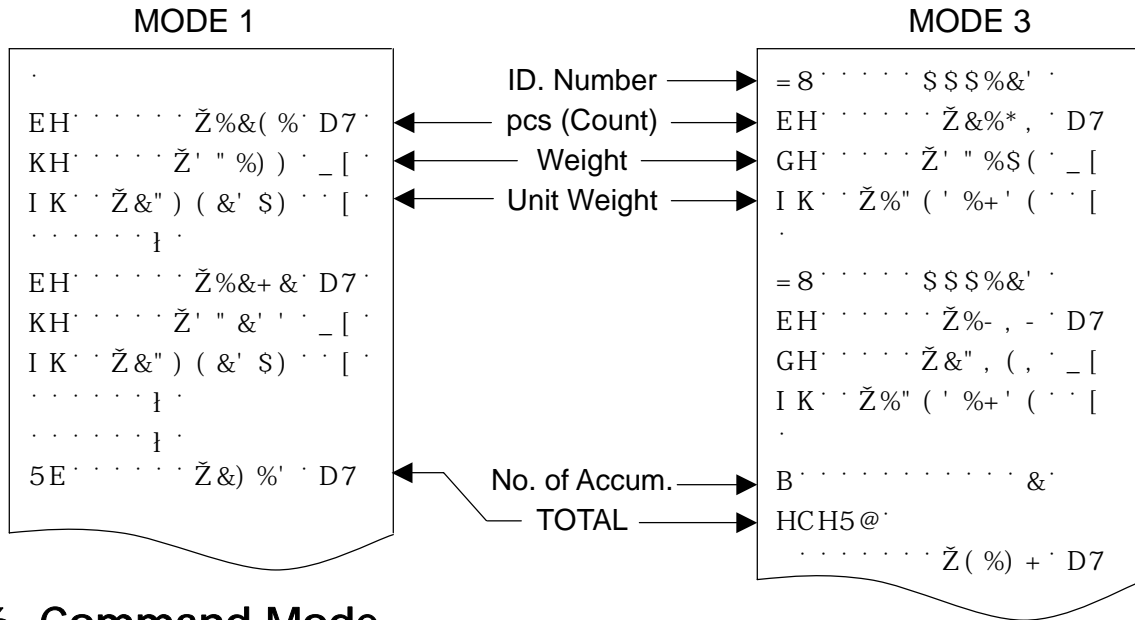

13-6. Command Mode

£ In the command mode, the scale is controlled by commands that come from an external device, computer etc.



⚠ Do not set f-06-01="1" (stream mode) to use with the command mode. if you don't want to use command mode together with key mode or auto-print mode, set f-06-01="4" (command mode only).

£ Use an optional cable below to connect with a computer.

AX-KO577A-200 RS-232C cable, for D-sub 25 pin, length 2m

AX-KO1786-200 RS-232C cable, for D-sub 9 pin, length 2m

(These cable have a DIN 7pin connector, but it can connect with the OP-03.)

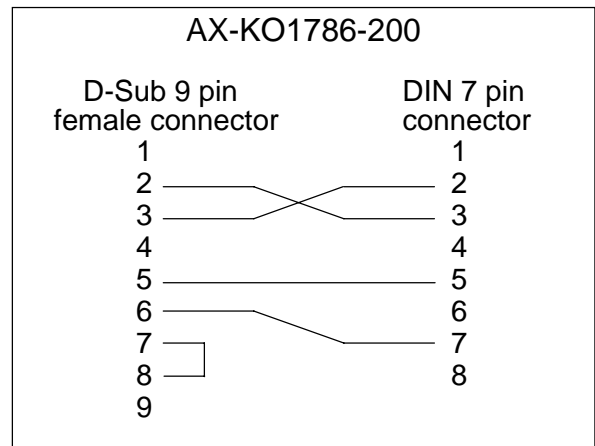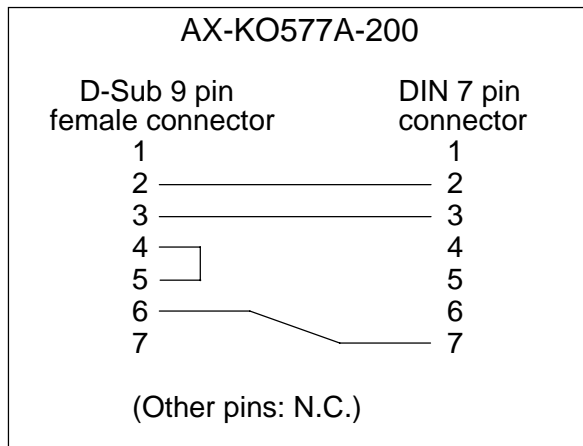

Command List

Command	Definition	Notes
@	Start / stop continuous data transmission.	
A	Same as RESET key.	Key command
D	Set a known tare weight.	"D,1.23C _R L _F " sets the tare weight as "1.23kg".
E	Store the unit weight and other values in use to ID memory.	Refer to the data format. Refer f-01-05
F	Recall a unit weight from ID memory.	"F12C _R L _F " recalls from ID12.
G	Set a known unit weight.	"G,0.123C _R L _F " sets the unit weight as "0.123g" (or "0.123 lb").
J	Same as the TOTAL key.	Key command
K	Same as the M+ key.	Key command
Q	Send data immediately.	Data depends on f-06-02
S	Send stable data after accepting command.	
T	Same as the TARE key.	Key command
X	Request a list of the F-Function parameters.	The last data terminates with <EOT> (04H)
Y	Request a list of the ID memory contents.	
Z	Same as the ZERO key.	Key command
ON	Start the scale from power on sequence	Refer to the data format for the reply.
?ID	Send the ID number in use.	
?QT	Send the pcs (count) data.	
?WT	Send the weight data.	
?UW	Send the unit weight in use.	
?AQ	Send the total (accumulated) M+ memory count	
?AN	Send the number of additions to M+ memory.	
?TR	Send the tare weight in use.	
?MR	Send the specified ID memory contents.	
MR	Store the unit weight and tare weight into the specified ID memory.	Refer to the data format for the reply.
ML	Store the comparator limits into the specified ID memory.	
CM	Clear the specified ID memory contents	"CM,1.2C _R L _F " clears content of i d12.
?FC	Send the specified F-Function setting.	Refer to the data format for the reply.
FC	Store the specified F-Function setting value.	

Acknowledgment and Error Codes

When the scale receives an external command, it reacts as follows:

£ If the command requests a data reply, the scale will send the data.

For other commands, the scale will send an acknowledgment <ACK><C_{RF}

£ If the command is **[S]**, **[T]** or **[Z]**, the scale will send a second acknowledgment <ACK><C_R><L_F> or <ACK> (see F-Function “f-09-02”) when the command operation is completed.

If an error occurs, the scale will send an error code.

£ The error format is **[E][C], [E][n][C][L_F]**, “n” being error number.

En	Definition	Notes
E0	Communication Error	Parity error, framing error, etc.
E1	Undefined command Error	Command does not exist for the scale.
E2	Scale not ready Error.	The scale is not in a state where a command could be expected.
E4	Too many characters Error	Command contains too many characters.
E6	Format Error	Command contains invalid characters.
E7	Out of range Error	Value is out of range. Tare weight is more than the capacity, etc.

Data Format “ _ ” in examples below shows “Space” (20H).

£ Examples below are for f-09-02=”0000”. <ACK>=06H.

£ Store unit weight and other value in use (according to f-01-05).

Command **[E], [1][2][C][L_F]** Stores to i d-12. (E,000012C_RL_F is acceptable.)

Reply **[ACK][C][L_F]**

£ ID Number

Command **[?][I][D][C][L_F]**

Reply **[I][D], [0][0][0][0][1][2][C][L_F]**

£ PCS (Count) Data

Command **[?][Q][T][C][L_F]**

Reply	Q	T	,	+	0	0	0	0	1	2	3	4	_	P	C	C	L _F	Stable Positive Data
	U	S	,	-	0	0	0	0	5	6	7	8	_	P	C	C	L _F	Unstable Negative Data
	O	L	,	+	9	9	9	9	9	9	9	9	_	P	C	C	L _F	‘E’ display

£ Weight Data

Command **[?][W][T][C][L_F]**

Reply	S	T	,	+	0	0	1	.	2	3	4	6	_	k	g	C	L _F	Stable Positive Data
	S	T	,	-	0	0	2	.	7	2	5	5	_	l	b	C	L _F	Stable Negative Data
	U	S	,	-	0	0	1	2	.	3	4	6	_	l	b	C	L _F	Unstable Negative Data
	U	S	,	+	0	0	0	5	.	5	9	3	_	k	g	C	L _F	Unstable Positive Data
	O	L	,	+	9	9	9	9	.	9	9	9	_	k	g	C	L _F	‘E’ display
	O	L	,	-	9	9	9	9	.	9	9	9	_	l	b	C	L _F	‘-E’ display

£ Unit Weight

Command

?	U	W	C	L _F
---	---	---	---	----------------

Reply

U	W	,	+	1	.	2	3	4	5	6	7	_	_	g	C	L _F
U	W	,	+	0	.	2	7	2	5	3	1	_	l	b	C	L _F

£ Total Count

Command

?	A	Q	C	L _F
---	---	---	---	----------------

Reply

A	Q	,	+	0	0	9	9	9	9	9	9	_	P	C	C	L _F
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	----------------

£ Accumulation Numbers

Command

?	A	N	C	L _F
---	---	---	---	----------------

Reply

A	N	,	0	0	0	0	1	2	3	4	C	L _F
---	---	---	---	---	---	---	---	---	---	---	---	----------------

£ Tare Weight

Command

?	T	R	C	L _F
---	---	---	---	----------------

Reply

T	R	,	+	0	0	1	.	2	3	4	6	_	k	g	C	L _F
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	----------------

£ Request the scale to reply with the contents of ID memory.

Command

?	M	R	,	1	2	C	L _F
---	---	---	---	---	---	---	----------------

 Request the contents of i d-12.

Reply

M	R	,	0	0	0	0	1	2	,	1	2	.	3	4	5	6	7	,	+	0	0	0
.	2	3	4	5	,	+	0	0	0	0	1	3	5	7	,	+	0	0	0	0	1	2
4	6	,	+	0	1	2	3	4	5	6	7	,	0	0	0	0	1	2	3	4	C	L _F

MR, ID number (6 digit), unit weight (8 digit including decimal point), tare weight (9 digit including sign and decimal point), upper limit (9 digit including sign), lower limit (9 digit including sign), total count (9 digit including sign), number of addition (8 digit) C_R L_F .

£ Memorize (enter) unit weight and tare weight into a specified ID memory.

Command

M	R	,	1	2	,	1	.	2	3	,	0	.	3	4	5	C	L _F
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	----------------

ID #
Unit Weight
Tare Weight

Reply

ACK	C	L _F
-----	---	----------------

ID Number: Maximum 6 digit
 Unit Weight: Maximum 8 digit including decimal point
 Tare Weight: Maximum 8 digit including decimal point ('kg' or 'lb' depends on f-00 setting).

£ Store the comparator limits into a specified ID memory.

Command

M	L	,	1	2	,	+	1	0	1	0	,	+	9	9	0	C	L _F
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	----------------

ID #
Upper Limit
Low Limit

Reply

ACK	C	L _F
-----	---	----------------

ID Number: Maximum 6 digit
Upper Limit: Maximum 9 digit including sign
Lower Limit: Maximum 9 digit including sign

£ Request the scale to reply with the setting of F-Function.

Command

?	F	C	,	0	5	0	1	C	L _F
---	---	---	---	---	---	---	---	---	----------------

 Request to reply with the setting of f-05-01.

Reply

F	C	,	0	5	0	1	,	0	C	L _F
---	---	---	---	---	---	---	---	---	---	----------------

 f-05-01 = 0

F-# Setting value

£ Store the specified F-Function setting value

Command

F	C	,	0	5	0	3	,	+	1	2	3	4	C	L _F
---	---	---	---	---	---	---	---	---	---	---	---	---	---	----------------

 Set "1234" as the Upper limit.

F-# Setting value

F-Function Number: 4 digits
Setting Value: Maximum 8 digits including sign.

Reply

ACK	C	L _F
-----	---	----------------


Command

O	N	C	L _F
---	---	---	----------------

 Start with new settings.

Reply


ACK	C	L _F
-----	---	----------------

 Having finished the "FC" command, send the "ON" command to start the scale with new settings. The scale replies <ACK> (06H) and starts.

13-6. Using UFC (Universal Flex Coms) Function

- £ The UFC function allows you to print out as you format the printer (UFC format).
- £ The scale can store the UFC format as text data. It will include parameters to replace with the count data, weight data and so on.
- £ The maximum number of text data is 384 characters.
- £ Terminator for the “PF” command is "C_R" or "C_RL_F".
- £ Using “PF” command, the text data has to be sent to the scale from the computer in advance. Then, connect the scale with the printer.
- £ When the PRINT key is pressed or by auto-print mode A/B, the scale will send the stored text data with the parameters replaced by the original data.

Store Text Data into the Scale Memory

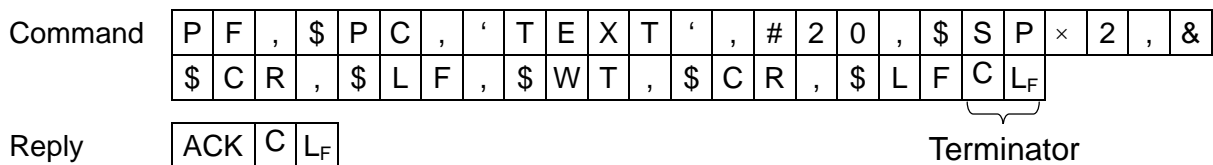

The “PF” command sends text data that will include:

- £ Parameters for the scale data and control codes

Parameter	Data & Code	Parameter	Data & Code
\$PC	Count	\$CD	ID number in use
\$WT	Weight	\$CP	Comparator result
\$UW	Unit weight in use	\$CM	Comma
\$TR	Tare weight in use	\$SP	Space
\$TL	Total count	\$CR	Carriage Return
\$AN	Accumulation numbers	\$LF	Line Feed

These parameters must be used in capital letters.

- £ ASCII text string

Text string is described in single quote marks as ‘Data’.

The single quote itself is written as ’’(2 single quotes).

Example: Text ‘ABC’ is described as ’’ABC’’.

- £ The ASCII hexadecimal code

The ASCII hexadecimal codes are written in the form “#” + 2 hexadecimal digits.

This will mainly be used to send control codes that can’t be described as a text string.

Example: #04 “EOT” of ASCII code

- £ Repeat data

The control codes \$SP, \$CR and \$LF can be used with “* + maximum 2 digit number”. That code will be repeated the number of times designated.

Example: \$LF*9 Repeat “\$LF” 9 times.

\$SP*12 Put 12 “Spaces”.

- £ Link mark “&”

If you will send more than 2 lines of data, attach “&” to the end of the first line. Then, the scale considers the data to be continued.

⚠ "Space" or "," will be used to separate these data. You can skip them, but you cannot skip "," after "PF". You must start with "PF".

Data Format for the Scale Data

"_" in examples below shows "Space" (20H).

Parameters for the scale data will be replaced by the format below when the scale sends them out.

⚠ Data has a fixed number of digits including a sign and a decimal point. The insignificant zeros are replaced by "Space (20H)" (except the ID number).

\$PC	<table border="1"><tr><td>_</td><td>_</td><td>_</td><td>_</td><td>+</td><td>1</td><td>2</td><td>3</td><td>4</td><td>_</td><td>P</td><td>C</td></tr></table>	_	_	_	_	+	1	2	3	4	_	P	C	1234 pcs / 9 digit data + 3 digit unit
_	_	_	_	+	1	2	3	4	_	P	C			
\$WT	<table border="1"><tr><td>_</td><td>_</td><td>+</td><td>4</td><td>.</td><td>3</td><td>2</td><td>1</td><td>0</td><td>_</td><td>k</td><td>g</td></tr></table>	_	_	+	4	.	3	2	1	0	_	k	g	4.3210 kg / 9 digit data + 3 digit unit
_	_	+	4	.	3	2	1	0	_	k	g			
\$UW	<table border="1"><tr><td>+</td><td>1</td><td>.</td><td>2</td><td>3</td><td>4</td><td>5</td><td>6</td><td>7</td><td>_</td><td>_</td><td>g</td></tr></table>	+	1	.	2	3	4	5	6	7	_	_	g	1.234567 g / 9 digit data + 3 digit unit
+	1	.	2	3	4	5	6	7	_	_	g			
\$TR	<table border="1"><tr><td>_</td><td>_</td><td>+</td><td>1</td><td>.</td><td>2</td><td>3</td><td>4</td><td>5</td><td>_</td><td>k</td><td>g</td></tr></table>	_	_	+	1	.	2	3	4	5	_	k	g	1.2345 kg / 9 digit data + 3 digit unit
_	_	+	1	.	2	3	4	5	_	k	g			
\$TL	<table border="1"><tr><td>_</td><td>_</td><td>+</td><td>9</td><td>9</td><td>9</td><td>9</td><td>9</td><td>9</td><td>_</td><td>P</td><td>C</td></tr></table>	_	_	+	9	9	9	9	9	9	_	P	C	999999 pcs / 9 digit data + 3 digit unit
_	_	+	9	9	9	9	9	9	_	P	C			
\$AN	<table border="1"><tr><td>_</td><td>_</td><td>_</td><td>_</td><td>1</td><td>2</td><td>3</td><td>4</td></tr></table>	_	_	_	_	1	2	3	4	1234 times / 8 digit data				
_	_	_	_	1	2	3	4							
\$CD	<table border="1"><tr><td>0</td><td>0</td><td>0</td><td>0</td><td>1</td><td>2</td></tr></table>	0	0	0	0	1	2	ID Number 000012 / 6 digit data						
0	0	0	0	1	2									
\$CP	<table border="1"><tr><td>O</td><td>K</td></tr><tr><td>_</td><td>_</td></tr></table>	O	K	_	_	Result is "OK" / 2 characters Result is not available.								
O	K													
_	_													

Examples of PF command and AD-8121 Printout Sample

AD-8121 (f-06-03=" 0" or "1")
(HC-i à AD-8121)

"PF" Command
(Computer à HC-i)

```
= 8 ` SSSS%&`
.
7ci bh`
. . . . . Ž%&' ( ` D7
I b] h` KY] [ \h`
. . . . . Ž%" &' ( ) * + . . [
KY] [ \h`
. . . . . Ž%" ) &' ) ` _ [
.
85H9` $- #%, #&$$)
H=A9` . . . %&. ' ( . ) *
.
. . . 5/ 8` < 7! % ) ? ]`
```

```
PF, ' ID~', $CD, $CR, $LF, &
$CR, $LF, &
' Count', $CR, $LF, &
$SP*4, $PC, $CR, $LF, &
' Unit~Weight', $CR, $LF, &
$SP*4, $UW, $CR, $LF, &
' Weight', $CR, $LF, &
$SP*4, $WT, $CR, $LF, &
$CR, $LF, &
#1B, #44, $CR, $LF, &
#1B, #54, $CR, $LF, &
$CR, $LF, &
' ~-A&D~HC-15Ki', $CR, $LF
```

Terminator codes ↑

"~" shows "Space".

⚠ Normally the printer needs to receive the terminator, and do not forget to add the terminator code(s) to the end of text data.

14. OP-04 RS-232C & RELAY OUTPUT

RS-232C interface and relay output for comparator results are obtained by installing OP-04.


- £ The OP-04 unit includes an interface board, a connector plug (DIN type) and two screws. (M3x6 tapping type).

OP-04 Installation

- £ See "13-1. Installation".
- £ OP-04 is installed to the same slot with the OP-03.
- £ The RS-232C specifications are same as the OP-03 RS-232C interface and refer to "13. OP-03 RS-232C SERIAL INTERFACE".

Comparator Relay Output Circuit

Pin connections

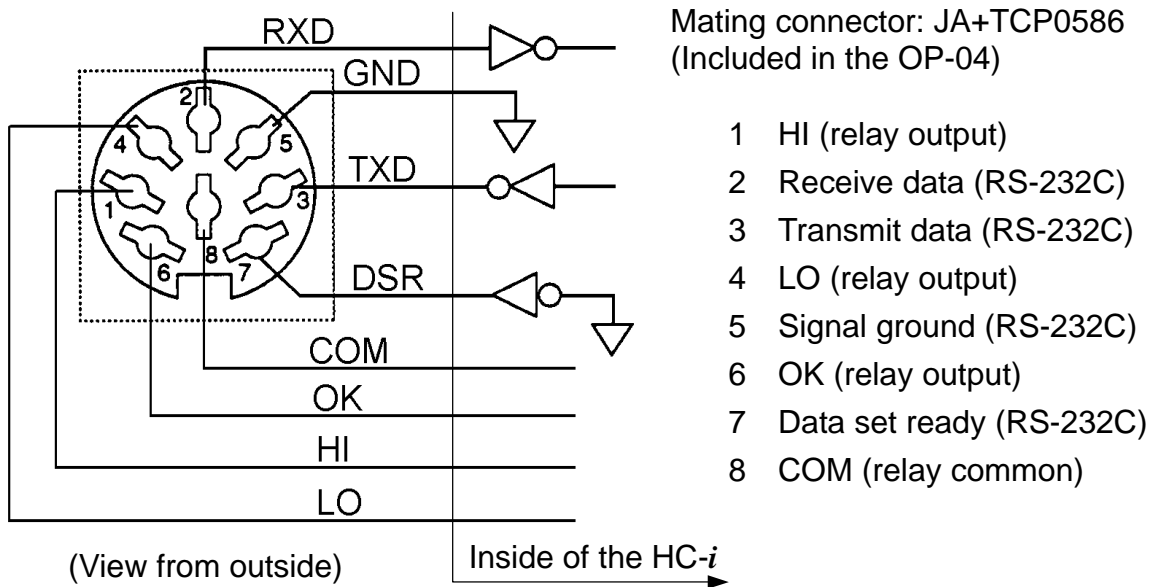

- £ The HC-*i* is designated as DCE (Data Communication Equipment).

Maximum rating of the Relay Output

The maximum rating of the replay output is as follows.

- £ Maximum voltage: 50V DC
- £ Maximum current: 100mA DC
- £ Maximum ON resistance 30 Ω

15. SPECIFICATIONS


MODEL	HC-3Ki	HC-6Ki	HC-15Ki	HC-30Ki
Capacity kg	3 kg	6 kg	15 kg	30 kg
Resolution (kg)	0.0005 kg	0.001 kg	0.002 kg	0.005 kg
Capacity lb	6 lb	15 lb	30 lb	60 lb
Resolution lb	0.001 lb	0.002 lb	0.005 lb	0.01 lb
Sample Size	10 pieces normal – 5, 25, 50, 100 or random number, user selectable			
Min. Unit Weight *)	0.1 g / 0.005 g	0.2 g / 0.01 g	0.4 g / 0.02 g	1 g / 0.05 g
Non-linearity	±0.5 g	±1 g	±2 g	±5 g
Repeatability	0.5 g	1 g	2 g	5 g
Span Drift	0.002%/°C (5°C~35°C) typ.			
Operating Temp.	-10°C~40°C/14°F~104°F, less than 85% RH (No Condensation)			
Display	7 segment LCD, Character height: pcs 18.6mm, weight/unit weight 11.4mm			
Display Update	Approximately 10 times per second			
Interface	RS-232C (option)			
Power	AC adapter or SLA Battery (option) Battery Operating Time: Approx. 80 hours (without interface)			
Platform Size	300 x 210 mm / 11.8 x 8.3 inches			
Dimensions	315(W) x 331(D) x 126(H) mm / 12.4(W) x 13.0(D) x 5.0(H) inches			
Weight (approx.)	4.7 kg / 10.4 lb			
Calibration Weight	3kg±0.1g	6kg±0.2g	15kg±0.5g	30kg±1g
Accessories	This manual, AC adapter			

*) Min. unit weight varies according to the function setting (f-02-03).

Options

- OP-02 SLA Battery (Yuasa Battery NP4-6 recommended.)
 - OP-03 RS-232C (See note.)
 - OP-04 RS-232C + Comparator Relay output (See note.)
 - OP-05 Remote Scale Interface
- Note) OP-03 and OP-04 cannot co-exist.


Dimensions

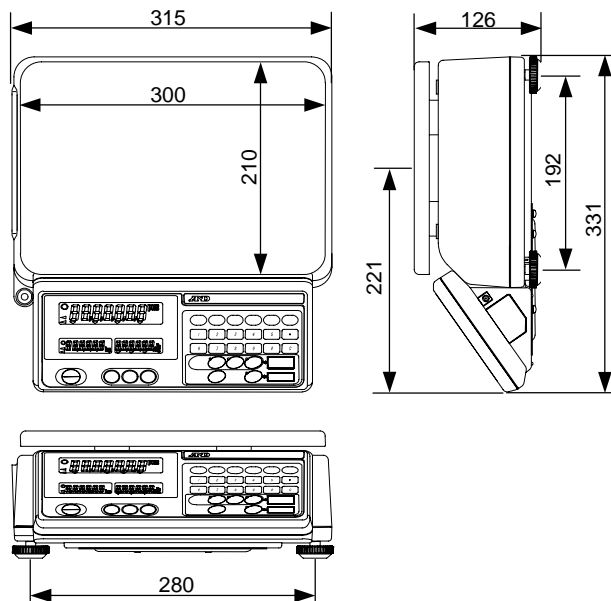


16. GRAVITY ACCELERATION MAP

Values of gravity at various locations

Amsterdam	9.813 m/s ²	Manila	9.784 m/s ²
Athens	9.807 m/s ²	Melbourne	9.800 m/s ²
Auckland NZ	9.799 m/s ²	Mexico City	9.779 m/s ²
Bangkok	9.783 m/s ²	Milan	9.806 m/s ²
Birmingham	9.813 m/s ²	New York	9.802 m/s ²
Brussels	9.811 m/s ²	Oslo	9.819 m/s ²
Buenos Aires	9.797 m/s ²	Ottawa	9.806 m/s ²
Calcutta	9.788 m/s ²	Paris	9.809 m/s ²
Cape Town	9.796 m/s ²	Rio de Janeiro	9.788 m/s ²
Chicago	9.803 m/s ²	Rome	9.803 m/s ²
Copenhagen	9.815 m/s ²	San Francisco	9.800 m/s ²
Cyprus	9.797 m/s ²	Singapore	9.781 m/s ²
Djakarta	9.781 m/s ²	Stockholm	9.818 m/s ²
Frankfurt	9.810 m/s ²	Sydney	9.797 m/s ²
Glasgow	9.816 m/s ²	Taichung	9.789 m/s ²
Havana	9.788 m/s ²	Taiwan	9.788 m/s ²
Helsinki	9.819 m/s ²	Taipei	9.790 m/s ²
Kuwait	9.793 m/s ²	Tokyo	9.798 m/s ²
Lisbon	9.801 m/s ²	Vancouver, BC	9.809 m/s ²
London (Greenwich)	9.812 m/s ²	Washington DC	9.801 m/s ²
Los Angeles	9.796 m/s ²	Wellington NZ	9.803 m/s ²
Madrid	9.800 m/s ²	Zurich	9.807 m/s ²

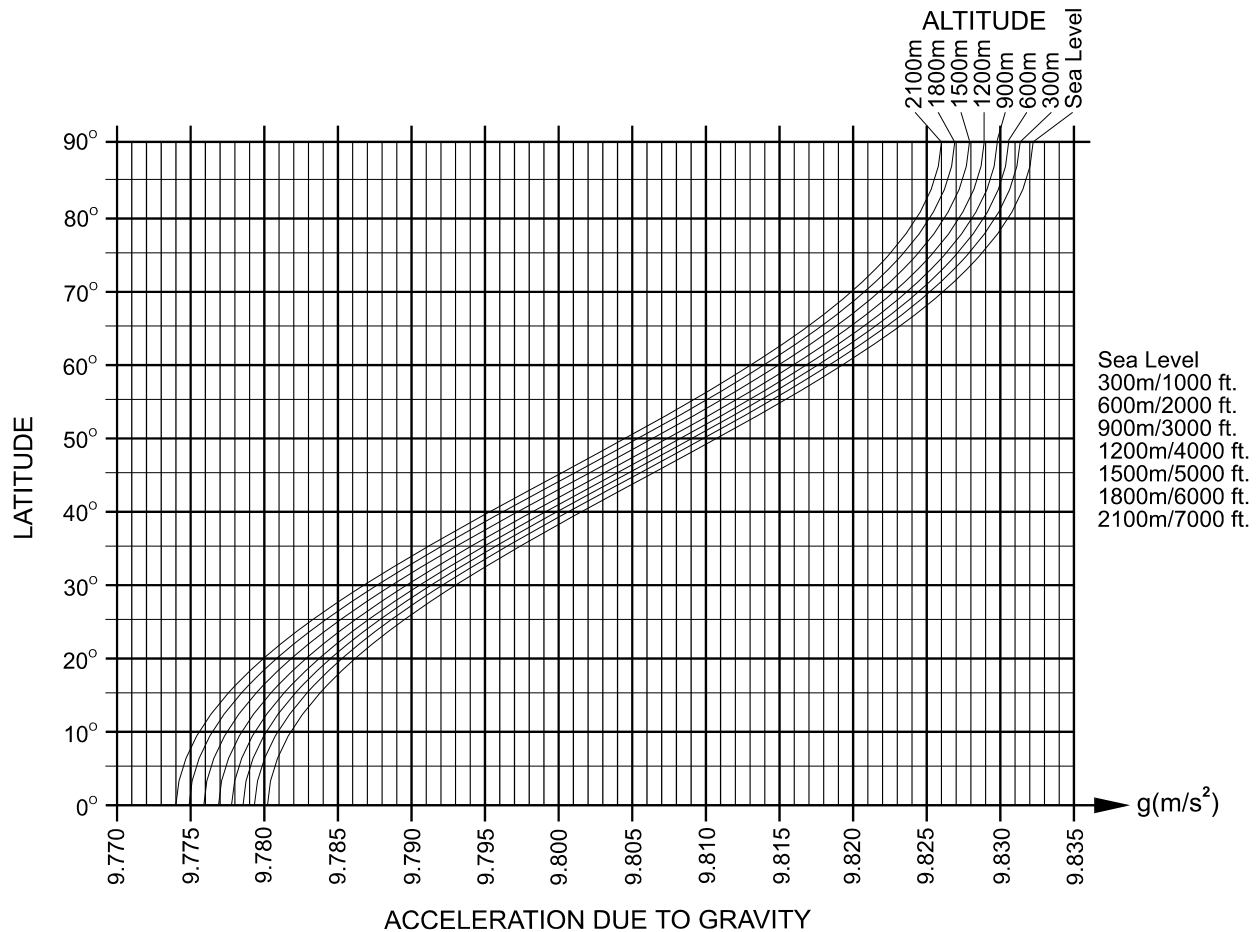

World map

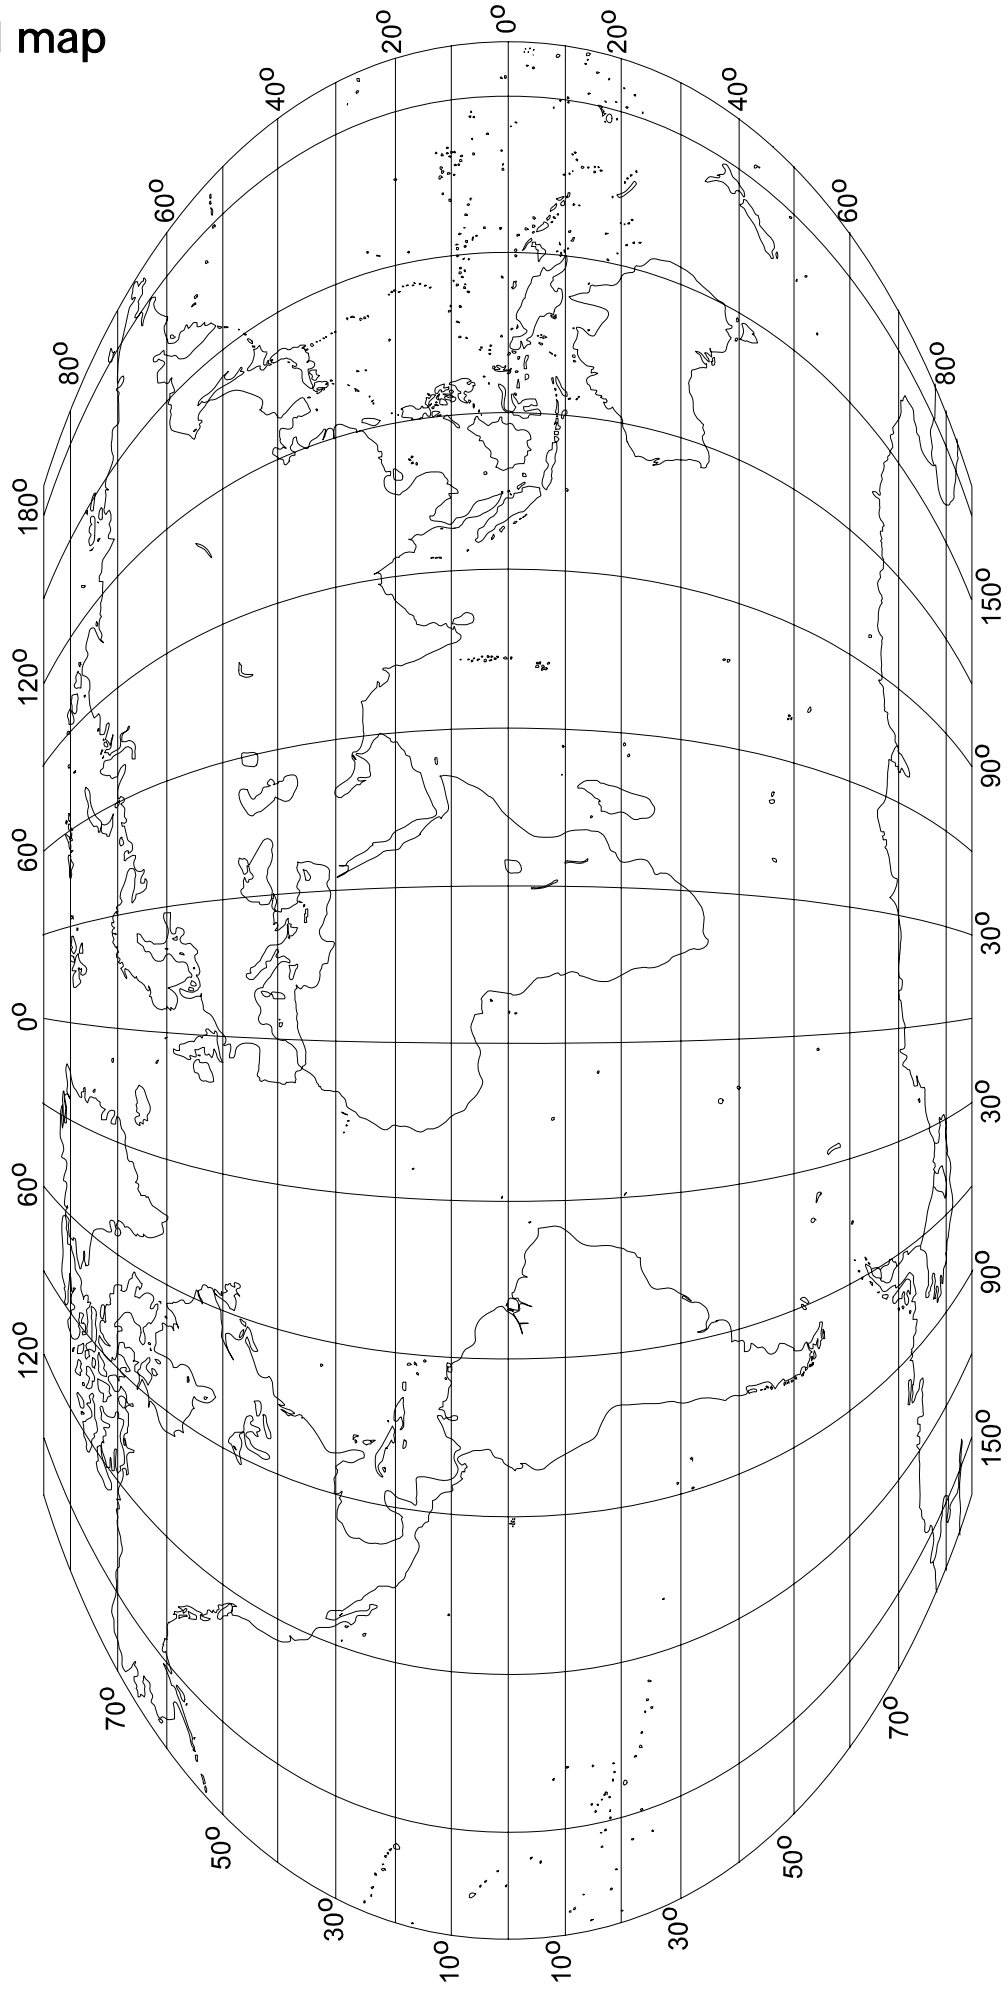



A&D Company, Limited

3-23-14 Higashi-Ikebukuro, Toshima-ku, Tokyo 170-0013 JAPAN
Telephone: [81] (3) 5391-6132 Fax: [81] (3) 5391-6148

A&D ENGINEERING, INC.

1555, McCandless Drive, Milpitas, CA. 95035 U.S.A.
Telephone: [1] (408) 263-5333 Fax: [1] (408)263-0119

A&D INSTRUMENTS LTD.

Unit 24/26 Blacklands Way, Abingdon Business Park, Abingdon, Oxon OX14 1DY United Kingdom
Telephone: [44] (1235) 550420 Fax: [44] (1235) 550485

<German Scales Office>

Große Straße 13 b 22926 Ahrensburg GERMANY
Telephone: [49] (0) 4102 459230 Fax:[49] (0) 4102 459231

A&D MERCURY PTY. LTD.

32 Dew Street, Thebarton, South Australia 5031 AUSTRALIA
Telephone: [61] (8) 8301-8100 Fax: [61] (8) 8352-7409

A&D KOREA Limited

8th Floor, Manhattan Bldg. 36-2 Yoido-dong, Youngdeungpo-ku, Seoul, KOREA
Telephone: [82] (2) 780-4101 Fax: [82] (2) 782-4280