# 

FX-1207WP/FX-2007WP/FX-3007WP FX-12007WP/FX-20007WP/FX-30007WP

# Dust and Waterproof Precision Balance

INSTRUCTION MANUAL



© 2007 A&D Company Ltd. All rights reserved.

No part of this publication may be reproduced, transmitted, transcribed, or translated into any language in any form by any means without the written permission of A&D Company Ltd.

The contents of this manual and the specifications of the instrument covered by this manual are subject to change for improvement without notice.

Windows, Word and Excel are the registered trademarks of the Microsoft Corporation.

# **CONTENTS**

# **Basic Operation**

1. INTRODUCTION	3
1-1 About This Manual	3
1-2 Features	3
1-3 Compliance	4
2. UNPACKING THE BALANCE	6
2-1 Unpacking	6
2-2 Installing the Balance	
3. PRECAUTIONS	8
3-1 Before Use	8
3-2 During Use	
3-3 After Use	
3-4 Power Supply	10
3-5 Display Symbols and Key Operation	11
4. WEIGHING UNITS	12
4-1 Units	12
4-2 Storing Units	
5. WEIGHING	
5-1 Basic Operation (Gram Mode)	
5-3 Percent Mode (%)	
5-4 Statistical Calculation Mode	
5-5 Statistical Calculation Mode (Example of Use)	
Adapting to the Environment	
6. RESPONSE ADJUSTMENT	26
7. CALIBRATION	27
7-1 Calibration Mode	27
7-2 Calibration Using an External Weight	
7-3 Calibration Test Using an External Weight	30
8. FUNCTION SWITCH AND INITIALIZATION	32
8-1 Permit or Inhibit	32
8-2 Initializing the Balance	33
Functions	
9 FUNCTION TABLE	34

9-1 Structure and Sequence of the Function Table	
9-2 Display and Keys	
9-3 Details of the Function Table	
9-4 Description of the Class "Environment, Display"	
9-5 Description of the Item "Data Output Mode"	
9-6 Description of the Item "Data Format"	
9-7 Data Format Examples	
9-8 Description of the Item "Application Function"	
9-9 Comparator Function	
10. ID NUMBER AND GLP REPORT	46
10-1 Setting the ID Number	46
10-2 GLP Report	46
11. UNDERHOOK	49
12. PROGRAMMABLE-UNIT	50
RS-232C Serial Interface	
13. RS-232C SERIAL INTERFACE	51
14. CONNECTION TO PERIPHERAL EQUIPMENT	52
14-1 Connection to the AD-8121B Printer	
14-2 Connection to a Computer	
15. COMMANDS	
15-1 Command List	55
15-2 Acknowledge Code and Error Codes	
15-3 Settings Related to RS-232C	
Maintenance	
16. MAINTENANCE	58
17. TROUBLESHOOTING	59
17-1 Checking the Balance Performance and Environment	59
17-2 Error Codes	
17-3 Asking For Repair	61
18. OPTIONS	62
40 SPECIFICATIONS	25
19. SPECIFICATIONS	65
20. EXTERNAL DIMENS IONS	66
21. TERMS/INDEX	68

# 1. INTRODUCTION

This manual describes how the FX-i WP series balance works and how to get the most out of it in terms of performance.

Read this manual thoroughly before using the balance and keep it at hand for future reference.

#### 1-1 About This Manual

This manual consists of the following five parts:

Basic operation	Describes precautions on handling the balance, balance construction and basic balance operation.
Adapting to the environment	Describes response adjustment and calibration.
Functions	Describes various functions of the balance.
RS-232C serial interface	Describes the interface which transmits data and controls the balance.
Maintenance	Describes maintenance, error codes, troubleshooting, specifications and options

### 1-2 Features

- Dust-tight and protected against water jets (complying with IP65), suitable to weigh powdery or liquid material. A waterproof RS-232C cable (AX-KO2737-500) is available as an option.
- Compact general-purpose balance, can be installed almost anywhere.
- Casing construction, strong protection against dust and water.
- Stabilization time of one second. When FAST is selected for the response rate, a stabilization time of one second, to read a displayed value after a sample is placed on the pan, has been achieved.
- Multiple weighing units with most of the common units used around the world.
- Standard RS-232C serial interface to communicate with a computer and to output the Good Laboratory Practice (GLP) data
- Statistical calculation mode to statistically calculate the weight data, and display or output the sum, maximum, minimum, range (maximum-minimum), average, standard deviation and coefficient of variation.
- Comparator Indicators, displaying the comparison results.
- Hold Function, provided for weighing a moving object such as an animal.
- Breeze break, provided for the FX-120*i* WP /200*i* WP /300*i* WP, for more accurate weighing.
- Underhook, provided for suspended weighing.
- As options, the USB interface (FX*i*-02), the Ethernet interface (Fx*i*-08) and the built-in battery unit (Fx*i*-09) are available. When any one of these is used, the balance does not comply with IP65.

## 1-3 Compliance

#### Compliance with FCC Rules

Please note that this device generates, uses and can radiate radio frequency energy. This device has been tested and has been found to comply with the limits of a Class A computing device pursuant to Subpart J of Part 15 of FCC rules. These rules are designed to provide reasonable protection against interference when this device is operated in a commercial environment. If this unit is operated in a residential area, it may cause some interference and under these circumstances the user would be required to take, at his own expense, whatever measures are necessary to eliminate the interference.

(FCC = Federal Communications Commission in the U.S.A.)

## **Compliance with EMC Directives**

This device features radio interference suppression and safety regulation in compliance with the following Council Directives

Council directive 89/336/EEC EN61326 EMC directive

Council directive 73/23/EEC EN60950 Safety of Information Technology Equipment

The CE mark is an official mandatory European marking.
Please note that any electronic product must comply with local laws and regulations when sold or used anywhere outside Europe.



A&D Instruments Ltd
24 Blacklands Way
Abingdon Business Park
Abingdon, Oxfordshire
OX14 1DY United Kingdom
Tel: +44(0)1235 550420
Fax: +44 (0)1235 550485
Email: info@aandd-eu.net
Internet: http://www.aandd-eu.net
Vat No: GB 596 1273 15

# Œ

A & D Instruments Ltd. hereby declare that the following balance series conforms to the requirements of the council directives on ...

#### Electromagnetic Compatibility (EMC) 89/336/EEC

and

Low Voltage Equipment (LVD) 73/23/EEC amended by 93/68/EEC

#### **FX-i Series**

Standards applicable:

BS EN 61326 Electrical Equipment for Measurement, Control and Laboratory use

- EMC Requirements - Class B

BS EN 60950 Safety of Information Technology Equipment.

CE Mark first applied March 2006

Signed for A&D Instruments in Oxford England March 2006

Takeo Goto

Managing Director






... Clearly a Better Value

Registered in England No: 2609110- Registered Office: 24/26 Blacklands Way Abingdon Oxon OX14 1DY

# 2. UNPACKING THE BALANCE

# 2-1 Unpacking

- The balance is a precision instrument. Unpack the balance carefully. Keep the packing material to be used for transporting the balance in the future.
- The packing contents depend on the balance model. See the illustrations to confirm that everything is contained.

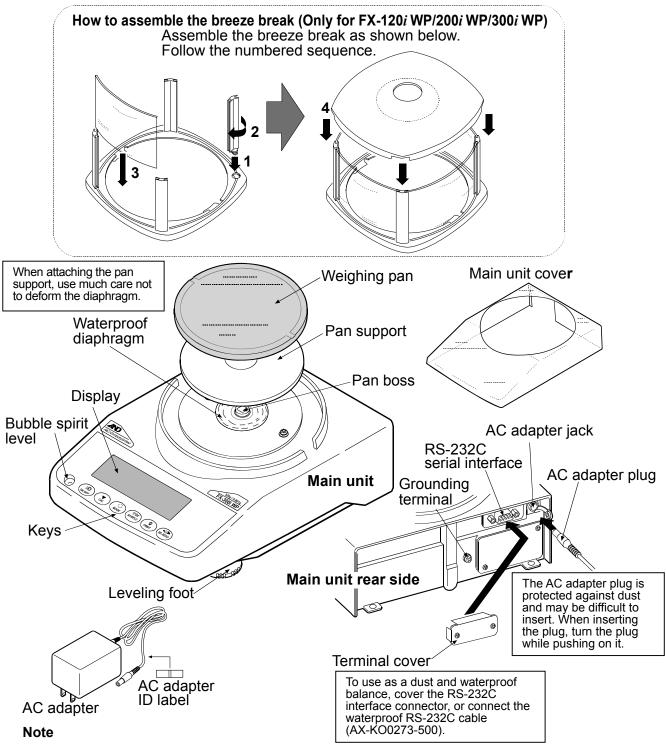

Please confirm that the AC adapter type is correct for your local voltage and receptacle type.

# 2-2 Installing the Balance

Install the balance as follows:

- 1. Place the balance on a solid weighing table. Refer to "3. PRECAUTIONS" for installing the balance.
- 2. FX-120*i* WP /200*i* WP /300*i* WP

Assemble the pan support, weighing pan and breeze break, on the balance as shown in the illustration on page 6.

FX-1200*i* WP /2000*i* WP /3000*i* WP

Assemble the pan support and weighing pan on the balance as shown in the illustration on page 6.

- 3. Adjust the leveling feet to level the balance. Confirm it using the bubble spirit level.
- 4. Confirm that the AC adapter type is correct for the local voltage and power receptacle type.
- 5. Connect the AC adapter to the balance. Warm up the balance for at least 30 minutes with nothing on the weighing pan.

#### Note


The AC adapter plug is protected against dust and may be difficult to insert. When inserting the plug, turn the plug while pushing on it.

# 3. PRECAUTIONS

To get the optimum performance from the balance and acquire accurate weight data, note the following:

#### 3-1 Before Use

- The meaning of IP65 is "No ingress of dust. Projected against water jets".
  - If a powerful water jet is used or the balance is immersed in water, the ingress of water may cause damage to the balance.
- Confirm that "the plug is inserted firmly into the AC adapter jack" and "the RS-232C interface connector is covered using the terminal cover or the waterproof RS-232C cable (AX-KO2737-500) is connected", when using as a dust and waterproof balance.
- When the balance is used without the terminal cover on the RS-232C interface connector or a standard RS-232C cable is used, the balance does not comply with IP65.
- Install the balance in an environment where the temperature and humidity are not excessive. The best operating temperature is about 20°C / 68°F at about 50% relative humidity.
- Install the balance where it is not exposed to direct sunlight and it is not affected by heaters or air conditioners.
- Install the balance where it is free of dust.
- Install the balance away from equipment which produces magnetic fields.
- Install the balance in a stable place avoiding vibration and shock. Corners of rooms on the first floor are best, as they are less prone to vibration.
- The weighing table should be solid and free from vibration, drafts and as level as possible.
- Level the balance by adjusting the leveling feet and confirm it using the bubble spirit level.
- Ensure a stable power source when using the AC adapter.
- Plug in the AC adapter and warm up the balance for at Leveling foot least 30 minutes.
- Calibrate the balance before use or after having moved it to another location.

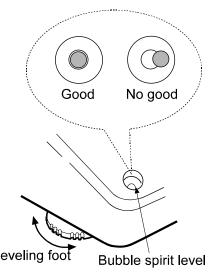


#### Caution

Do not install the balance where flammable or corrosive gas is present.

## 3-2 During Use

- The FX-i WP series balance has a casing with high sealing performance due to its dust-tight and waterproof design. Therefore, a very subtle change in the atmospheric pressure in the installation site, for example, generated by opening or closing the door, affects the weighing and may yield an unstable weight value. Wait for the atmospheric pressure to stabilize before weighing.
- If the residue of a powdery or liquid material is left on the waterproof diaphragm or the pan boss, it may cause weighing errors. Clean them before weighing.
- If the waterproof diaphragm is deformed due to overloading, it may cause weighing errors. Remove the load and wait for the waterproof diaphragm to restore to the original shape before continuing with weighing.
- Discharge static electricity from the material to be weighed (hereinafter referred to as the sample). When a sample could have a static charge, the weight data is influenced. Ground the balance and try the following:
  - Eliminate static electricity using the optional AD-1683 DC static eliminator.
  - Try to keep the ambient humidity above 45%RH.
  - Use a metal shield case for a charged sample.
  - Wipe charged plastic samples with a moistened cloth.
- This balance uses a strong magnet as part of the balance assembly, so please use caution when weighing magnetic materials such as iron. If there is a problem, use the underhook on the bottom of the balance to suspend the material away from the influence of the magnet.
- Eliminate the temperature difference between a sample and the environment. When a sample is warmer (cooler) than the ambient temperature, the sample will be lighter (heavier) than the true weight. This error is due to a rising (falling) draft around the sample.
- Make each weighing gently and quickly to avoid errors caused by the evaporation of moisture from the sample or the absorption of moisture by the sample.
- Do not drop things upon the weighing pan, or place a sample on the pan that is beyond the balance weighing capacity. Place a sample in the center of the weighing pan.
- Do not use a sharp instrument such as a pencil to press the keys. Use your finger only.

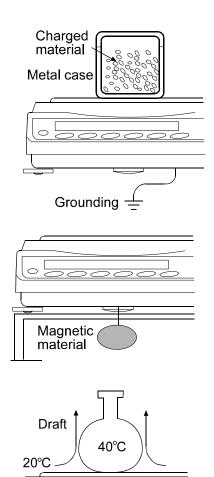

- Press the RE-ZERO key before each weighing to eliminate possible errors.
- Calibrate the balance periodically so as to eliminate possible errors.
- Take into consideration the affect of air buoyancy on a sample when more accuracy is required.
- Prevent foreign materials, such as powder, liquid and metal, from invading the area around the weighing pan.
- The breeze break (FX-120i WP /200i WP /300i WP only) is provided as an accessory. An anti-static treatment has been applied to the breeze break components, but they may be charged with static electricity when they are unpacked or when the humidity is low. If the weight value is unstable even when there are no drafts or the balance has a problem with repeatability, remove the breeze break. Or wipe the clear plates with a moistened cloth, use the optional AD-1683 DC static eliminator or apply an anti-static spray.

## 3-3 After Use

- Do not allow the balance to be immersed in water. Even though the balance complies with IP code, the balance will not withstand being completely immersed in water.
- Avoid mechanical shock to the balance.
- Do not disassemble the balance. Contact the local A&D dealer if the balance needs service or repair.
- Do not use organic solvents to clean the balance. Clean the balance with a lint free cloth that is moistened with warm water and a mild detergent.
- The edge of the weighing pan is sharp. Use much care when cleaning the pan.

# **3-4 Power Supply**

When the AC adapter is connected, the balance is in the standby mode if the standby indicator is on (refer to "3-5 Display Symbols and Key Operation"). This is a normal state and does not harm the balance. For accurate weighing, warm up the balance for at least 30 minutes before use.

# 3-5 Display Symbols and Key Operation

#### **Key operation**

Key operation affects how the balance functions. The basic key operations are:

- "Press and release the key immediately" or "Press the key"
   normal key operation during measurement
- "Press and hold the key"



standby indicator

Weight data

#### **Display symbols**

- Number of statistical data (Statistical calculation mode)
  Displays the weight data relative to the
- weighing capacity, in percentage, in the weighing mode (Capacity indicator)

  Response indicator

  Animal mode indicator

  Processing indicator

  Stabilization indicator

  Standby indicator

  Standby indicator




Each key, when pressed or when pressed and held, functions as follows:

Key	When pressed	When pressed and held	
(I/O) ON:OFF	turned off. The weighing mode is enabled w	display on or off. The standby indicator is displayed when the display is The weighing mode is enabled when the display is turned on. is available anytime. Pressing the key during operation will interrupt the and turn the display off.	
1/10d SAMPLE	In the weighing mode, turns the minimum weighing value on or off.  In the counting or percent mode, enters the sample storing mode.	Enters the function table mode. Refer to "9. FUNCTION TABLE".	
MODE	Switches the weighing units stored in the function table. Refer to "4. WEIGHING UNITS".	Enters the response adjustment mode.	
<b>▼</b> CAL	Cancels the operation when performing settings.	Enters the calibration mode.	
Q PRINT	Outputs the weight data to a printer or personal computer using the RS-232C serial interface, depending on the function table settings.  Confirms the operation when performing settings.	No function at the factory setting  By changing the function table: Outputs "Title block" and "End block" for GLP report.	
→0/T+ RE-ZERO	Sets the display to zero.		

# 4. WEIGHING UNITS

## 4-1 Units

With the FX-i WP series balance, the following weighing units and weighing modes are available:

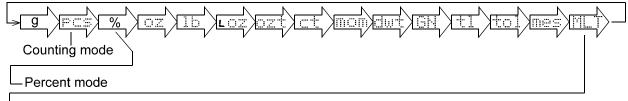

Programmable-unit (No unit displayed. For details, refer to "12. PROGRAMMABLE-UNIT".)

A unit or mode can be selected and stored in the function table as described on page 14. If a weighing mode (or unit of weight) has been turned off, that mode or unit will be missing in the sequence. Tael has four varieties, one of which can be selected and installed at the factory.

To select a unit or mode for weighing, press the MODE key. For details about the units and modes, see the table below:

Name (unit, mode)	Display	Function table (Storing mode)	Conversion factor 1 g =
Gram	g	g	1 g
Counting mode	PCS	PCS	
Percent mode	%	%	
Ounce (Avoir)	OZ	OZ	28.349523125 g
Pound	lb	lb	453.59237 g
Pound/Ounce	å omore	1	1Lb=16 oz,
	LOZ	LO	1 oz=28.349523125 g
Troy Ounce	ozt	ozt	31.1034768 g
Metric Carat	ct	ct	0.2 g
Momme	mom	mom	3.75 g
Pennyweight	dwt	dwt	1.55517384 g
Grain (UK)	GN	GN	0.06479891 g
Tael (HK general, Singapore)			37.7994 g
Tael (HK jewelry)	i "i	ti I ti —	37.429 g
Tael (Taiwan)	T. I.		37.5 g
Tael (China)			31.25 g
Tola (India)	tol	tol	11.6638038 g
Messghal	mes	mes	4.6875 g
Programmable-unit (Multi-unit)	MLT	MLT	

The tables below indicate the weighing capacity and the minimum display for each unit, depending on the balance model.

Unit	Capacity			Minimum
Offic	FX-120 <i>i</i> WP	FX-200 <i>i</i> WP	FX-300 <i>i</i> WP	display
Gram	122.000	220.000	320.000	0.001
Ounce (Avoir)	4.30340	7.76025	11.28765	0.00005
Pound	0.268965	0.485015	0.705480	0.000005
Pound/Ounce	0L 4.30oz	0L 7.76oz	0L 11.29oz	1L 0.01oz
Troy Ounce	3.92240	7.07315	10.28825	0.00005
Metric Carat	610.000	1100.000	1600.000	0.005
Momme	32.5335	58.6665	85.3335	0.0005
Pennyweight	78.621	141.776	206.220	0.001
Grain (UK)	1882.74	3395.12	4938.34	0.02
Tael (HK general, Singapore)	3.22755	5.82020	8.46575	0.00005
Tael (HK jewelry)	3.25950	5.87780	8.54950	0.00005
Tael (Taiwan)	3.25330	5.86670	8.53330	0.00005
Tael (China)	3.90400	7.04000	10.24000	0.00005
Tola (India)	10.4597	18.8618	27.4353	0.0001
Messghal	26.0265	46.9335	68.2665	0.0005

Unit	Capacity			Minimum
Offit	FX-1200 <i>i</i> WP	FX-2000 <i>i</i> WP	FX-3000 <i>i</i> WP	display
Gram	1220.00	2200.00	3200.00	0.01
Ounce (Avoir)	43.0340	77.6025	112.8765	0.0005
Pound	2.68965	4.85015	7.05480	0.00005
Pound/Ounce	2L 11.03oz	4L 13.60oz	7L 0.88oz	1L 0.01oz
Troy Ounce	39.2240	70.7315	102.8825	0.0005
Metric Carat	6100.00	11000.00	16000.00	0.05
Momme	325.335	586.665	853.335	0.005
Pennyweight	786.21	1417.76	2062.20	0.01
Grain (UK)	18827.4	33951.2	49383.4	0.2
Tael (HK general, Singapore)	32.2755	58.2020	84.6575	0.0005
Tael (HK jewelry)	32.5950	58.7780	85.4950	0.0005
Tael (Taiwan)	32.5330	58.6670	85.3330	0.0005
Tael (China)	39.0400	70.4000	102.4000	0.0005
Tola (India)	104.597	188.618	274.353	0.001
Messghal	260.265	469.335	682.665	0.005

# 4-2 Storing Units

The units or modes can be selected and stored in the function table. The sequence of displaying the units or modes can be arranged in the function table so as to fit the frequency of use.

Select a unit or mode and arrange the sequence of display as follows:

- 1 Press and hold the SAMPLE key until b85Fnc of the function table is displayed.
- 2 Press the SAMPLE key several times to display
- 3 Press the PRINT key to enter the unit selection mode.
- 4 Specify a unit or mode in the order to be displayed using the following keys.

SAMPLE key

To sequentially display the units.


To specify a unit or mode. The stabilization indicator appears when the displayed unit or mode is specified.

- 5 Press the PRINT key to store the units or modes. The balance displays *ξnd* and then displays the next menu of the function table.
- 6 Press the CAL key to exit the function table. Then the balance returns to the weighing mode with the unit specified first in step 4.

#### **Notes**

When the power is turned on, the scale displays the unit specified first in step 4.

In the weighing mode, to select a unit or mode for weighing, press the MODE key.

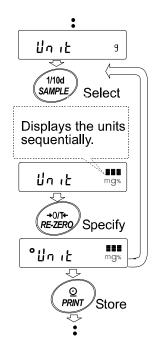

# 5. WEIGHING

# 5-1 Basic Operation (Gram Mode)

- 1 Place a container on the weighing pan, if necessary.

  Press the RE-ZERO key to cancel the weight (tare). The balance displays UDD g. (The decimal point position depends on the balance model.)
- 2 Place a sample on the pan or in the container.
- 3 Wait for the stabilization indicator to be displayed. Read the value.

While the stabilization indicator is on, pressing the PRINT key will output the weight value, using the RS-232C serial interface.

#### Note

Peripheral equipment, that is sold separately, such as a printer or a personal computer is required.


4 Remove the sample and container from the pan.


#### **Notes**

To use other units, press the MODE key and select an appropriate unit.

Press the **SAMPLE** key to turn on or off the minimum weighing value.

When the ON:OFF key is pressed with a container placed on the weighing pan, the balance displays QQQ and weighing is started,

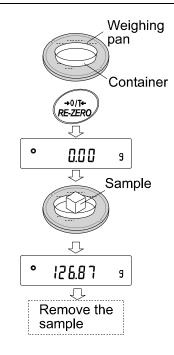

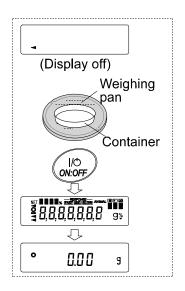

## 5-2 Counting Mode (PCS)

This is the mode to determine the number of objects in a sample based on the standard sample unit mass. Unit mass means the mass of one sample. The smaller the variables in each sample unit mass are, the more accurate the counting will be. The FX-*i* WP series balance is equipped with the Automatic Counting Accuracy Improvement (ACAI) function to improve the counting accuracy.

#### Note

If the sample unit mass variable is too large, it may cause a counting error.

#### Selecting the counting mode

1 Press the MODE key to select [Figure (counting mode).

#### Storing a sample unit mass

- 2 Press the SAMPLE key to enter the sample unit mass storing mode.
  - Even in the storing mode, pressing the MODE key will switch to the next mode.
- 3 To select the number of samples, press the SAMPLE key several times. It may be set to 5, 10, 25, 50 or 100.

#### Note


# A greater number of samples will yield more accurate counting result.

- 4 Place a container on the weighing pan, if necessary. Press the RE-ZERO key to cancel the weight (tare). The number specified in step 3 appears.
  - e.g.: 25 0 is displayed if 25 is selected in step 3.
- 5 Place the number of samples specified on the pan. In this example, 25 pieces.
- 6 Wait for the stabilization indicator to come on. Press the PRINT key to calculate and store the unit mass. The balance displays 25 FCS (counting mode) and is set to count samples with this unit mass. (The sample unit mass stored, even if the AC adapter is removed, is maintained in non-volatile memory.)

To improve the accuracy of the unit mass, proceed to step 8.

#### **Notes**

If the balance judges that the mass of the samples is too light and is not adequate to be used as the unit mass, it displays  $\boxed{La}$ . In that case, store the mass by some quantity. For example, when the model with the minimum weighing value of 0.01 g is used and 10 pieces of samples weigh 0.05 g. Store 100 pieces of samples as 10 and multiply the weighing result by 10.

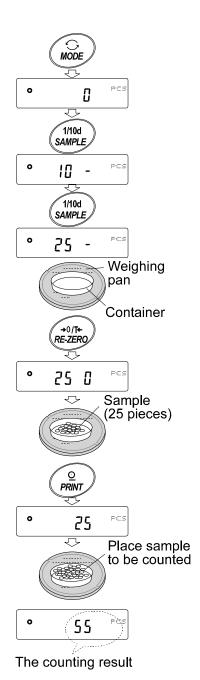

If the balance judges that the mass of the samples is too light to aquire accurate weighing, it displays an error requiring the addition of more samples to the specified number. In the example above, 50- PCS appears, requiring 25 more samples. Add 25 samples and press the PRINT key. When the unit mass is stored correctly, the balance proceeds to the counting mode.

#### Counting operation


7 Place the samples to be counted on the pan.
While the stabilization indicator is on, pressing the PRINT key will output the weight value, using the RS-232C serial interface.

#### Note

Peripheral equipment, that is sold separately, such as a printer or a personal computer is required.

#### Counting mode using the ACAI function

The ACAI is a function that improves the accuracy of the unit mass automatically by increasing the number of samples and averaging the unit mass variable to minimize the weighing error, as the counting process proceeds.

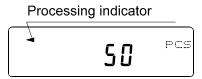

- 8 If a few more samples are added, the processing indicator turns on. To prevent an error, add three or more. The processing indicator does not turn on if overloaded. Try to add the same number of samples as displayed.
- 9 The balance re-calculates the unit mass while the processing indicator is blinking. Do not touch the balance or samples on the pan until the processing indicator turns off.
- 10 Counting accuracy is improved when the processing indicator turns off.
  - Each time the above operation is performed, a more accurate unit mass will be obtained. There is no definite upper limit of ACAI range for the number of samples exceeding 100. Try to add the same number of samples as displayed.
- 11 Remove all the samples used in ACAI and proceed with the counting operation using the improved unit mass.

# 5-3 Percent Mode (%)

This is the mode to display the weight value in percentage compared to a 100% reference mass and is used for target weighing or checking the sample variable.

## Selecting the percent mode

1 Press the MODE key to select % (percent mode).

#### Storing the 100% reference mass

- 2 Press the <u>SAMPLE</u> key to enter the 100% reference mass storing mode.
  - Even in the storing mode, pressing the MODE key will switch to the next mode.
- 3 Place a container on the weighing pan, if necessary. Press the RE-ZERO key to cancel the weight (tare). The balance displays 100 %.
- 4 Place the sample to be set as the 100% reference mass on the pan or in the container.
- 5 Press the PRINT key to store the reference mass. The balance displays 1000 %. (The decimal point position depends on the reference value. The reference mass stored, even if the AC adapter is removed, is maintained in non-volatile memory.)

#### Note

If the balance judges that the mass of the sample is too light to be used as a reference, it displays  $\boxed{\textit{Lo}}$ . Do not use the sample.

6 Remove the sample.


#### Reading the percentage

7 Place a sample to be compared to the reference mass on the pan. The displayed percentage is based on the 100% reference mass.

While the stabilization indicator is on, pressing the PRINT key will output the weight value, using the RS-232C serial interface.

#### Note

Peripheral equipment, that is sold separately, such as a printer or a personal computer is required.

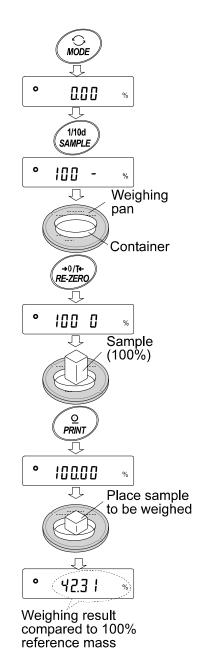

## 5-4 Statistical Calculation Mode

The statistical calculation mode statistically calculates the weight data, and displays or outputs the results. To use the statistical calculation mode, set the "Application function (RPF)" parameter of "Application (RPF)" in the function table to " $\mathcal{E}$ ", as described below.

Statistical items available are number of data, sum, maximum, minimum, range (maximum-minimum), average, standard deviation and coefficient of variation. What statistical items to output can be selected from the three modes in the function table.

- The wrong data input can be canceled by the key operation, if immediately after the input.
- Turning the balance off will delete the statistical data.
- The standard deviation and coefficient of variation are obtained by the equation below:

Standard deviation= 
$$\sqrt{\frac{N \cdot \sum (X_i)^2 \cdot (\sum X_i)^2}{N \cdot (N-1)}}$$
 where Xi is the i-th weight data, N is number of data.

## 5-4-1 Getting Started


**Switching to the Statistical Function Mode (Changing The Function Table)** 

1 Press and hold the SAMPLE key until bR5Fnc of the function table is displayed, then release the key.

- 2 Press the SAMPLE key several times to display
- 3 Press the PRINT key to display RPF [].
- 4 Press the RE-ZERO key to display RPF 2

To select statistical items to output, go to step 5. To store the statistical function mode setting, go to step 7.

To disable the statistical calculation mode, press the RE-ZERO key to select RPF 0.

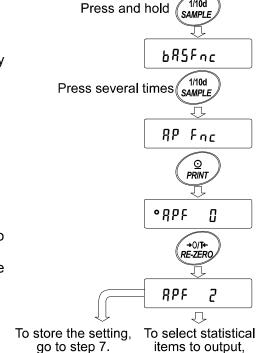

go to step 5.

## Selecting the statistical items to output

- 5 Press the SAMPLE key to display 5 tale 0.
- 6 Press the RE-ZERO key to select the output items. In the example, 5£8F / is selected to output the number of data, sum, maximum, minimum, range (maximum-minimum) and average.

Parameter	Description
<b>-</b> []	Number of data, sum
ı	Number of data, sum
'	Maximum, minimum, range (maximum – minimum), average
	Number of data, sum
2	Maximum, minimum, range (maximum – minimum), average,
	Standard deviation, coefficient of variation

7 Press the PRINT key to store the setting.

#### Note

The statistical calculation mode will be enabled using the ON:OFF key or when the power is turned on.

8 Press the CAL key to return to the weighing mode.


#### Selecting the unit


9 Press the MODE key to select the unit to be used for the statistical calculation mode.

#### **Notes**

Selecting the unit using the  $\overline{\text{MODE}}$  key is not available after the data is entered. In this case, clear the data as described on page 23 and select the unit using the  $\overline{\text{MODE}}$  key.

When the unit used for the statistical calculation mode is to be enabled upon power-on, select the unit in "Unit (Unit)" of the function table beforehand.

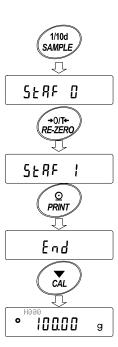

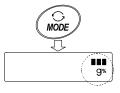

## 5-4-2 Using The Statistical Calculation Mode

#### **Entering data for statistical calculation**

Use the following keys to operate the statistical calculation mode.

MODE key······ ■When the data is entered, moves between the displaying items (weighing mode, statistical results and data operation) each time the key is pressed.

■When no data has been entered, selects the unit.

SAMPLE key ........ Turns the minimum display on or off, in the weighing mode.


RE-ZERO key ······· Sets the display to zero in the weighing mode.

PRINT key..... Outputs the data number and the weight data and includes the weight data to statistical calculation in the weighing mode. (Output is not in the data format specified in the function table because of the data number added.)

Outputs the statistical results while the statistical results are displayed.
 (Output is not in the data format specified in the function table.)

CAL key ..... Returns to the weighing mode.

- 1 Press the RE-ZERO key to set the display to zero.
- 2 Place the sample on the weighing pan and wait for the stabilization indicator to turn on.
- 3 Press the PRINT key to add the data displayed to statistical calculation. The number of data on the upper left of the display increases by 1.
- 4 Repeat steps 1 to 3 for each weighing.

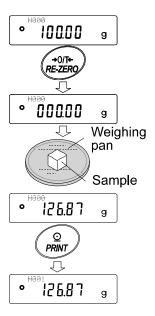

#### **Outputting the statistical results**

5 Each time the MODE key is pressed, the display changes: the results as selected in "Statistical function mode output items (5£RF)", [ERGEEL] and [ELERG].

#### **Notes**


When the number of data is 1, the standard deviation and coefficient of variation are displayed as -----.

When the average is 0, the coefficient of variation is displayed as ----.


Statistical items are indicated on the upper left of the display using the following symbols.

Symbol	Statistical item
SUM	Sum
MAX	Maximum
MIH	Minimum
R	Range (Maximum – minimum)
AUE	Average
SD	Standard deviation
CV	Coefficient of variation

6 While the results are displayed, press the PRINT key to output the results.

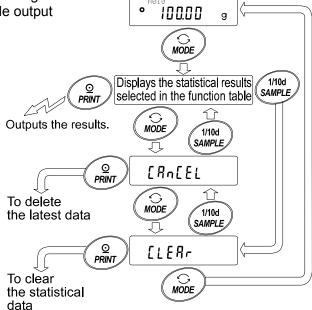

#### Output example

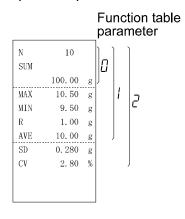


#### **Deleting the latest data**

When the wrong data is entered, it can be deleted and excluded from statistical calculation. Only the latest data can be deleted.

- 1 In the weighing mode, press the MODE key, and then press the SAMPLE key several times to display

  [Rn[E]].
- 2 Press the PRINT key to display [fin no]
- 3 Press the RE-ZERO key to display [ [ An Lo
- 4 Press the PRINT key to delete the latest data and exclude it from statistical calculation.

  The number of data decreases by 1 when the balance returns to the weighing mode.

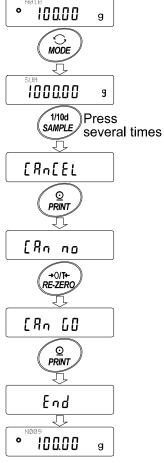


## Clearing the statistical data

All the statistical data will be deleted and the number of data will be 0 (zero).

- 1 In the weighing mode, press the MODE key, and then press the SAMPLE key several times to display [LERr].
- 2 Press the PRINT key to display [[Lr na
- 3 Press the RE-ZERO key to display  $[[Lr \ \ Lo\ ]]$
- 4 Press the PRINT key to delete the statistical data.

The number of data becomes 0 (zero) when the balance returns to the weighing mode.

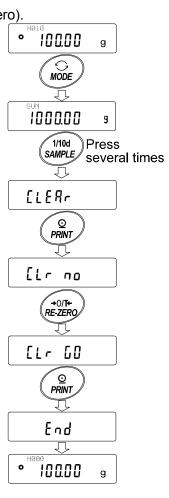

# 5-5 Statistical Calculation Mode (Example of Use)

Here, as an example of use of the statistical calculation mode, mixing of the multiple formulae such as medicine is described. The mixing process is recorded using the balance and the printer. In the example, the FX-3000*i* WP and the AD-8121B (dump print mode) are connected using the

RS-232C serial interface.

## 5-5-1 Getting Started

## Changing the function table

Changes: •To enable the statistical calculation mode

•To enable "Zero after output"

## Enabling the statistical calculation mode

1 Enter the function table menu.

Press and hold the SAMPLE key until b85Fnc of the function table is displayed, then release the key.

2 Select the application function.

Press the SAMPLE key several times to display RP Fnc. Then, press the PRINT key to display RPF D.

3 Change the application function parameter to "₽".

Press the RE-ZERO key to display RPF 2. Press the PRINT key to confirm the change. After End, b855nc is displayed.

#### Enabling "Zero after output"

4 Select "Zero after output".


Press the SAMPLE key several times to display dout. Then, press the PRINT key to display Prt D, and press the SAMPLE key several times to display Rr-d D.

5 Enable "Zero after output".

Press the RE-ZERO key to display Rr-d | . Then, press the PRINT key to confirm the change. After End, 5 F is displayed.

## Returning to the weighing mode

6 Press the CAL key to return to the weighing mode.

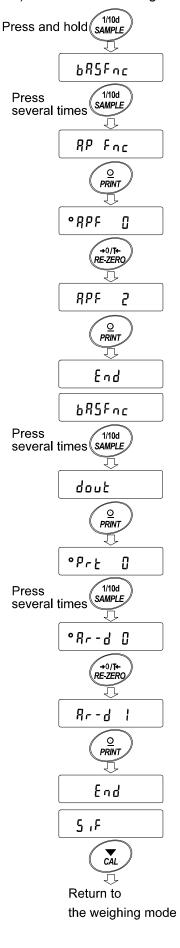

## 5-5-2 Using The Statistical Calculation Mode

- 1 Press the RE-ZERO key to set the display to zero.
- Place a container on the weighing pan. Press the PRINT key to cancel the weight (tare). The balance displays 0.00 g. (Storing the tare value) The tare value data is output when the peripheral output equipment is connected.
- 3 Weigh formula 1 and press the PRINT key. The balance displays 0.00 g. (Storing the weight value of formula 1)


The weight value data is output when the peripheral output equipment is connected.


4 Weigh formula 2 and press the PRINT key. The balance displays 0.00 g. (Storing the weight value of formula 2)

The weight value data is output when the peripheral output equipment is connected.

- 5 When there are some more formulae to be added, repeat step 4.
- 6 After mixing is complete, press the MODE key to display the statistical results.
- 7 Press the PRINT key to output the number of data saved including the tare value and the total weight.

#### Output example

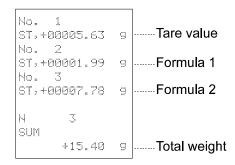

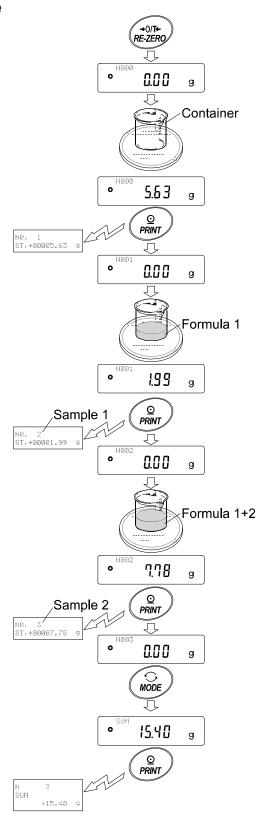

# 6. RESPONSE ADJUSTMENT

This function stabilizes the weight value, reducing the influence on weighing that is caused by drafts and vibration at the place where the balance is installed.

The function has three stages as follows and can be changed by simple key operation.

Indicator	Description	
FAST	Fast response, but prone to drafts and vibration.	
FAST	Good for target weighing.	
MID.	•	
CI OW	Slow response, but strong against drafts and vibration	
SLOW	Good for weighing which requires a stable display.	



#### **Operation**


- 1 Press and hold the MODE key until RESPONSE is displayed. And then, release the key.
- 2 Press the MODE key to select a rate of the response adjustment. Either FAST, MID. or SLOW can be selected.
- 3 After a few seconds of inactivity, or when the PRINT key is pressed, the balance displays End. Then, it returns to the weighing mode and displays the updated response indicator. The response indicator remains displayed for a while.

#### Note

Setting the response rate automatically changes the "Condition ([End])" and "Display refresh rate ([SPd])" parameters of "Environment, Display ([ERSFnc])" in the function table, as shown below:

Indicator	Land (Condition)	5Pd (Display refresh rate)
FAST	0	2
MID.	1	0
SLOW	2	0

When the balance is to be used with other setting combinations, set each parameter in the function table.

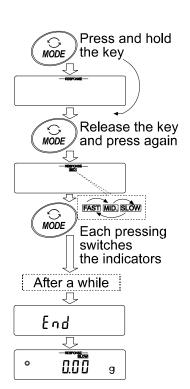

# 7. CALIBRATION

### 7-1 Calibration Mode

The FX-i WP series balance has the following two modes.

- Calibration using an external weight
- Calibration test using an external weight (Calibration test does not perform calibration.)

#### **Terms**

The following terms are defined as follows:

External weight = A weight that you have. Referred to as a calibration weight when used for

calibration.

Calibration weight = A weight used for calibration

Target weight = An external weight used for calibration test

#### Caution

Calibration adjusts the balance for accurate weighing.

Besides periodic calibration and before each use, perform calibration when:

- The balance is installed for the first time.
- The balance has been moved.
- The ambient environment has changed.
- Do not allow vibration or drafts to affect the balance during calibration.
- To output the data for GLP using the RS-232C serial interface, set "GLP output ( יים )" of "Data output ( daub )". For details, refer to "9. FUNCTION TABLE".
- Calibration test is available only when "GLP output ( ¬¬F¬□ )" of "Data output ( ¬¬¬□ )" is set to " !" or "¬□".

#### Caution on using an external weight

• The accuracy of an external weight will influence the accuracy of weighing. Select an appropriate weight as listed below:

Model	Usable calibration weight	Adjustable range
FX-120 <i>i</i> WP	<b>100 g</b> , 50 g	
FX-200 <i>i</i> WP	<b>200 g</b> , 100 g	-0.050 g to +0.050 g
FX-300 <i>i</i> WP	300 g, <b>200 g</b> , 100 g	
FX-1200 <i>i</i> WP	<b>1000 g</b> , 500 g,	
FX-2000 <i>i</i> WP	<b>2000 g</b> , 1000 g	-0.50 g to +0.50 g
FX-3000 <i>i</i> WP	3000 g, <b>2000 g</b> , 1000 g	

The calibration weight in bold type: factory setting

The calibration weight value can be adjusted within the range above.

#### **Display**



This indicator means "the balance is measuring calibration data".
 Do not allow vibration or drafts to affect the balance while this indicator is displayed.

# 7-2 Calibration Using an External Weight

This function calibrates the balance using an external weight.

#### Operation

- 1 Connect the AC adapter and warm up the balance for at least 30 minutes with nothing on the pan.
- 2 Press and hold the CAL key until [RLout] is displayed, and then release the key.
- 3 The balance displays [FRL ].
  - If you want to change the calibration weight (a list of usable weights is shown on page 27), press the SAMPLE key and proceed to step 4.
  - If you use the calibration weight value stored in the balance, proceed to step 5.
- 4 Specify the calibration weight value as follows:

SAMPLE key

To switch the display condition to: "All of the segments blinking" (calibration weight selection mode) or "The last two digits blinking" (value adjustment mode).

RE-ZERO key (To increase the value)
MODE key (To decrease the value)


To select the calibration weight or adjust the value.

PRINT key

To store the new weight value. Even if the AC adapter is removed, the data is maintained in non-volatile memory.

CAL key


To cancel the operation and return to [FL 0].

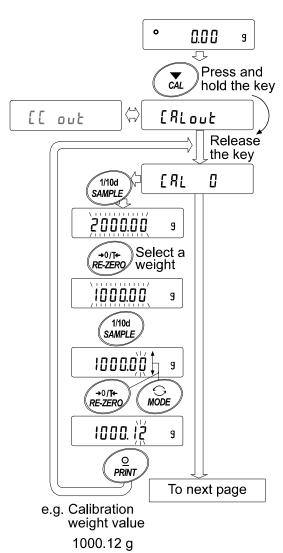

5 Confirm that there is nothing on the pan and press the PRINT key. The balance measures the zero point. Do not allow vibration or drafts to affect the balance.

The balance displays the calibration weight value.

- 6 Place the displayed calibration weight on the pan and press the PRINT key. The balance measures the calibration weight. Do not allow vibration or drafts to affect the balance.
- 7 The balance displays  $\boxed{\textit{End}}$ . Remove the weight from the pan.
- 8 When the GLP output is set, the balance displays [LLP] and outputs "Calibration Report".
- 9 The balance will automatically return to the weighing mode.
- 10 Place the calibration weight on the pan and confirm that the value displayed is within  $\pm 2$  digits of the specified value. If it is not within the range, check the ambient conditions such as breeze and vibration, also check the weighing pan. Then, repeat steps 1 to 9.

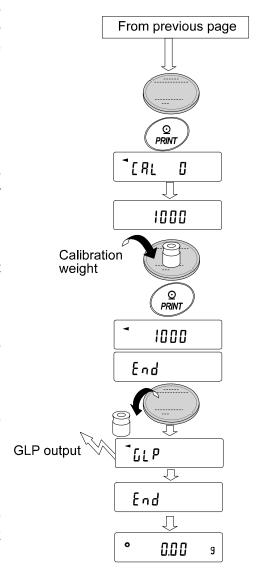

## 7-3 Calibration Test Using an External Weight

This function tests the balance weighing accuracy using an external weight and outputs the result. This is available only when the "GLP output ( InFa)" parameter is set to " I" or " $\bar{c}$ ". (Calibration test does not perform calibration.)

#### Operation

- 1 Connect the AC adapter and warm up the balance for at least 30 minutes with nothing on the pan.
- 2 Press and hold the CAL key until [[aut] is displayed, and then release the key.
- 3 The balance displays [[[ ]].
  - If you want to change the target weight (a list of usable weights is shown on page 27), press the SAMPLE key and proceed to step 4.
  - If you use the target weight value stored in the balance, proceed to step 5.
- 4 Specify the target weight value as follows:

SAMPLE key To switch the display condition to: "All of the

condition to: "All of the segments blinking" (target weight selection mode) or "The last two digits blinking"

(value adjustment mode).

RE-ZERO key (To increase the value)
MODE key (To decrease the value)

To select the target weight or

adjust the value.


PRINT key To store the new weight

value. Even if the AC adapter is removed, the data is maintained in non-volatile

memory.

CAL key To cancel the operation and


return to [[ []

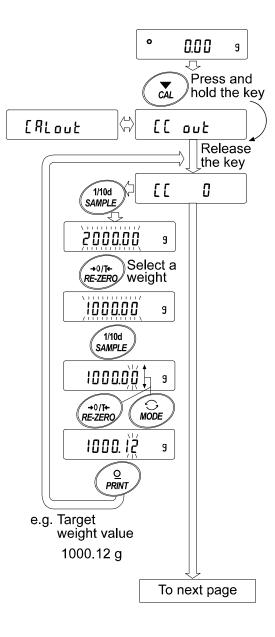

5 Confirm that there is nothing on the pan and press the PRINT key. The balance measures the zero point and displays the measured value. Do not allow vibration or drafts to affect the balance.

The balance displays the target weight value.

6 Place the displayed target weight on the pan and press the PRINT key. The balance measures the target weight and displays the measured value. Do not allow vibration or drafts to affect the balance.

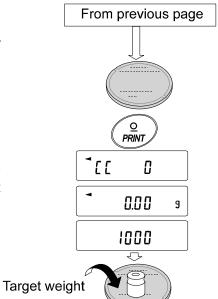

PRINT


1000

1000.12

7 The balance displays *End*. Remove the weight from the pan.

8 When the GLP output is set, the balance displays LLP and outputs "Calibration Test Report".

9 The balance will automatically return to the weighing mode.

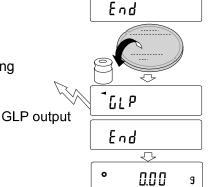


# 8. FUNCTION SWITCH AND INITIALIZATION

## 8-1 Permit or Inhibit

The balance stores parameters that must not be changed unintentionally. There are two switches for the purpose of protecting these parameters. Each switch can select either "permit" or "inhibit". The "inhibit" protects parameters against unintentional operations.

#### **Switches**

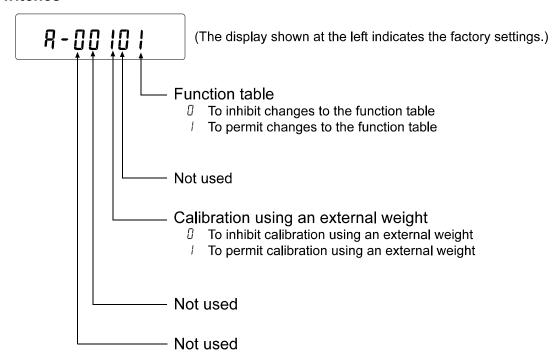

#### Operation

- 1 Press the ON:OFF key to turn off the display.
- 2 While pressing and holding the  $\boxed{\mathsf{PRINT}}$  key and the  $\boxed{\mathsf{SAMPLE}}$  key, press the  $\boxed{\mathsf{ON:OFF}}$  key. The balance displays  $\boxed{\mathit{P5}}$ .
- 3 Press the PRINT key. Then the balance displays the function switches.
- 4 Set the switches using the following keys.

SAMPLE key	To select the switch to change the parameter.
RE-ZERO key	To change the parameter of the switch selected.
	☐:To inhibit changes. /:To permit changes
PRINT key	To store the new parameter and return to the weighing mode.
CAL key	To cancel the operation ( [[Lr]] is displayed.) To return to the weighing mode, press the CAL key once again.

# 8-2 Initializing the Balance

This function returns the following parameters to factory settings.

- Calibration data
- Function table
- The sample unit mass value (counting mode), 100% reference mass value (percent mode)
- External calibration weight
- Function switch settings
- Statistical data

#### **Note**

Be sure to calibrate the balance after initialization.


#### Operation

- 1 Press the ON:OFF key to turn off the display.
- 2 While pressing and holding the PRINT key and the SAMPLE key, press the ON:OFF key. The balance displays 75.
- 3 Press the SAMPLE key to display [[Lr].
- 4 Press the PRINT key.

To cancel this operation, press the CAL key.

- 5 Press the RE-ZERO key.
- 6 Press the PRINT key to initialize the balance.

The balance will automatically return to the weighing mode.

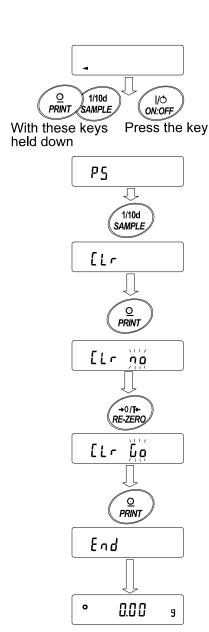

# 9. FUNCTION TABLE


The function table reads or rewrites the parameters that are stored in the balance. These parameters stored, even if the AC adapter is removed, are maintained in non-volatile memory.

# 9-1 Structure and Sequence of the Function Table

The function table menu consists of two layers. The first layer is the "Class" and the second layer is the "Item". Each item stores a parameter.

#### **Example**

This example sets "Auto print mode A" for "Data output mode" and "100 digits" for "Auto print difference".

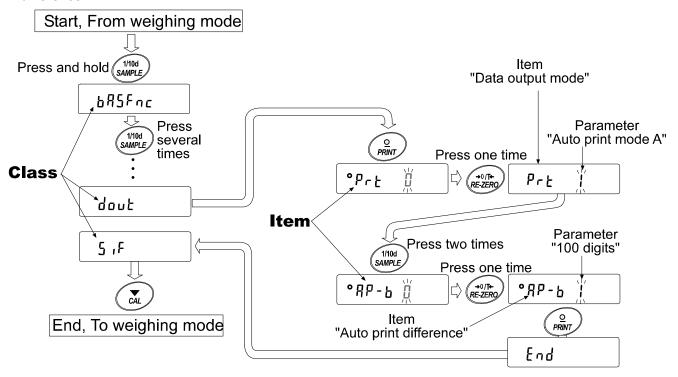

# 9-2 Display and Keys

Display/Key	Description
0	The symbol "o" indicates that the parameter displayed is in effect.
1/10d SAMPLE	When pressed and held in the weighing mode, enters the function table mode.
	Selects the class or item in the function table mode.
→0/T← RE-ZERO	Changes the parameter.
© PRINT	When a class is displayed, moves to an item in the class.
	When an item is displayed, stores the new parameter and displays the next class.
<b>▼</b> CAL	When an item is displayed, cancels the new parameter and displays the next
	class.
	When a class is displayed, exits the function table mode and returns to the
	weighing mode.

# 9-3 Details of the Function Table

Class	Item and Parame	ter	Desc	ription			
	Eand Condition		Fast response, sensitive value FAST MID.	With "Hald I", sets the averaging time.			
	5と-6 Stability band width	- 1 - 2	Slow response, stable value SLOW  Stable range is ±1 digit  Stable range is ±3 digits	The stabilization indicator illuminates when the display fluctuation is within the range. With "Hald I", sets the stabilization range.			
	Hald Hold function	<b>-</b> []	OFF ON	Holds the display when stable in animal mode. With "Hold I", ANIMAL tums on.			
bASFnc	ادرد Zero tracking	- 1 - 2	OFF Normal Strong Very strong	Keeps zero display by tracking zero drift.			
Environment Display	5Pd Display refresh rate	• 0   	5 times/second 10 times/second 20 times/second	Period to refresh the display			
	Pnt Decimal point	<b>-</b> []	Point (.) Comma (,)	Decimal point format			
	P-an Auto display-ON	<b>-</b> []	OFF ON	Tums on the weighing mode display when the AC adapter is connected.			
	PoFF Auto display-OFF	<b>-</b> []	OFF ON (10 minutes)	Turns off the display after 10 minutes of inactivity.			
	ากโ Display at start	<b>-</b> []	Displays  Does not display	Select whether or not to display the minimum weighing value at weighing start.			
	ьеер		Does not sound Sounds	Select whether or not to sound the beep when operating on keys.			
		<b>=</b> []	No comparison  Comparison, excluding "near zero	" when stable value or overloaded			
	[P Comparator mode	2	Comparison, including "near zero"  Continuous comparison, excluding	when stable value or overloaded			
CP Fnc		4	Continuous comparison, including	"near zero"			
Comparator	ЬЕР₋ LO buzzer	<b>-</b> []	OFF ON				
	ЬЕР- OK buzzer	<b>-</b> []	OFF ON				
	ЬЕР⁻ HI buzzer	<b>-</b> []	OFF ON				
Upper limit  Upper limit  Lower limit		Refer	to "9-9 Comparator Function".				

<sup>■:</sup> Factory settings. Digit is a unit of minimum weighing value

Class	Item and Parame	ter	Desc	cription				
		<b>-</b> []	Key mode	Accepts the PRINT key only when the display is stable.				
		1	Auto print mode A (Reference = zero)	Outputs data when the display is				
	PrŁ	2	Auto print mode B (Reference = last stable value)	stable and conditions of RP-P, RP-b and the reference value are met.				
	Data output mode	3	Stream mode	Outputs data continuously.				
		4	Key mode B (Immediately)	Accepts the PRINT key regardless of the display condition.				
		5	Key mode C (When stable)	Accepts the PRINT key immediately when the display is stable, or waits for the display to be stable when not.				
		6	Interval output mode	Uses interval output mode.				
	   RP-P	<b>-</b> []	Plus only	Displayed value>Reference				
	Auto print polarity	!	Minus only	Displayed value <reference< td=""></reference<>				
	Auto print polarity	2	Both	Regardless of displayed value				
	   AP-6	<b>-</b> []	10 digits	D''				
	Auto print difference	1	100 digits	Difference between reference value and displayed value				
dout	Auto print difference	2	1000 digits	and displayed value				
Data output		0	Every measurement					
		-	2 seconds					
		2	5 seconds					
	Int	3	10 seconds	Interval time for the interval output				
	Interval time	4	30 seconds	mode (With <sup>P</sup> cと も)				
	intorvar timo	5	1 minute	(VVIUITE a)				
		5	2 minute					
		7	5 minute					
	aus s	8	10 minute					
	PUSE	<b>-</b> []	No pause	Selects the data output interval.				
	Data output pause	1	Pause (1.6 seconds)	·				
	RE-F	<b>-</b> []	Not used	Selects whether or not automatic				
	Auto feed		Used	feed is performed.				
	inFa	<b>-</b> []	No output					
	GLP output		AD-8121 format	Selects GLP output method.				
	'	2	General data format					
	Rr-d	<b>-</b> []	Not used	Adjusts zero automatically after data				
	Zero after output	1	Used	is output				

<sup>■</sup> Factory settings. Digit is a unit of minimum weighing value

Class	Item and Paramet	er	Desc	ription				
		0	600 bps					
		1	1200 bps					
	6PS	- 2	2400 bps					
	Baud rate	3	4800 bps					
		4	9600 bps					
		5	19200 bps					
		<b>-</b> []	7 bits, even					
	bepr Data bit marity bit	1	7 bits, odd					
	Data bit, parity bit	2	8 bits, none					
5 ,F	[rLF	<b>-</b> []	CR LF	CR: ASCII code 0Dh				
Serial	Terminator	1	CR	LF: ASCII code 0Ah				
interface		<b>-</b> []	A&D standard format					
		1	DP format					
	E YPE	2	KF format	Refer to "9-6 Description of the Item				
	Data format	3	MT format	"Data Format"".				
		4	NU format					
		5	CSV format					
	E-UP	<u>[]</u>	No limit	Selects the wait time to receive a				
	Timeout	-	1 second	command.				
	Er[d	<b>-</b> []	No output	AK:ASCII code 06h				
	AK, Error code	1	Output	AK.ASCII code oon				
הובל Programmabl	e-unit (Multi-unit)	Sets a	an arbitrary coefficient.	Available only when programmable- unit mode is selected.				
ปก เะ Unit		Refer to "4. WEIGHING UNITS".						
ıd ID number		Refer	to "10. ID NUMBER AND GLP REPOR	RT"				
	RPF	<b>-</b> []	Normal weighing mode					
	Application function	1	Capacity indicator					
	Application function	2	Statistical calculation mode					
		<b>-</b> []	Number of data, sum					
RP Fnc			Number of data, sum, maximum,					
Application	SERF	1	minimum, average, range					
, application	Statistical function		(maximum-minimum)					
	mode output items		Number of data, sum, maximum,					
	mode odipat items	2	minimum, average, range					
		L	(maximum-minimum), standard					
1			deviation, coefficient of variation					

: Factory settings.

## Caution

The balance may not transmit the data completely at the specified refresh rate, depending on the baud rate.

When a refresh rate of 20 times/second is used, set the baud rate to 4800 bps or higher.

## 9-4 Description of the Class "Environment, Display"

## Condition ( [and )

Cond O



This parameter is for sensitive response to the fluctuation of a weight value. Used for powder target weighing, weighing a very light sample or when quick response weighing is required.

After setting, the balance displays FAST.

Cand 2

This parameter is for stable weighing with slow response. Used to prevent a weight value from drifting due to vibration or drafts.

After setting, the balance displays SLOW.

#### Note

With "Hold function (Hald)" set to "ON ( I)", this item is used to set the averaging time.

## Stability band width (5t-b)

This item controls the width to regard a weight value as a stable value. When the fluctuation per second is less than the parameter, the balance displays the stabilization indicator and outputs the data. The parameter influences the "Auto print mode"

5t-b 0

This parameter is for sensitive response of the stabilization indicator. Used for exact weighing.

This parameter ignores slight fluctuation of a weight value. Used to prevent a weight value from drifting due to vibration or drafts.

#### Note

With "Hold function (HaLd)" set to "ON (I)", this item is used to set the stabilization range.

### Hold function ( Hold ) (Animal weighing mode)

This function is used to weigh a moving object such as an animal.

When the weight data is over the weighing range from zero and the display fluctuation is within the stabilization range for a fixed period of averaging time, the processing indicator illuminates and the balance displays the average weight of the animal. When the animal is removed from the weighing pan, the display returns to zero automatically.

This function is available only when the hold function parameter is set to "!" (the animal mode indicator ANIMAL illuminates) and any weighing unit other than the counting mode is selected.

The stabilization range and averaging time are set in "Condition ([and)" and "Stability band width (5t-b)".

Weighing rai	nge		Averaging time	Stabilization range					
FX-120 <i>i</i> WP /200 <i>i</i> WP /	0.200 g or over	[ond []	2 seconds Fa	ster	5E-P 0	Lesser			
300 <i>i</i> WP	_								
FX-1200 i WP /2000 i WP /	2.00 g or over	[and	4 seconds		5t-b l				
3000 <i>i</i> WP	_								
		[ond 2	8 seconds More	accurate	5E-B 2	Greater			

## Zero tracking ( trc )

This function tracks zero point drift caused by changes in the environment and stabilizes the zero point. When the weight data is only a few digits, turn the function off for accurate weighing.

#### Note

Digit, when used for the FX-i WP series balance, indicates a unit of minimum weighing value.

trc O	The tracking function is not used. Used for weighing a very light sample.
trc 1	The tracking function is used. Normal zero tracking.
trc 2	The tracking function is used. Strong zero tracking.
trc 3	The tracking function is used. Very strong zero tracking.

## Display refresh rate (5Pd)

Period to refresh the display. This parameter influences "Stream mode" along with "Baud rate" and "Data output pause"

#### Note

This item is selected automatically when the response rate is changed.

## **Decimal point (***PnE* )

The decimal point format can be selected.

## Auto display-ON (P-on)

When the AC adapter is connected, the display is automatically turned on in the weighing mode, without the ON:OFF key operation. Used when the balance is built into an automated system. 30-minute warm up is necessary for accurate weighing.

## Auto display-OFF ( $P_0FF$ )

When the AC adapter is connected and no operation is performed (inactivity state) for 10 minutes, the display is automatically turned off and the standby indicator is illuminated.

## 9-5 Description of the Item "Data Output Mode"

The parameter setting of the "Data output mode (PrE)" applies to the performance when the data is transmitted using the RS-232C serial interface.

## Key mode

When the PRINT key is pressed with the stabilization indictor turned on, the balance outputs the weight data and the display blinks one time.

Required setting doub Prb (1) Key mode

## Auto print modes A and B

When the displayed value is stable and the conditions of "Auto print polarity", "Auto print difference" and reference value are met, the balance outputs the weight data.

When the PRINT key is pressed with the stabilization indictor turned on, the balance outputs the data and the display blinks one time.

Mode A: Required setting dout Prt | Auto print mode A (reference = zero)

dout RP-P Auto print polarity
dout RP-b Auto print difference

Example "For outputting the weight value each time a sample is added, with

"Ar - d" set to " /" (to adjust zero after the data is output)."

Mode B: Required setting dout Prt 2 Auto print mode B (reference = last stable value)

dout RP-P Auto print polarity
dout RP-b Auto print difference

Example "For outputting the weight value while a sample is added."

#### Stream mode

The balance outputs the weight data continuously regardless of the display condition. The display does not blink in this mode.

Required setting doub Prb 3 Stream mode

basence 5Pd Display refresh rate

5 iF 6P5 Baud rate

Example "For monitoring data on a computer"

#### Caution

The balance may not transmit the data completely at the specified refresh rate and baud rate. Set the baud rate higher.

### Key mode B

When the PRINT key is pressed, the balance outputs the weight data, regardless of the display condition. The display does not blink in this mode.

### Key mode C

When the PRINT key is pressed with the stabilization indictor turned on, the balance outputs the weight data. When the stabilization indicator is not on, the balance waits for the indicator to turn on and outputs the data. The balance blinks one time in this mode.

## Interval output mode

The weight data is periodically output.

When the PRINT key is pressed, the balance starts to output the weight data at a preset interval time. When the PRINT key is pressed again, the balance stops outputting the weight data.

Required setting doub Prt 5 Interval output mode

doub Interval time

Example "For outputting the weight data periodically."

#### Caution

The balance may not transmit the data completely at the specified interval times and baud rate. Set the baud rate higher.


## 9-6 Description of the Item "Data Format"

### A&D standard format

5 if EYPE O

This format is used when the peripheral equipment can receive the A&D format. If an AD-8121B is used, set the printer to MODE 1 or 2.


- This format consists of fifteen characters excluding the terminator.
- A header of two characters indicates the balance condition.
- The polarity sign is placed before the data with the leading zeros. If the data is zero, the plus sign is used.
- The unit, consisting of three characters, follows the data.

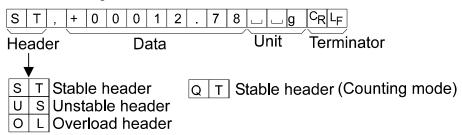

## **DP (Dump print) format** 5 if EYPE |

This format is used when the peripheral equipment can not receive the A&D format. If an AD-8121B is used, set the printer to MODE 3.


- This format consists of sixteen characters excluding the terminator.
- A header of two characters indicates the balance condition. No overload header is used.
- The polarity sign is placed before the data, with spaces in place of leading zeros, if the data is not zero or overloaded.
- The unit, consisting of three characters, follows the data.

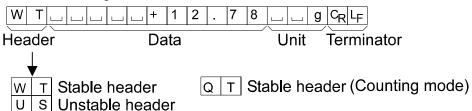

### **KF format** 5 .F £ 498 2


This is the Karl-Fischer moisture meter format and is used when the peripheral equipment can only communicate using this format.

- This format consists of fourteen characters excluding the terminator.
- This format has no header characters.
- The polarity sign is placed before the data, with spaces in place of leading zeros, if the data is not zero or overloaded.
- This format outputs the unit only for a stable value.

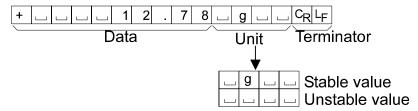

### MT format 5 F LYPE 3


- A header of two characters indicates the balance condition.
- The polarity sign is used only for negative data.
- The weight data uses spaces in place of the leading zeros.
- The character length of this format changes dependent upon the unit

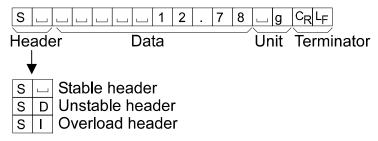

## NU (numerical) format 5 ,F ŁYPE 4

This format outputs only numerical data.

- This format consists of nine characters excluding the terminator.
- The polarity sign is placed before the data with the leading zeros. If the data is zero, the plus sign is used.

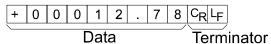

### CSV format 5 iF EYPE 5

- Separates the data of A&D standard format and the unit by a comma (,).
- Outputs the unit even when the data is overloaded.

# 9-7 Data Format Examples

Stable  • 1.27 g	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$
Unstable -183.69 9	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$
Overload Positive error  E 9	A&D O L , + 9 9 9 9 9 9 9 E + 1 9 C <sub>R</sub> L <sub>F</sub> DP KF
Overload Negative error	A&D O L , - 9 9 9 9 9 9 E + 1 9 C <sub>R</sub> L <sub>F</sub> DP KF
─ Space, ASCII	20h

Space, ASCII 20h

c<sub>R</sub> Carriage Return, ASCII 0Dh

Line Feed, ASCII 0Ah

Units		A&D	D.P.	KF	МТ
g	g	g	g		∟ g
Counting mode	FCS	⊔ P C	⊔PC	□ p c s	□ P C S
Precent mode	%	니 <b>니</b> %	<u> </u>		山%
Ounce (Avoir)	OZ	<u></u> О Z	_ O Z	υΟΖυ	⊔ O Z
Pound	1b	⊔ I b	∟ I b	u I b u	⊔ I b
Pound Ounce	LOZ	0 Z	0 Z		_ 0 Z
Troy Ounce	ozt	o z t	o z t	u o z t	ப o z t
Metric Carat	ct	ct	ct	∟ c t ∟	_ c t
Momme	mom	m o m	$m \circ m$		∟ m o
Pennyweight	dwt	d w t	d w t	니dwt	ഥ d w t
Grain	GN	□GN	□GN	g r	□GN
Tael (HK general, Singapore)	<b>tl</b>	山 t I	山 t I	니 t l s	山 t I
Tael (HK, jewelry)	<b>tl</b>	山 t I	山 t I	니 t l h	山 t I
Tael (Taiwan)	<u>t1</u>	山 t I	山 t I		山 t I
Tael (China)	<u>t1</u>	山 t I	山 t I	⊔ t I c	山 t I
Tola (India)	tol	பப t	uu t	∟ t O I	t
Messghal	mes	m e s	m e s	⊔MS⊔	⊔ m
Multi	MLT	MLT	MLT		

<sup>□</sup> Space, ASCII 20h

### Note

When "Pound Ounce" is selected, the data is output with the unit of ounce (oz).

## 9-8 Description of the Item "Application Function"

## Capacity indicator ( RPF 1)

In the weighing mode, the indicator displays the weight data relative to the weighing capacity in percentage. (Zero = 0%, maximum capacity = 100%)

## Statistical calculation mode ( RPF ≥)

The mode statistically calculates the weight data, and displays or outputs the results. For details, refer to "5-4 Statistical Calculation Mode".

## 9-9 Comparator Function

The results of the comparison are indicated by HI OK LO on the display.

Operating conditions: 

No comparison

- Comparison when the weight data is stable or overloaded, excluding "near zero"
- Comparison when the weight data is stable or overloaded, including "near zero"
- Continuous comparison, excluding "near zero"
- Continuous comparison, including "near zero"

To compare, use: Input method:

• Upper limit value and lower limit value

Digital input

#### Note

"Near zero" means that the weight value is within  $\pm 10$  digits of the minimum weighing value. For example, using a FX-3000i WP in gram mode, the range of  $\pm 0.10$  g is "near zero".

For the description of "Comparator (*EP Foc*)", refer to "9-3 Details of the Function Table".

## Setting example

(Continuous comparison, excluding "near zero", upper limit and lower limit values, digital input)

### Selecting a comparator mode

- 1 Press and hold the SAMPLE key until b85Fnc of the function table is displayed.
- 2 Press the SAMPLE key several times to display [[P Fnc].
- 3 Press the PRINT key.
- 4 Press the RE-ZERO key several times to display [[P β].
- 5 Press the PRINT key to store the selected mode.

### Entering the upper limit value

- 6 With [[P] H] displayed, press the PRINT key. The current setting of the upper limit value is displayed with all the digits blinking.
  - When the current setting is not to be changed, press the PRINT or CAL key to proceed to step 7.
  - When the current setting is to be changed, press the RE-ZERO key. Change the setting using the following keys.

SAMPLE key To select the digit to change the value.

RE-ZERO key To change the value of the digit selected.

MODE key To switch the polarity.

PRINT key

To store the new setting and go to step 7.

CAL key

To cancel the new setting and go to step 7.

### **Entering the lower limit value**

- 7 With [P Lo] displayed, press the PRINT key. The current setting of the lower limit value is displayed with all the digits blinking.
  - When the current setting is not to be changed, press the PRINT or CAL key to proceed to step 8.
  - When the current setting is to be changed, press the RE-ZERO key. Change the setting using the following keys.

SAMPLE key To select the digit to change the value.

RE-ZERO key To change the value of the digit selected.

MODE key To switch the polarity.

PRINT key

To store the new setting and go to step 8.

CAL key

To cancel the new setting and go to step 8.

8 Press the CAL key to exit the comparator function and return to the weighing mode.

# 10. ID NUMBER AND GLP REPORT

- The ID number is used to identify the balance when Good Laboratory Practice (GLP) is used.
- The ID number is maintained in non-volatile memory even if the AC adapter is removed.
- The GLP output format is selected at "GLP output ( ) of the function table and can be output to a personal computer or printer using the RS-232C serial interface.
- The GLP output format includes the balance manufacturer, model, serial number, ID number and space for signature for weight data, and the weight used and results for calibration or calibration test data.

When the AD-8121B is used, the date and time can be printed using the AD-8121B clock and calendar function. In this case, set the "GLP output ( )" parameter to " !".

The balance can output the following reports for GLP.

"Calibration report" of the calibration, using an external weight.

"Calibration test report" of the calibration test, using an external weight.

"Title block" and "End block" for the weight data.

## 10-1 Setting the ID Number

- 1 Press and hold the SAMPLE key until bR5Fnc of the function table is displayed.
- 2 Press the SAMPLE key several times to display \[ \sqrt{d} \].
- 3 Press the PRINT key. Set the ID number using the following keys.

SAMPLE key To select the digit to change the value.

RE-ZERO key To set the character of the digit selected. Refer to the display character

set shown below.

PRINT key

To store the new ID number and display RP Fnc

CAL key

To cancel the new ID number and display RP Fnc

4 Press the CAL key to return to the weighing mode.

### Display character set

C	)	1	2	3	4	5	6	7	8	9	-	_	Α	В	С	D	Е	F	G	Н	I	J	K	L	М	N	0	Ρ	Q	R	s	Т	U	V	W	Χ	Υ	Z
[	7	1	2	3	4	5	5	7	8	3	•		R	5	Ĺ	₫	E	F	[	Н	,	η	ዞ	L	ā	n	ū	ביר	7	7	5	<u></u>	<u>!</u> /	ū	'n	//	4	<u>,</u>
	. Space																																					

## 10-2 GLP Report

Set the following parameters to output the report.

- To print the report, set the "GLP output ( InFa)" parameter to "!" and use MODE 3 of the AD-8121B. For details on using the printer, refer to "14-1 Connection to the AD-8121B Printer". If the time and date are not correct, adjust the AD-8121B clock and calendar.
- To output the report to a personal computer using the RS-232C serial interface, set the "GLP output ( ¬¬F¬□ )" parameter to "¬□".

#### **Note**


For operational details about calibration and calibration test, refer to "7. CALIBRATION".

## Calibration report using an external weight

When the setting is " in Fa 1":

When the setting is " ₁¬F¬ 2":

### AD-8121 format

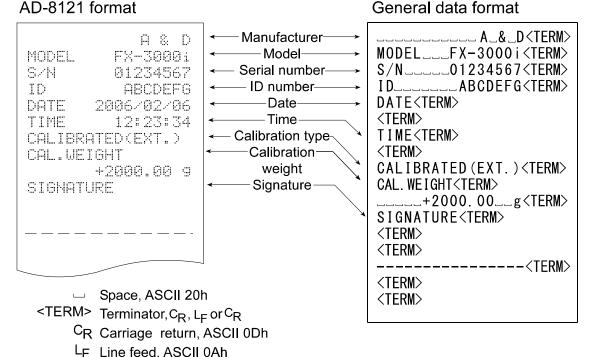


## Calibration test report using an external weight

(Calibration test does not perform calibration.)

When the setting is " In Fa 1":

When the setting is " יח + a ≥":


### AD-8121 format

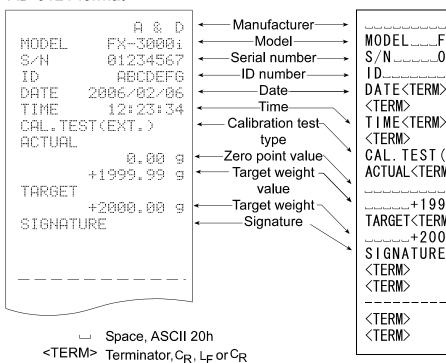

CR Carriage return, ASCII 0Dh

LF Line feed, ASCII 0Ah

### General data format

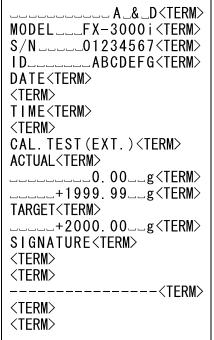

### Title block and end block


When a weight value is recorded as the GLP data, "Title block" and "End block" are inserted at the beginning and at the end of a group of weight values, in the GLP report.

#### Note

To output the report to an AD-8121B, use MODE 3 of the AD-8121B.

### Operation


- 1 With the weight data displayed, press and hold the  $\boxed{PRINT}$  key until  $\boxed{5 \xi R r \xi}$  is displayed. The "Title block" is output.
- 2 The weight data is output according to the parameter setting of the data output mode.
- 3 Press and hold the PRINT key until  $r \mathcal{E} c \mathcal{E} n d$  is displayed. The "End block" is output.

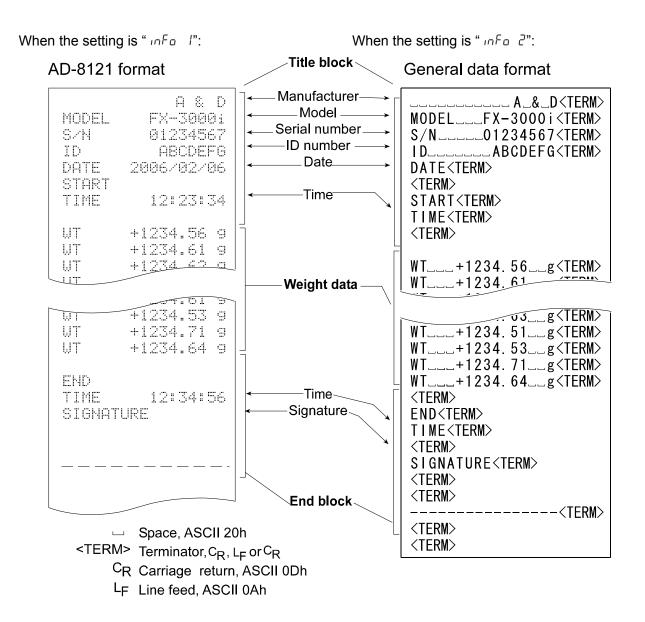

# 11. UNDERHOOK

The underhook can be used for magnetic materials or density measurement. The built-in underhook is revealed by removing the plastic cap on the bottom of the balance.

Use the underhook as shown below.

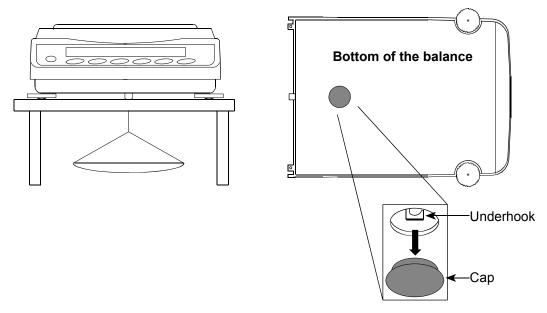

### Caution

- Do not apply excessive force to the underhook.
- When the underhook is not in use, attach the plastic cap to prevent dust from getting into the balance.

The cap was sealed to the bottom of the balance using a special adhesives to be dust-tight and protected against water jets. The balance does not comply with IP65 once the cap has been removed, .

# 12. PROGRAMMABLE-UNIT

This is a programmable unit conversion function. It multiplies the weight data in grams by an arbitrary coefficient set in the function table and displays the result.

The coefficient must be within the range between the minimum and maximum shown below. If the coefficient set is beyond the range, an error is displayed and the balance returns to the coefficient setting mode, prompting to enter an appropriate value. A coefficient of 1 was set at the factory.

Model	Minimum coefficient	Maximum coefficient
FX-120 <i>i</i> WP /200 <i>i</i> WP /300 <i>i</i> WP	0.000001	1000
FX-1200 <i>i</i> WP /2000 <i>i</i> WP /3000 <i>i</i> WP	0.000001	100

## Operation

- 1 Press and hold the SAMPLE key until bR5Fnc of the function table is displayed.
- 2 Press the SAMPLE key several times to display [nlt].
- 3 Press the PRINT key. The balance enters the mode to confirm or set the coefficient.

### Confirming the coefficient

- 4 The current coefficient is displayed with the first digit blinking.
  - When it is not to be changed, press the CAL key and proceed to step 6.
  - When it is to be changed, press the RE-ZERO key and proceed to step 5.

## Setting the coefficient

5 Set the coefficient using the following keys.

SAMPLE key

To select a digit to change the value. The selected digit blinks.

RE-ZERO key

To change the value.

MODE key

To change the decimal point

position.

Each time the switch is pressed, the decimal point position

changes as follows:

 $\nearrow 0.000001 \longrightarrow 00.00001 \longrightarrow ... \longrightarrow 000000.1 \longrightarrow 0000001 ---$ 

PRINT key To store the new setting,

display End and go to step 6.

CAL key To cancel the new setting and

go to step 6.

#### Quitting the operation

6 The balance displays Unit. Press the CAL key to exit the programmable-unit function and return to the weighing mode.

### Using the function

Press the MODE key to select the programmable-unit (no display on the unit section). Perform weighing as described in "5-1 Basic Operation (Gram Mode)". After weighing, the balance displays the result (weight data in grams x coefficient).



# 13. RS-232C SERIAL INTERFACE

The balance is a Data Communication Equipment (DCE) device. Connect the balance to a personal computer (DTE) using a straight through cable.

Transmission system: EIA RS-232C (D-Sub 9-pin, female connector)

Transmission form : Asynchronous, bi-directional, half duplex

Transmission rate : 20 times/second, 10 times/second or 5 times/second (same as data refresh rate)

Data format : Baud rate : 600, 1200, 2400, 4800, 9600, 19200 bps

Data bits : 7 or 8 bits

Parity : Even, Odd (Data bits 7 bits)

None (Data bits 8 bits)

Stop bit : 1 bit
Code : ASCII

RS-232C

-5V to -15V

Data bits

Start bit

RS-232C

-5V to -15V


Stop bit


Parity bit

### **D-Sub 9-pin assignments**

Pin No.	Signal name	Direction	Description				
1	_	_	No connection				
2	TXD	Output	Transmit data				
3	RXD	Input	Receive data				
4	_	_	No connection				
5	SG	_	Signal ground				
6	DSR	Output	Data set ready				
7	RTS	Input	Request to send				
8	CTS	Output	Clear to send				
9	_	_	No connection				

Signal names of the balance side are the same as the DTE side with TXD and RXD reversed.

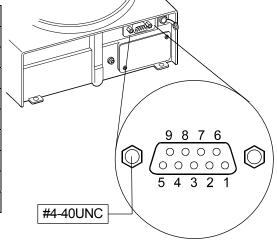

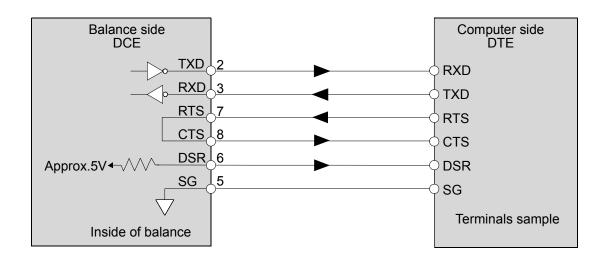

# 14. CONNECTION TO PERIPHERAL EQUIPMENT

## 14-1 Connection to the AD-8121B Printer

Set the following parameters to use the AD-8121B printer.

Example of use	AD-8121B mode setting
To print A&D standard format weight data, using the FX- <i>i</i> WP PRINT key or FX- <i>i</i> WP auto print mode. (The time and date can be added.)	MODE 1
To print A&D standard format weight data, using the AD-8121B DATA key or AD-8121B built-in timer. (The time and date can be added.)  To print, using the AD-8121B chart printing function.	MODE 2
To print the FX- <i>i</i> WP statistical data.	MODE 3
To print GLP output.	MODE 3

Class	Item and Parameter	Factory settings	AD-8121B MODE 1	AD-8121B MODE 2	AD-8121B MODE 3
dout	Pr է Data output mode	0	0, 1,2,4,5 *1	3	0, 1,2,4,5 *1
Data output	PUSE Data output pause	0	О	0	0,1 *2
	ьዎ5 Baud rate	2	2	2	2
5 iF	bととこ Data bit, parity bit	0	О	0	0
Serial interface	ErLF Terminator	0	0	0	0
	는	0	0	0	I

<sup>\*1</sup> Set appropriate parameters for "PP-P (Auto print polarity)" and "PP-b (Auto print difference) " when auto print mode A or B (Prb I or 2) is selected.

Set the AD-8121B DIP switch No.3 to ON when unstable data is printed with "Prt 4".

### **Notes**

Refer to "10-2 GLP Report" for print samples.

### **Settings of AD-8121B DIP switches**

MODE	AD-8121B DIP switch	Description
MODE 1	D S O P O D O D O D O D O D O D O D O D O D	Print at receiving data. Standard mode, statistical calculation mode
MODE 2	D S S P O O O O O O O O O O O O O O O O O	Print by the AD-8121B DATA key operation or AD-8121B built-in timer. Standard mode, interval mode, chart mode
MODE 3	V S C L O	Print at receiving data. Dump print mode

DIP switch No.3: Handling unstable data

ON Print
OFF Not printed





Set the DIP switch No.4 to OFF.


<sup>\*2</sup> Set / when multiple lines are printed in the FX- i WP statistical calculation mode.

## 14-2 Connection to a Computer

The FX-i WP series balance can be connected to a personal computer using the RS-232C serial interface. As an option, the FXi –02 USB interface is available to transmit the balance data to a personal computer.

The FX-i WP series balance is a DCE.

Use a straight through cable. If purchasing the RS-232C cable on the market, check the interface connections and type.

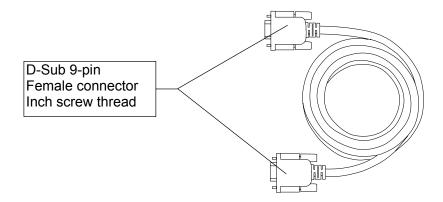

Use the waterproof RS-232C cable (AX-KO2737-500) that is sold separately as an option, when the RS-232C serial interface is used with IP-65. (Refer to page 63)

## 14-3 Using Windows Communication Tools (WinCT)

When Windows is used as an operating system in a personal computer, the WinCT software, that is downloaded from the A&D website, can be used to transmit the weight data to the personal computer.

The WinCT has two communication methods: "RsCom" and "RsKey".

#### **RsCom**

- Can transmit commands to control the balance.
- Can make bi-directional communication between the balance and a personal computer using the RS-232C serial interface.
- Can display or store the data using a text file format. Can also print the data using a printer connected to the personal computer.
- When several ports of a personal computer have balances connected, can communicate with each balance simultaneously.
- Can share a personal computer with other application software.

### RsKey

- Can transmit the weight data output from the balance directly to other application software such as Microsoft Excel.
- Can be used with most application software.

### Using the WinCT software, the balance can do the following:

- 1 Analyzing the weight data and the statistics with "RsKey"

  The weight data can be input directly into an Excel worksheet. Then, Excel can analyze the data to obtain sum, average, standard deviation, maximum and minimum value, and display them in a graph.
- 2 Controlling the balance using commands from a personal computer By using "RsCom", the personal computer sends commands such as "re-zero" or "send weight data" to the balance and controls the balance.
- 3 Printing the balance GLP report using your printer
  The balance GLP report can be printed using a printer connected to the personal computer.
- 4 Receiving weight data at a certain interval

  The weight data can be received at a certain interval and data characteristic with elapsed time
  can be obtained.
- 5 Using a personal computer as an external indicator
  With the "RsKey" test mode function, a personal computer can be used as an external weight indicator for the balance. (To do this, set the balance data output mode to stream mode.)

# 15. COMMANDS

## 15-1 Command List

### Note

A command has a terminator added, that is specified using the "Terminator ([FLF]" parameter of "Serial interface ([FLF])" in the function table, and is sent to the balance.

## Commands to query weight data

С	Cancels the <b>S</b> or <b>SIR</b> command.
Q	Requests the weight data immediately.
S	Requests the weight data when stabilized.
SI	Requests the weight data immediately.
SIR	Requests the weight data continuously.
E <sub>SC</sub> P	Requests the weight data when stabilized.

Note: The "Q" and "SI" commands, the "S" and "EscP" commands behave the same.

### Commands to control the balance

CAL	Same as the CAL key
OFF	Turns the display off.
ON	Turns the display on.
Р	Same as the ON:OFF key
PRT	Same as the PRINT key
R	Same as the RE-ZERO key
SMP	Same as the SAMPLE key
Т	Tare key
Z	Same as the RE-ZERO key
E <sub>SC</sub> T	Same as the RE-ZERO key
U	Same as the MODE key
?ID	Requests the ID number.
?SN	Requests the serial number.
?TN	Requests the model name.
?PT	Requests the tare weight.
PT: ****. * g	Changes the tare weight.
	The unit added is the current weighing unit in A&D standard format.

Note: The "R", "Z" and "EscT" commands behave the same.

Esc: ASCII code 1Bh

## 15-2 Acknowledge Code and Error Codes

When the "AK, Error code ( $\mathcal{E}_{\mathcal{F}}\mathcal{E}_{\mathcal{G}}$ )" parameter of "Serial interface ( $\mathcal{E}_{\mathcal{F}}\mathcal{F}_{\mathcal{G}}$ )" is set to " $\mathcal{E}_{\mathcal{F}}$ ", the balance outputs <AK> code or an error code for each command as follows:

<AK> (06h) Acknowledge in ASCII code.


- When the balance receives a command to request data and can not process it, the balance transmits an error code (EC, Exx).
  - When the balance receives a command to request data and can process it, the balance outputs the data.
- When the balance receives a command to control the balance and can not process it, the balance transmits an error code (EC, Exx).
  - When the balance receives a command to control the balance and can process it, the balance transmits the acknowledge code.

Among commands to control the balance, the following transmit the acknowledge code both when the balance receives the command and when the balance has accomplished the command. If the command can not be processed properly, the balance transmits an error code (EC, Exx). This error can be released using the CAL command.


CAL command (Calibration command) ON command (Display ON command)

P command (Display ON/OFF command) R command (RE-ZERO command)


### R command example

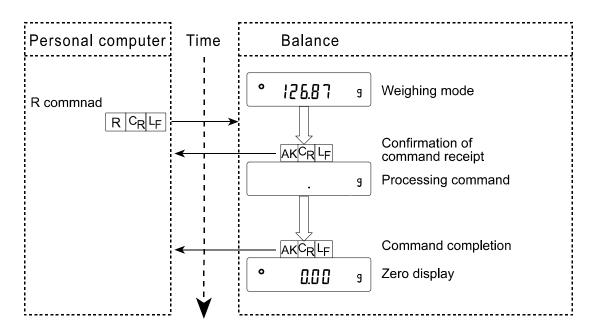

### T command example

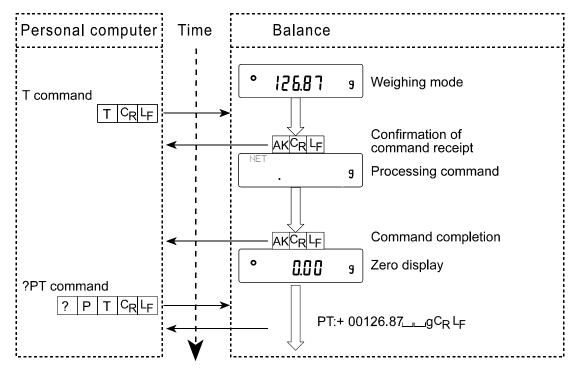

### PT command example

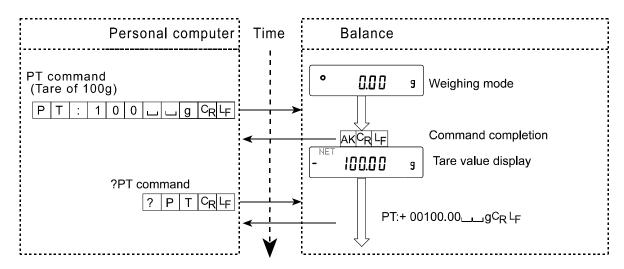

 When a communication error has occurred due to external noise, or a parity error has occurred due to transmission error, the balance transmits an error code. In this case, send the command again.

## 15-3 Settings Related to RS-232C

Concerning the RS-232C, the balance has two functions: "Data output ( daut )" and "Serial interface (  $5 \, F$  )". Set each function as necessary.

# 16. MAINTENANCE


• In normal use, the balance can be cleaned with water. But, keep the following precautions so that dust and water do not invade the balance.

Do not direct water pressure at the bottom of the balance.

Do not use powerful water jets.

Do not immerse the balance in water.

- Do not use organic solvents to clean the balance. Clean the balance with a lint free cloth that is moistened with warm water and a mild detergent.
- Do not disassemble the balance. Contact the local A&D dealer if the balance needs service or repair.
- Use the original packing material for transportation.
- While cleaning the balance and keeping it waterproof, cover the RS-232C interface connector
  using the terminal cover or connect the waterproof RS-232C cable (AX-KO2737-500), and
  cover the AC adapter jack. Also, insure that the underhook cap is in place.

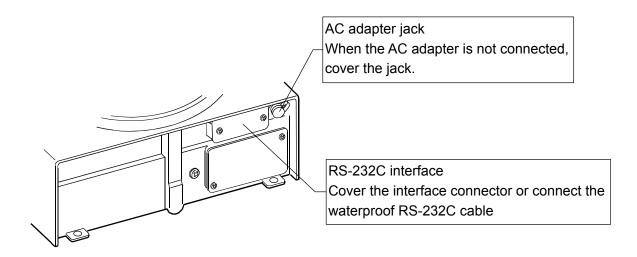

• If water accumulates on the waterproof diaphragm, a weight value may be difficult to become stable. Clean the diaphragm while taking much care not to deform it.

# 17. TROUBLESHOOTING

## 17-1 Checking the Balance Performance and Environment

The balance is a precision instrument. When the operating environment or the operating method is inadequate, correct weighing can not be performed. Place a sample on the pan and remove it, and repeat this several times. If the balance seems to have a problem with repeatability or to perform improperly, check as described below. If improper performance persists after checking, contact the local A&D dealer for repair.

## Checking that the balance performs properly

- Check the balance repeatability using an external weight. Be sure to place the weight in the center of the weighing pan.
- Check the balance repeatability, linearity and calibrated value using external weights with a known value.

## Checking that the operating environment or weighing method is proper Operating environment

- Is the weighing table solid enough (especially for the FX-120*i* WP /200*i* WP /300*i* WP, the balance with a minimum weighing value of 0.001 g)?
- Is the balance level? Refer to "3-1 Before Use".
- Is the operating environment free from vibration and drafts? For the FX-120i WP /200i WP /300i WP, has the breeze break been installed?
- Is there a strong electrical or magnetic noise source such as a motor near the balance?

#### Weighing method

- Is the weighing pan installed correctly?
- Is the waterproof diaphragm deformed? Is the waterproof diaphragm free of foreign materials?
- Is the RE-ZERO key pressed before placing a sample on the weighing pan?
- Is the sample placed in the center of the weighing pan?
- Has the balance been calibrated using an external weight?
- Has the balance been warmed up for 30 minutes before weighing?

### Sample and container

- Has the sample absorbed or lost moisture due to the ambient conditions such as temperature and humidity?
- Has the temperature of the container been allowed to equalize to the ambient temperature?
   Refer to "3-2 During Use".
- Is the sample charged with static electricity? Refer to "3-2 During Use".
   The FX-120i WP /200i WP /300i WP is prone to be affected by static electricity when the relative humidity is low.
- Is the sample of magnetic material such as iron? Caution is required for weighing magnetic materials. Refer to "3-2 During Use"

# 17-2 Error Codes

Display	Error code	Description
	EC, E11	Stability error
[Error		The balance can not stabilize due to an environmental problem. Prevent vibration, drafts, temperature changes, static electricity and magnetic fields.
		Confirm that the weighing pan is properly installed. Confirm that the waterproof diaphragm is free of foreign materials.
		Refer to "3. PRECAUTIONS" for details on the operating environment and "6. RESPONSE ADJUSTMENT" about adapting the balance to the environment.
		To return to the weighing mode, press the CAL key.
		Out of range error
Error <u>2</u>		The value entered is beyond the settable range.
		Re-enter the value.
	EC, E20	Calibration weight error
		The calibration weight is too heavy.
		Confirm that the weighing pan is properly installed.  Confirm the calibration weight value.
		Press the CAL key to return to the weighing mode.
	EC, E21	Calibration weight error
-[RL E	<b>,</b>	The calibration weight is too light.
		Confirm that the weighing pan is properly installed.
		Confirm the calibration weight value.
		Press the CAL key to return to the weighing mode.
F		Overload error
		A sample beyond the balance weighing capacity has been placed on the pan.
		Remove the sample from the pan.
		Weighing pan Error
- <u>E</u>		The weight value is too light.
		Confirm that the weighing pan is properly installed and calibrate the balance.
		Sample mass error
La		The balance can not store the sample for the counting mode or for the percent mode because it is too light.
		Use a sample that is heavier.
		Unit mass error
25 - PCS		The sample unit mass for the counting mode is too light. Storing and using it for counting will cause a
50 - PCS		counting error.  Add samples to reach the specified number and press the PRINT key.
		Pressing the PRINT key without adding samples will shift the balance to the counting mode. But, to acquire accurate weighing, be sure to add samples.

Display	Error code	Description		
	EC, E00	Communications error		
		A protocol error occurred in communications.		
		Confirm the format, baud rate and parity.		
	EC, E01	Undefined command error		
		An undefined command was received.		
		Confirm the command.		
	EC, E02	Not ready		
		A received command can not be processed.		
		e.g. The balance received a Q command, but not in the weighing mode.		
		e.g. The balance received a Q command while processing a RE-ZERO command.		
		Adjust the delay time to transmit a command.		
	EC, E03	Timeout error		
		If the timeout parameter is set to "Ł-UP I", the balance did not receive the next character of a command within the time limit of one second.		
		Confirm the communication.		
	EC, E04	Excess characters error		
		The balance received excessive characters in a command.		
		Confirm the command.		
	EC, E06	Format error		
		A command includes incorrect data.		
		e.g. The data is numerically incorrect.		
		Confirm the command.		
	EC, E07	Parameter setting error		
		The received data exceeds the range that the balance can accept.		
		Confirm the parameter range of the command.		
Other errors		If the errors described above can not be released or other errors are displayed, contact the local A&D dealer.		
	•			

# 17-3 Asking For Repair

If the balance needs service or repair, contact the local A&D dealer.

The balance is a precision instrument. Use much care when handling the balance and observe the following when transporting the balance.

- Use the original packing material.
- Remove the weighing pan from the main unit

# 18. OPTIONS


#### **Notes**

The FXi-02, FXi-08 and FXi-09 can not be used at the same time.


The FX-i WP series balance does not comply with IP65 when the FXi-02, FXi-08 or FXi-09 is used with the balance.

### FXi-02 USB interface (Installed in the balance, Applicable OS: Windows 98 OSR2 or later)

- Used to transmit the balance weight data (numerical value only) uni-directionally to a personal computer via USB
- Can transmit the balance weight data (numerical value only) directly to other application software such as Microsoft Excel, Word and memo pad.
- Driver installation is not necessary.

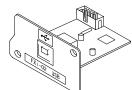


FX i -02 Example of use

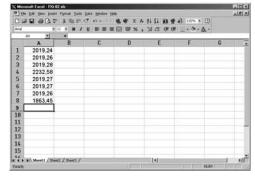


### FXi-08 Ethernet interface

- Used to connect the balance to a LAN.
- The "WinCT-Plus" data communication software is provided as an accessory and can perform the following.
  - Acquire data from multiple balances connected to a LAN.
  - Control these balances with commands.
  - Acquire data transmitted from balances.
     Example: When pressing the PRINT key of the balance, data is output and is acquired by the computer.
  - The stored data can be used with Microsoft Excel (if installed).

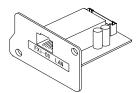

FX i -08 Example of use

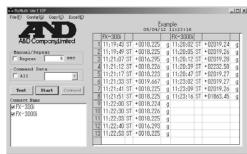

## FXi-09 Built-in battery unit (Ni-HM rechargeable battery pack)

- Charging time: Approx. 10 hours
- Continuous operation hours: Approx. 8 hours

#### FXi-WP-10 Small breeze break


Provided for FX-120i WP /200i WP /300i WP as standard. Can be used for FX-1200i WP /2000i WP /3000i WP.

### FXi-WP-11 Large breeze break

 Breeze break with greater height. Can be used for all models. Convenient when a large beaker or measuring cylinder is used and requires more height.

### AX-KO2737-500 Waterproof RS-232C cable

- Length 5 m, D-Sub 9-pin D-Sub 9-pin
- Only the 9-pin of the balance side is of waterproof type.

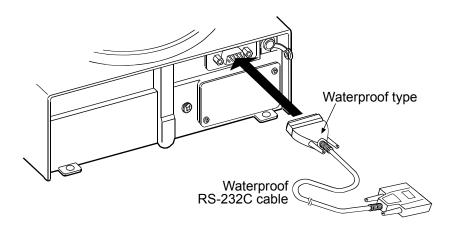

### Note

Be sure to insert the waterproof type connector into the RS-232C interface connector on the rear of the balance.

### AD-1683 DC static eliminator

• Used to minimize weighing errors due to static electricity on the material.

### AD-8920 Remote display

• Connected to the FX-*i* WP series balance using the RS-232C serial interface to display the weight data away from the balance.

#### **AD-8922 Remote controller**

- Connected to the FX-*i* WP series balance using the RS-232C serial interface to display the weight data and to remotely control the balance.
- Analog output and comparator output available as an option to be installed.

#### **AD-8121B Printer**

- Compact dot-matrix printer
- Statistical function, clock and calendar function, interval print function, graphic print function, dump print mode
- 5 x 7 dots, 16 characters per line
- Print paper (AX-PP143, 45 (W) x 50 (L) mm , ø65 mm)
- AC adapter or alkaline battery.



#### Note


When connecting the remote display, remote controller, or printer to the FX-i WP series balance using the cable provided with each device, the balance does not comply with IP65.

# 19. SPECIFICATIONS

		FX-120 <i>i</i> WP	FX-200 <i>i</i> WP	FX-300 <i>i</i> WP	FX-1200 <i>i</i> WP	FX-2000 <i>i</i> WP	FX-3000 <i>i</i> WP	
Weighing capacity		122 g	220 g	320 g	1220 g	2200 g	3200 g	
Maximum	display	122.084 g	220.084 g	320.084 g	1220.84 g	2200.84 g	3200.84 g	
Minimum	weighing value (1 digit)		0.001 g		0.01 g			
Repeatab	ility (Standard deviation)	0.001 g			0.01 g			
Linearity		±0.002 g			±0.02 g			
Stabilizati	on time (typical at FAST)	Approx. 1 second						
	Sensitivity drift (10°C-30°C/50°F-86°F)		±2 ppm/°C					
Operating	Operating environment		5°C to 40°C (41°F to 104°F) 85%RH or less (No condensation)					
Display re	fresh rate	5	times/secon	d, 10 times/s	second or 20 times/second			
Counting	Minimum unit mass	0.001 g			0.01 g			
mode	Number of samples	5, 10, 25, 50 or 100 pieces						
Percent	Percent Minimum 100% reference mass		0.100 g			1.00 g		
mode	Minimum 100% display	0.01%, 0.1%, 1% (Depends on the reference mass stored.)						
External of	External calibration weight		200 g 100 g	300 g 200 g 100 g	1000 g 500 g	2000 g 1000 g	3000 g 2000 g 1000 g	
Weighing	pan diameter	130 mm			150 mm			
Net weigh	t	Approx. 2.7 kg						
External d	External dimensions		193 (W) x 262.5 (D) x 84.5 (H) mm					
AC adapter		Confirm that the adapter type is correct for the local voltage and power receptacle type						
Power consumption		Approx. 11VA (supplied to the AC adapter)						
Interface		RS-232C						
Dust and	water protection	Complying with IP65						


# **20. EXTERNAL DIMENSIONS**


### FX-120i WP / 200i WP / 300i WP

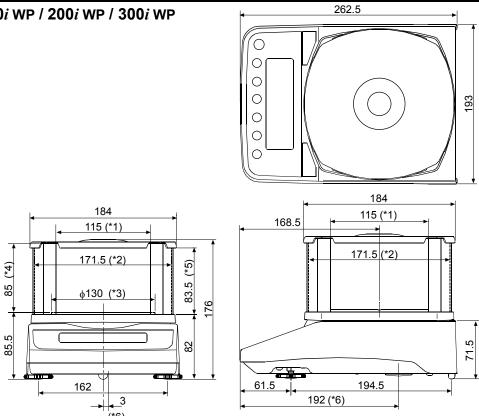

- \*1: Width of the opening when a clear plate is removed
- \*2: Inside dimension
- \*3: Weighing pan diameter
- \*4: Height from the weighing pan up to the cap of the breeze break (Inside dimension)
- \*5: Height of the opening when a clear plate is removed
- \*6: Underhook position

### FX-1200i WP / 2000i WP / 3000i WP

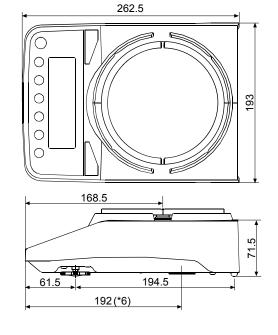


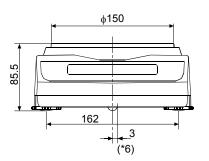

\*6: Underhook position

Unit: mm

FXi-WP-11 Large breeze break

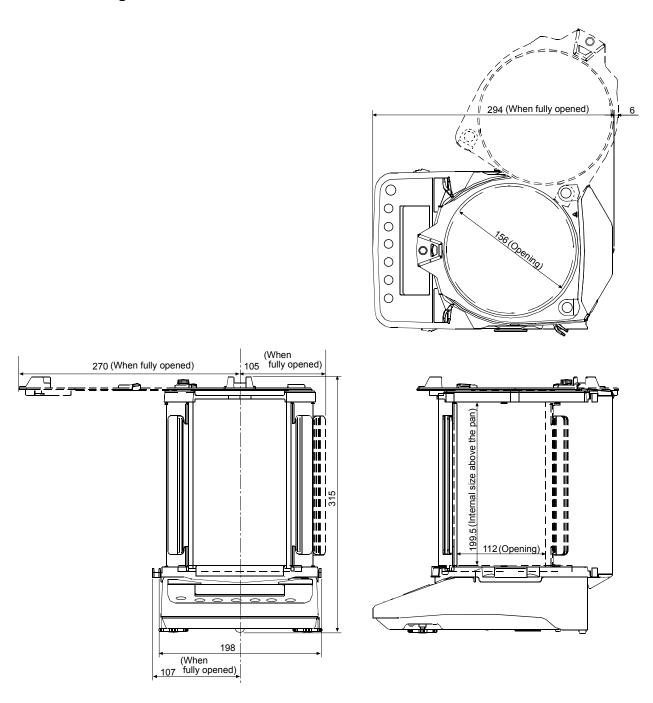

Unit: mm

# 21. TERMS/INDEX

**Terms** 

**Stable value** The weight data when the stabilization indicator appears.

**Environment** Ambient conditions such as vibration, drafts, temperature, static electricity and

magnetic fields which affect the weighing operation.

**Calibration** Adjustment of the balance so that it can weigh accurately.

**Output** To output the weight data using the RS-232C serial interface.

Zero point A weighing reference point or the zero display. Usually refers to the value

displayed when nothing is on the weighing pan.

**Digit** Unit of digital resolution. Used for the balance, a unit of minimum weighing value.

**Tare** To cancel the weight of a container which is not included in the weight data.

**Mode** Balance operational function.

**Re-zero** To set the display to zero.

**GLP** Good Laboratory Practice.

Repeatability Variation in measured values obtained when the same weight is placed and

removed repetitively. Usually expressed as a standard deviation.

e.g. Standard deviation=1 digit: This means that measured values fall within  $\pm 1$ 

digit in the frequency of about 68%.

Stabilization time Time required after a sample being placed, until the stabilization indicator

illuminates and the weight data is displayed.

**Sensitivity drift** An affect that a change in temperature causes to the weight data. Expressed as

temperature coefficient.

e.g. Temperature coefficient = 2 ppm/°C : If a load is 300 g and the temperature

changes by 10°C, the value displayed changes by the following value.

0.0002%/°C x 10°C x 300 g = 6 mg

**IP65** IP code: Degree of protection provided by enclosures.

6: Dust-tight. No ingress of dust. 5: Protect against water jets.

## Index

## Keys and symbols

ON/OFF key	- B -
SAMPLE key	₽₩₽₽₽₽₽ Environment display 14, 35
MODE key 11 CAL key 11, 28, 34	bR5Fnc         Environment display14, 35           Baud rate37, 51, 52
<u> </u>	<i>δΕΕΡ</i> Beep35
PRINT key	<i>δΕΡ</i> - HI buzzer35
Stabilization indicator11	<i>ΔΕΡ</i> - LO buzzer35
	<i>LEP</i> OK buzzer35
Interval output mode active indicator 11	6/5 Baud rate37, 52
	Breeze break
Processing indicator11  CR CR43	·
	,   , , -
L <sub>F</sub> LF43 Space43	Built-in battery unit62
100% reference mass18	- C -
100 % reference mass10	
_	Calibration weight error60
- A -	-[RL E Calibration weight error60
A&D standard format37, 41	<u>CAL</u> key11
AC adapter6	Calibration 27, 28, 29, 33, 46, 60, 68
AC adapter ID label6	Calibration report29, 46
ACAI17	Calibration test30, 46
AD-16839, 63	Calibration test report31, 46
AD-8121B48, 52, 64	CanCel22
AD-8920 64	capacity indicator44
AD-892264	Capacity indicator 11, 37
AK56	Clear the statistical data22
Animal mode indicator11	Coefficient of variation19, 22, 37
RP Fnc Application19, 37	Command list55
유무-Ь Auto print difference36	Comparator function45
RPF Application function19, 37	Comparator indicators11
유우-우 Auto print polarity36, 52	Eand Condition35, 38
Application19, 37	Counting mode16
Application function19, 37	Comparator mode35
Rr-d Zero after output36	[P Fnc Comparator35
위난 - F Auto feed	EP H , Upper limit35
Auto display-OFF35, 39	[P Lo Lower limit35
Auto display-ON35, 39	[rLF Terminator37, 52
Auto print difference36	CSV format
Auto print mode A36, 40	Coefficient of variation22
Auto print mode B36, 40	_
Auto print polarity36	- D -
리나트 Average22	Data bits51
Average19, 22, 37	Data format
AX-KO2737-5003, 8, 53, 58, 63	Data output mode36
-, -,,	Data output pause36
	ostpat pasoo

DC static eliminator	63	
DCE		-1-
Decimal point		-1-
Digit35		ID number 46
Display at start		ınFa GLP output36
		Inhibit
Display refresh rate		Initializing the Balance 33
dout Data output		Interval time
DP format		Interval output mode36, 41
DTE		Interval output mode active indicator 11
Dust and waterproof balance	6, 8	Interval output mode standby indicator 11
_		Interval time
- E -		IP653, 8, 49, 62, 65, 68
-E	60	, 5, 15, 5, 5, 5, 5, 5, 5, 5, 5, 5, 5, 5, 5, 5
EC, E00		- K -
EC, E01	_	
EC, E02		Key mode36, 40
EC, E03		Key mode B36, 40
EC, E04		Key mode C36, 40
EC, E06		KF format37, 42
EC, E07		
EC, E11	_	- L -
EC, E20		Loveling feet
EC, E21		Leveling foot
		Linearity
End block		Lo
Error code		Lower limit value 45
error1		
error2		- M -
Ethernet interface		Main unit cover 6
External dimensions	65, 66	Maximum 22
_		Maximum19, 22, 37
- F -		Maximum display
FAST	26	MID
Function table		Manimum 22
FX <i>i</i> -02		Minimum19, 22
FX <i>i</i> -08		Minimum 100% reference mass 65
FX <i>i</i> -09		Minimum unit mass
FX <i>i</i> -WP-10		Minimum weighing value
FX <i>i</i> -WP-11		MODE key11, 12, 14
		MT format
- G -		WT 101111at
- 0 -		- N -
GLP		- 14 -
GLP output27, 29, 30	, 36, 46	NET indicator11
Grounding terminal	6	NU format37, 42
		Number of data19, 37
- H -		
Hald Hold function	35, 38	

- O -	Stabilization time65		
ON:OFF key11, 32	Standard deviation19, 22, 37		
Operating environment65	Standby indicator 11, 39		
operating environment	5ERF Statistical function mode output items 20, 37		
- P -	Statistical calculation mode 19, 20, 37, 44		
	Statistical function mode output items37		
pan boss6, 9	5 <i>L</i> - <i>b</i> Stability band width35, 38		
Pan support6	Stop bit51		
Parity51	Stream mode		
<u>=CS</u> 16	SUM19, 22, 37		
Percent Mode18	_		
Permit32	- T -		
Pnt Decimal point35, 39	Tare15, 16, 18, 25		
Poff Auto display-OFF35, 39	Terminal cover6, 8, 58		
P-an Auto display-ON35, 39	Terminator37		
PRINT key11, 14	Timeout37		
Printer52, 64	Title block48		
Processing indicator11	Transmission form51		
Programmable unit50	Transmission rate51		
Prt Data output mode36, 52	Transmission system51		
PUSE Data output pause36, 52	Łrc Zero tracking35		
	<i>E-UP</i> Timeout37		
- R -			
^	ይ ይያ		
	ይ ያ ይ ይ ይ ይ ይ ይ ይ ይ ይ ይ ይ ይ ይ ይ ይ ይ ይ		
Range22	- U -		
	- U -		
Range	<i>- U -</i> Underhook49		
Range       22         Range       19, 22, 37         Remote controller       64         Remote display       64	<i>- U -</i> Underhook49 Units11, 12, 14		
Range	- <i>U</i> -  Underhook		
Range	<i>- U -</i> Underhook49 Units11, 12, 14		
Range	- <i>U</i> -  Underhook		
Range	- <i>U</i> -  Underhook		
Range       22         Range       19, 22, 37         Remote controller       64         Remote display       64         Repeatability       65         Response indicators       11, 26         RE-ZERO key       10, 11         CDISPlay at start       35	- <i>U</i> -  Underhook		
Range       22         Range       19, 22, 37         Remote controller       64         Remote display       64         Repeatability       65         Response indicators       11, 26         RE-ZERO key       10, 11         CDI       Display at start       35         RS-232C       51, 53         RSCom       54	- <i>U</i> -  Underhook		
Range       22         Range       19, 22, 37         Remote controller       64         Remote display       64         Repeatability       65         Response indicators       11, 26         RE-ZERO key       10, 11         rn□       Display at start       35         RS-232C       51, 53	- U -  Underhook		
Range       22         Range       19, 22, 37         Remote controller       64         Remote display       64         Repeatability       65         Response indicators       11, 26         RE-ZERO key       10, 11         CDI       Display at start       35         RS-232C       51, 53         RSCom       54	- U -  Underhook		
Range       19, 22, 37         Remote controller       64         Remote display       64         Repeatability       65         Response indicators       11, 26         RE-ZERO key       10, 11         □□□□       Display at start       35         RS-232C       51, 53         RsCom       54         RsKey       54	- U -  Underhook		
Range       22         Range       19, 22, 37         Remote controller       64         Remote display       64         Repeatability       65         Response indicators       11, 26         RE-ZERO key       10, 11         CDI       Display at start       35         RS-232C       51, 53         RsCom       54         RsKey       54         SAMPLE key       11, 14	- U -  Underhook		
Range	- U -  Underhook		
Range       22         Range       19, 22, 37         Remote controller       64         Remote display       64         Repeatability       65         Response indicators       11, 26         RE-ZERO key       10, 11         COL       Display at start       35         RS-232C       51, 53         RSCom       54         RSKey       54         - S -       SAMPLE key       11, 14         Som       54         Standard deviation       22         Sensitivity drift       65	- <i>U</i> -  Underhook		
Range	- <i>U</i> -  Underhook		
Range	- <i>U</i> -  Underhook		
Range	- <i>U</i> -  Underhook		
Range	- <i>U</i> -  Underhook		

# MEMO
